

Butte Falls, Oregon  
March 17, 1970

Jackson County Surveyor  
Court House  
Medford, Oregon

Revised 8-70.

Dear Sir:

Pertaining to Recorded Survey # 3919.



NARRATIVE: Discovered following written discrepancies on Plat while tying relocated Obenchain County Road survey to coordinates of Butte Falls Cemetery survey. Monuments and measurements remain the same in the field.

Correct tie  $W\frac{1}{4}$  corner Section 5 to Sta. 00+00.00 (center-line County Road at West boundary) is;  
South 2529.02 feet  
East 3682.03 feet

Correct tie  $W\frac{1}{4}$  corner Section 5 to Sta. 2+00.00 (PT 27+82.31) is;  
South 2480.75 feet  
East 3876.12 feet Bearing is  $S57^{\circ}22'50''E$  4602.01 feet.

Correct tangent bearing P.C. 19+75.15 to Butte Falls Hiway;  
 $S21^{\circ}33'W$

Curve length; 807.16' RP - 807.63' Hiway.

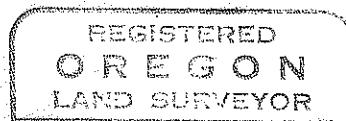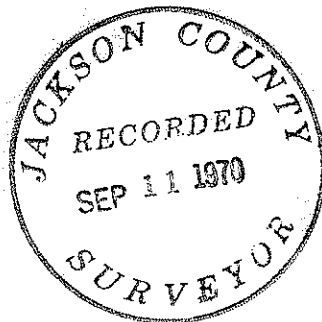

*Duane A. Smeltzer*

