


MAP OF SURVEY  
FOR  
ROGUE RIVER NATIONAL FOREST  
P.O. BOX 520  
MEDFORD, OREGON  
SEPTEMBER 18, 1987

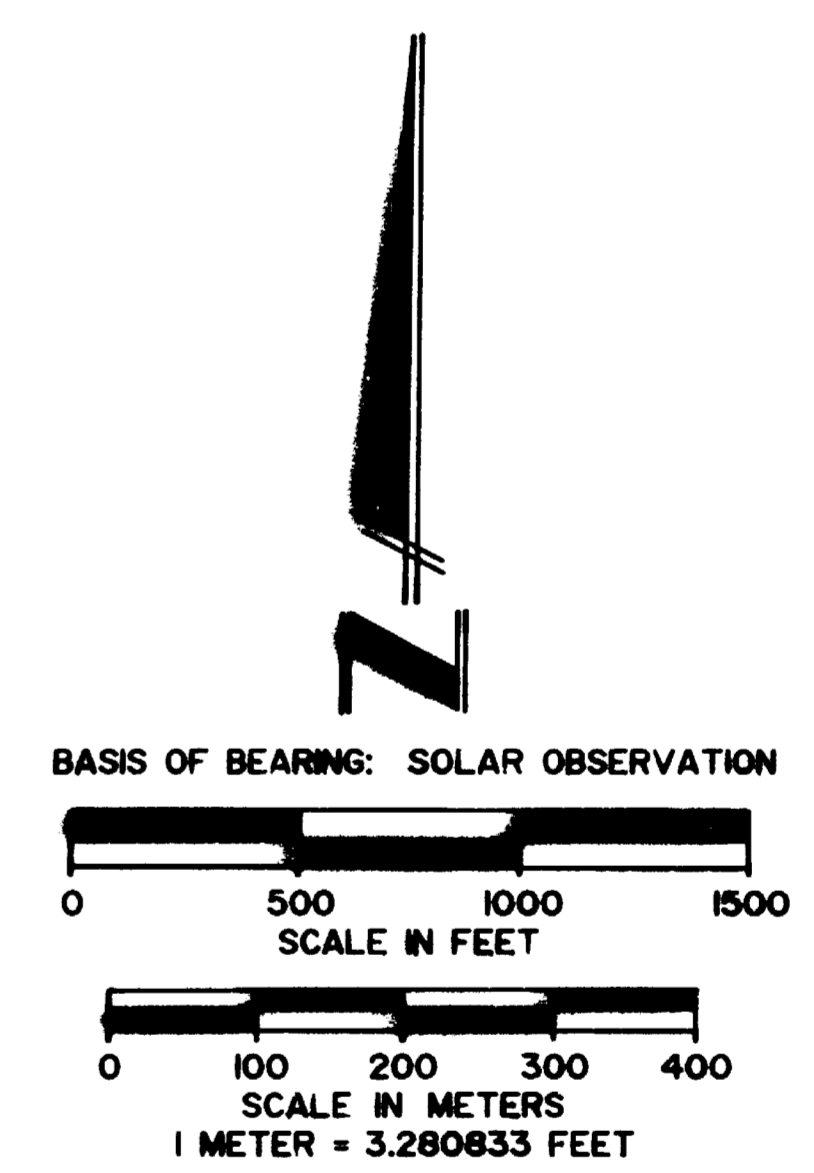

**HISTORY OF SURVEYS**

THE ORIGINAL SUBDIVISION OF TOWNSHIP 39 SOUTH, RANGE 1 WEST, W.M., WAS SURVEYED BY RUFUS S. MOORE UNDER CONTRACT NO. 475 DATED JULY 3, 1883.

THE ORIGINAL SUBDIVISION OF TOWNSHIP 39 SOUTH, RANGE 1 EAST, W.M. (SECTIONS 19 AND 30) WAS SURVEYED BY ORMAND FLETCHER UNDER CONTRACT NO. 663 DATED MAY 21, 1896.

THE NORTH BOUNDARY OF SECTION 26 WAS RESURVEYED BY L.E. AGER, P.L.S. NO. 21, DURING JACKSON COUNTY RECORD SURVEY NO. 3375 DATED FEBRUARY 20, 1967.

THE SOUTH BOUNDARY OF SECTION 26 WAS RESURVEYED BY HAROLD L. CENTER, P.L.S. NO. 1071, DURING JACKSON COUNTY RECORD SURVEY NO. 3926 DATED MARCH 9, 1984.

THE GOLDEN FLEECE EXTENSION (LOCATED IN SECTION 23 NEAR THE NORTHWEST CORNER SECTION 26) WAS SURVEYED BY C. FRANK RHODES, U.S. DEPUTY MINERAL SURVEYOR, UNDER MINERAL SURVEY NO. 758 DATED OCTOBER 18-19, 1942. CORNERS G.F.E. 1 AND G.F.E. 2 WERE REMONUMENTED FROM ORIGINAL EVIDENCE BY THE JACKSON COUNTY SURVEYOR ON FEBRUARY 3, 1977.

THE BUREAU OF LAND MANAGEMENT DIVISION OF CADASTRAL SURVEYS REMONUMENTED FROM ORIGINAL EVIDENCE THE CORNERS INDICATED ON THIS PLAT AT VARIOUS TIMES IN 1972, 1973 AND 1976.

NO OTHER SURVEYS ARE OF RECORD.

**NOTES**

1. BASIS OF BEARING WAS WEST 1/2 OF SOUTH BOUNDARY SECTION 26, REFERENCE R.S. 3926.
2. THESE LINES WERE NOT INCLUDED IN THE TRAVERSE ADJUSTMENT FOR THIS SURVEY. WHEN BEARINGS AND DISTANCES FROM R.S. 3926 ARE INCLUDED, THERE IS A SMALL ENCLOSURE IN THE SOUTHEAST 1/4 SECTION 26 OF 0.4 FEET.

**CERTIFICATE OF SURVEY**

I, HAROLD L. CENTER, REGISTRATION NO. 1071 REGISTERED PROFESSIONAL LAND SURVEYOR, STATE OF OREGON, HEREBY CERTIFY THAT THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH LAWS OF THE STATE OF OREGON, AT THE REQUEST OF THE U.S. FOREST SERVICE.

RECEIVED  
Date: 10/15/87 By: [Signature]  
This survey consists of:  
1 sheet(s) Map  
11 page(s) Narrative  
JACKSON COUNTY SURVEYOR

REGISTERED PROFESSIONAL LAND SURVEYOR  
[Signature]  
JACKSON COUNTY SURVEYOR

- LEGEND**
- BUREAU OF LAND MANAGEMENT BRASS CAP MONUMENT
  - MONUMENT ESTABLISHED THIS SURVEY
  - ◆ JACKSON COUNTY SURVEYOR BRASS CAP MONUMENT MINERAL SURVEY NO. 758 (GOLDEN FLEECE EXTENSION)
  - 5/8-INCH DIAMETER IRON PIN FOUND, R.S. 3375
  - PROPERTY BOUNDARY POSTED AND BLAZED THIS SURVEY
  - - - CALCULATED LINE FROM TRAVERSE SURVEY
  - [ ] GOVERNMENT RECORD
  - N.F.S.L. NATIONAL FOREST SYSTEM LANDS
  - U.S.D.A./B.L.M. UNITED STATES DEPARTMENT OF INTERIOR/BUREAU OF LAND MANAGEMENT

PROJECT NO. 87-8

U.S. DEPARTMENT OF AGRICULTURE  
FOREST SERVICE  
REGION 6 - ROGUE RIVER NATIONAL FOREST

DEPENDENT RESURVEY  
AND  
SECTION SUBDIVISION  
SECTION 26, T.39S., R.1W., W.M.  
JACKSON COUNTY, OREGON

REVIEWED BY: [Signature] DATE: 10/17/87  
REVIEWED BY: [Signature] DATE: 10/17/87

and mark the following accessories:

A 12-inch diameter fir bears N.45°29'E., 13.98 feet distance, scribed  
W 1/16 S23 LS1071 BT.

A 12-inch diameter fir bears S.51°42'E., 44.50 feet distance, scribed  
W 1/16 S26 LS1071 BT.

The center one-quarter corner for Section 26, Township 39 South, Range 1 West,  
W.M.

At the corner point, I set a 2½-inch diameter by 32-inch long iron post 26  
inches in the ground, with a 2½-inch diameter brass cap marked:

T39S R1W  
C 1/4 — S26  
1987  
LS 1071

and mark the following accessories:

A 12-inch diameter fir bears S.37°54'W., 12.60 feet distance, scribed  
C 1/4 S26 LS1071 BT.

A 7-inch diameter fir bears N.80°50'E., 24.10 feet distance, scribed X BT.

The center-west one-sixteenth corner for Section 26, Township 39 South, Range 1  
West, W.M.

At the corner point, I set a 2½-inch diameter by 32-inch long iron post 29  
inches in the ground, with a 2½-inch diameter brass cap marked:

T39S R1W  
W 1/16  
C ——— C  
S26  
1987  
LS 1071

and mark the following:

A 17-inch diameter fir bears N.18°00'E., 49.82 feet distance, scribed  
CW 1/16 S26 LS1071 BT.

A 13-inch diameter fir bears S.54°15'W., 32.03 feet distance, scribed  
CW 1/16 S26 LS 1071 BT.

and the following accessories:

A fir stump, size indeterminate, bears N.17°52'W., 11.90 feet distance, with scattered remains of a rotted face on ground.

A 34-inch diameter fir bears S.41°46'W., 6.95 feet distance, with a healed blaze.

A 32-inch diameter fir bears N.80°31'W., 28.30 feet distance, with a healed blaze.

CORNERS ESTABLISHED THIS SURVEY

The one-quarter corner for Sections 23 and 26, Township 39 South, Range 1 West, W.M.

At the corner point, I set a 2½-inch diameter iron post 32 inches in the ground, with a 2½-inch diameter brass cap marked:

T39S R1W  
1/4  $\frac{S23}{S26}$   
1987  
LS 1071

and mark the following accessories:

A 13-inch diameter fir bears S.22°16'W., 56.20 feet distance, scribed 1/4S26 LS1071 BT.

A 9-inch diameter fir bears N.31°19' E., 17.45 feet distance, scribed 1/4 S23 LS1071 BT.

NOTE: A 5/8-inch diameter iron pin bears N.20°19'26"E., 120.04 feet distance. Refer to R.S. #3375.

The west one-sixteenth corner for Sections 23 and 26, Township 39 South, Range 1 West, W.M.

At the corner point, I set a 2½-inch diameter, by 12-inch long iron post, 18 inches in the ground, on north edge of ditch on Wagner Gap road, with a 2½-inch diameter brass cap marked:

T39S R1W  
W 1/16  $\frac{S23}{S26}$   
1987  
LS 1071

The section corner for Sections 24 and 25, Township 39 South, Range 1 West; and Sections 19 and 30, Township 39 South, Range 1 East, W.M.

At the corner point, I found a standard Bureau of Land Management brass cap monument protruding 3 inches above ground beside a 2-ft. x 2-ft. x 2-ft. granite boulder, marked:

US DEPT OF INTERIOR  
DO NOT DISTURB  
T39S  
R1W | R1E  
S24 | S19  
S25 | S30  
1972  
CADASTRAL SURVEYS  
BUR OF LAND MANAGEMENT

and the following accessories:

A 16-inch diameter fir bears S.35°53'E., 22.87 feet distance, with a healed blaze.

A 12-inch diameter fir bears S.55°10'W., 10.80 feet distance, with a healed blaze.

An 18-inch diameter fir bears N.77°28'W., 25.23 feet distance, with a healed blaze.

A 13-inch diameter fir bears N.56°14'E., 6.30 feet distance, with a healed blaze.

The one-quarter corner for Sections 19 and 30, Township 39 South, Range 1 East, W.M.

At the corner point, I found a standard Bureau of Land Management brass cap monument protruding 6 inches above ground, marked:

US DEPT OF INTERIOR  
DO NOT DISTURB  
T39S R1E  
1/4 S19  
S30  
1976  
CADASTRAL SURVEY  
BUR OF LAND MANAGEMENT

3. A Jackson County monument marked:

JACKSON COUNTY  
MS 759  
GFE 2 |  
1977

bears N.88°37'48"E., 687.50 feet distance. Monument found 6 inches below surface of Wagner Gap road.

The one-quarter corner for Sections 26 and 27, Township 39 South, Range 1 West, W.M.

At the corner point, I found a standard Bureau of Land Management brass cap monument, marked:

US DEPT OF INTERIOR  
DO NOT DISTURB  
T39S R1W  
1/4  
S27 | S26  
1973  
CADASTRAL SURVEYS  
BUR OF LAND MANAGEMENT

and the following accessories:

A 9-inch diameter fir bears N.61°17'E., 40.05 feet distance, with a healed blaze.

A 32-inch diameter sawed fir stump bears S.15°33'W., 15.50 feet distance, with scribing BT visible on an open blaze.

A 7-inch diameter fir bears S.15°33'W., 35.70 feet distance, with a healed blaze.

A 10-inch diameter broken madrone bears N.14°50'E., 26.22 feet distance, with scribing 1/4S visible.

NOTE: A 1-inch diameter iron pipe protrudes 3 inches above ground, alongside monument.

The section corner for Sections 22, 23, 26 and 27, Township 39 South, Range 1 West, W.M.:

At the corner point, I found a standard Bureau of Land Management brass cap monument protruding 6 inches above ground, marked:

US DEPT OF INTERIOR  
DO NOT DISTURB  
T39S R1W  

|     |     |
|-----|-----|
| S22 | S23 |
| S27 | S26 |

  
1973  
CADASTRAL SURVEYS  
BUR OF LAND MANAGEMENT

and the following accessories:

A 6-inch diameter oak bears S.50°48'W., 6.30 feet distance, with a healed blaze.

A 9-inch diameter oak bears N.59°50'W., 20.35 feet distance, with a healed blaze.

A madrone, size indeterminate, bears N.48°17'E., 26.80 feet distance. This tree is hollow and decayed.

An 8-inch diameter madrone bears N.53°55'E., 29.30 feet distance, with fragmentary scribing visible. This tree is dead.

A 14-inch diameter fir bears S.62°44'E., 32.90 feet distance, with a healed blaze.

A pine, size indeterminate, bears S.25°42'E., 26.20 feet distance, with fragmentary scribing visible on a loose face.

An 11-inch diameter pine bears N.66°08'E., 27.50 feet distance.

NOTES:

1. An inverted Jackson County Surveyor monument bears South, 0.25 feet distance.
2. A Jackson County monument marked:

JACKSON COUNTY  
MS 758  

|      |
|------|
| GFE1 |
|------|

  
1977

bears N.80°49'45"E, 89.20 feet distance.

and the following accessories:

A 29-inch diameter fir bears N.15°36'W., 22.10 feet distance, with a healed blaze.

A 19-inch diameter fir bears S.84°52'E., 39.13 feet distance, with a healed blaze.

The section corner for Sections 23, 24, 25 and 26, Township 39 South, Range 1 West, W.M.

At the corner point, I found a standard Bureau of Land Management brass cap monument protruding 3 inches above ground, marked:

US DEPT OF INTERIOR  
DO NOT DISTURB  
T39S R1W  
S23 | S24  
S25 | S26  
1972  
CADASTRAL SURVEYS  
BUR OF LAND MANAGEMENT

and the following accessories:

A 20-inch diameter fir snag approximately 20 feet tall bears N.45°16'W., 22.30 feet distance, with fragmentary scribing visible on an open blaze.

A 12-inch diameter fir snag approximately 10 feet tall bears N.42°55'W., 2.20 feet distance, with scribing T39S R1W S23 BT visible.

A fir, size indeterminate, bears N.49°46'E., 13.70 feet distance, with scribing T39S R1W S24 BT visible. This tree is dead and down.

An 18-inch diameter fir bears N.49°50'E., 23.90 feet distance, with a healed blaze.

A fir stub, size indeterminate, bears S.39°12'E., 27.40 feet distance, with scribing 1WS25 visible.

A 13-inch diameter fir bears S.07°53'E., 14.80 feet distance, with a healed blaze.

A 10-inch diameter fir bears S.48°50'W., 17.30 feet distance, with a healed blaze.

A 7-inch diameter sawed-off fir stump bears S.26°33'E., 23.90 feet distance, with fragmentary scribing visible on a partly-healed blaze.

NOTE: There is a 1-inch diameter iron pipe alongside monument, protruding 12 inches above ground.

The one-quarter corner for Sections 26 and 35, Township 39 South, Range 1 West, W.M.

At the corner point, I found a standard Bureau of Land Management brass cap monument protruding 6 inches above ground in a small ring of stone, marked:

US DEPT OF INTERIOR  
DO NOT DISTURB  
T39S R1W

1/4  $\frac{S26}{S35}$   
1972

CADASTRAL SURVEYS  
BUR OF LAND MANAGEMENT

and the following accessories:

A 41-inch diameter pine bears N.28°50'W., 29.20 feet distance, with a healed blaze.

A 13-inch diameter fir bears S.37°43'E., 5.40 feet distance, with a healed blaze.

A 13-inch diameter madrone bears S.57°41'W., 8.50 feet distance, with a healed blaze.

The one-quarter corner for Sections 25 and 26, Township 39 South, Range 1 West, W.M.

At the corner point, I found a standard Bureau of Land Management brass cap monument protruding 3 inches above ground in a small ring of stone, marked:

U.S. DEPT OF INTERIOR  
DO NOT DISTURB  
T39S R1W

1/4  
S26 | S25  
1972

CADASTRAL SURVEYS  
BUR OF LAND MANAGEMENT



With all controlling corners verified or established, I computed the subdivision of Section 26 and ran a series of closed traverses, establishing temporary positions for the west one-sixteenth corner for Sections 23 and 26, the center one-quarter corner for Section 26, and the center-west one-sixteenth corner for Section 26. I then calculated moves and set monuments at each location, as described later in this narrative.

Offsets were calculated from random to true line. Property lines, as indicated on the attached plat, were posted with six-foot aluminum posts, with National Forest 54-2 signs attached. Trees along the line were blazed and painted with red timber-marking paint.

**BASIS OF**

**BEARING:** Solar observation reference R.S. #9926

**EQUIPMENT**

**UTILIZED:** Wild T-2 theodolite, Hewlett-Packard 3808 distance meter,  
SOKKISHA Red 2-L distance meter.

**CORNERS ACCEPTED FOR CONTROL**

The section corner for Sections 26, 27, 34 and 35, Township 39 South, Range 1 West, W.M.

At the corner point, I found a standard Bureau of Land Management brass cap monument protruding 4 inches above ground, marked:

U.S. DEPT OF INTERIOR  
DO NOT DISTURB  
T39S R1W  
S27 | S26  
S34 | S35  
1973  
CADASTRAL SURVEYS  
BUR. OF LAND MANAGEMENT

and the following accessories:

A 15-inch diameter fir bears S.34°27'W., 12.05 feet distance, with a healed blaze.

A 17-inch diameter fir bears N.36°32'W., 32.90 feet distance, with a healed blaze.

A 13-inch diameter fir bears N.74°07'E., 13.70 feet distance, with a healed blaze.

An 8-inch diameter fir bears S.69°21'E., 13.70 feet distance, with a healed blaze.

The Golden Fleece extension lode (located near the northwest corner Section 26) was surveyed by C. Frank Rhodes, U.S. Deputy Mineral Surveyor, under Mineral Survey No. 758, dated October 18-19, 1912. Corners No. 1 and No. 2 were remonumented from original evidence by the Jackson County Surveyor on February 3, 1977. (Note: See attached plat for the location of these two corners.)

The south line of Section 26, and the south  $\frac{1}{2}$  of the east line Section 26 was dependently resurveyed by Professional Land Surveyor No. 1071 during Jackson County Surveyor Records File No. 9926, dated March 9, 1984.

No other surveys are of record.

PROCEDURE: Prior to commencement of this survey, an investigation of all controlling section and one-quarter section corner points was made. With the required controlling corners verified (except the north one-quarter corner for Section 26), I established a series of traverse lines, tying all corner points to part of a closed traverse. From this data, search areas were computed for the original north one-quarter corner for Section 26, and the north one-quarter corner for Section 25. After an extensive investigation of both lost corner positions, no conclusive original evidence could be found.

At the north one-quarter corner for Section 26 location, a 5/8-inch diameter iron pin was found N.20°19'26"E., 120.04 feet distance from the calculated proportioned position. This iron pin is consistent in what L. E. Ager used for monuments in 1967. The Bureau of Land Management, Division of Cadastral Surveys, found Ager's "proportioned iron pin," for the west one-quarter corner for Section 23, not to be acceptable and set their own monument in 1973. I contacted George R. Burrill, R.L.S. No. 638, who has Surveyor Ager's field notes for the area in question. Ager's notes state that he could find no original evidence for the south one-quarter corner and, therefore, set a 5/8-inch diameter iron pin at mid point, on true line for the one-quarter corner for Sections 23 and 26. No accessories were marked by Ager. Blazes dating to 1883 were discovered west of Wagner Creek. Using these blazes and the topographic calls of Rufus Moore, an extensive search was made for the original one-quarter corner. No original evidence could be found. Therefore, I set the one-quarter corner for Sections 23 and 26 by proportionate measurement, on true line.

At the north one-quarter corner for Section 25 location, an extensive search was made using the topographic calls of Rufus Moore and the proportionate distances along the section line. Blazes were found north of line, dating to 1908. An old location poster (K-TAG) was found at the search area. No original evidence could be found of the one-quarter corner for Sections 24 and 25. Therefore, I set a monument by proportionate measurement on true line.

SURVEY NARRATIVE TO COMPLY WITH  
PARAGRAPH 209.250 OREGON REVISED STATUTES

SURVEY FOR: Rogue River National Forest  
P. O. Box 520  
Medford, OR 97501

LOCATION: Sections 25 and 26, Township 39 South, Range 1 West; and Section 30,  
Township 39 South, Range 1 East, Willamette Meridian, Jackson County,  
Oregon.

PURPOSE: To establish property corners and mark and post the boundaries between  
National Forest and private lands within Sections 25, 26, and Section 30.

HISTORY OF: The original subdivision of Township 39 South, Range 1 West, W.M., was  
SURVEYS surveyed by Rufus S. Moore under Contract No. 475, dated July 3, 1883.

The original subdivision of Township 39 South, Range 1 East (Sections 19  
and 30) was surveyed by U.S. Deputy Surveyor Ormond Fletcher under  
Contract No. 663, dated May 21, 1896.

The Bureau of Land Management, Division of Cadastral Surveys, remonu-  
mented the following corners from original evidence:

1972 - Township 39 South, Range 1 West, W.M.

1. Northeast Section Corner for Section 25
2. Northeast Section Corner for Section 26
3. One-quarter Corner for Sections 25 and 26
4. One-quarter Corner for Sections 26 and 35

1973 - Township 39 South, Range 1 West, W.M.

1. Northwest Section Corner for Section 26
2. One-quarter Corner for Sections 26 and 27
3. Southwest Section Corner for Section 26

1976 - Township 39 South, Range 1 East

1. One-quarter Corner for Sections 19 and 30

The south boundary of Section 23 (north boundary Section 26) was depen-  
dently resurveyed by L. E. Ager, Professional Land Surveyor No. 21,  
during Jackson County Surveyor Records File No. 3375, dated February 20,  
1967. Surveyor Ager established the one-quarter corner for Sections 23  
and 26 by proportionate measurement. (Note: See description of this  
corner under "corners established this survey," and diagram on the  
attached plat.)