

1/4 cor.
Secs. 35 & 36
Fd. 1" iron pipe

1/4 cor.
Sec. 36, T.36S.R.2W.
Sec. 31, T.36S.R.1W.
Set 1" iron pipe

Ctr. 1/4 cor.
Set 5/8" iron pin
from County R.Ps.

N. 89° 53' 40" W.

1324.20'

North line of the SE 1/4 of the SE 1/4 of Sec. 36
N. 89° 48' 40" W. 364.08'

South 1/16 Sec. cor.

Survey For:
CHARLES MICHELSEN
Located in the S.E. 1/4
of Sec. 36, T.36S.R.2W.
By: Mark E. Boyden
Nov. 1958.



Scale: 1" = 100'

- ⊙ Re-estab. Gov't. cor.
- Set 3/4" iron pipe
- Set 5/8" iron pin

South 1293.66'

1106.20'

N. 0° 10' 10" W.

S. 89° 43' 40" E. 207.00'

N. 0° 10' 10" W.
188.00'

188.00'

Fd. 1/2" iron pin


16091'

207.00'

N. 89° 43' 40" W.

30.0'

S.S.E. cor. Sec. 36
Fd. iron pin

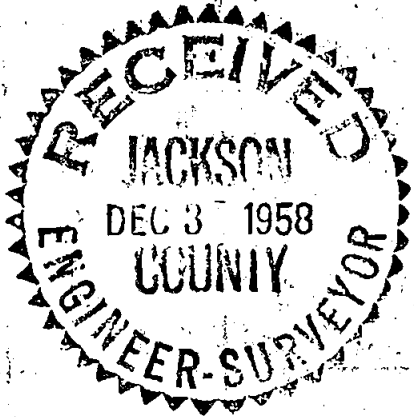

East 1/16 Sec. cor.
Sec. 36, T.36S.R.2W.
Sec. 1, T.37S.R.2W.
Fd. nail set from
County R.Ps.

EAST VILAS ROAD

BIDDLE ROAD

REGISTERED
OREGON
LAND SURVEYOR

Mark E. Boyden
NOVEMBER 9 1958
MARK E. BOYDEN
281

Survey Narrative to Comply With Paragraph 209.250
Oregon Revised Statutes

For: Charles Michelsen

PURPOSE: To monument the Michelsen property described in Jackson County Deed Records Volume 437, Page 97 in two parcels as directed, being located in the Southeast 1/4 of the Southeast 1/4 of Section 36, Township 36 South, Range 2 West.

PROCEDURE: Established the position of the South one-sixteenth section corner between Section 36, Township 36 South, Range 2 West and Section 31, Township 36 South, Range 1 West by a proportionate measurement between the re-established East 1/4 corner and the Southeast corners of Section 36.

The bearing for the North line of the South half of the Southeast Quarter was established by turning the angles at the East 1/4 corner and Southeast corners of said Section 36 to sectional controls as shown on the attached map.

The West property line was established due North and 368.00 feet Westerly from the Southeast corner of Section 36 as per deed record.

Meridian control was of solar origin as established on the survey of ORR SUBDIVISION.

November 1958

