## SURVEY NARRATIVE TO COMPLY WITH PARAGRAPH 209.250 OREGON REVISED STATUTES

SURVEY FOR:

Rogue River National Forest

P. O. Box 520 Medford, OR 97501

LOCATION:

Sections 14, 15, 22 and 23, Township 30 South, Range 3 East, Willamette Meridian, Jackson County,

Oregon.

BASIS OF BEARING:

Original northeast bearing tree.

PURPOSE:

To preserve and protect the section corner common to Sections 14, 15, 22 and 23, I referenced the corner prior to road construction. Upon completion of work in the area, I remonumented said corner as per the attached Certified Record of Land Corner


Remonumentation.

DATE:

July 17, 1984

HAROLD L. CENTER Registered Professional Land Surveyor Oregon Certificate No. 1071.



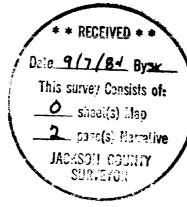

## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: This corner was originally established by Herbert N. Raymond, U.S. Cadastral Engineer, under special

instructions dated September 9, 1927, Group No. 125.

DIAGRAM
T30S R3E
S15 S14
S22 S23
LS 1071
1984

Description of corner evidence found:

At the corner point I found a 2 inch diameter iron pipe with a  $3\frac{1}{2}$  inch diameter brass cap exposed 12 inches above the ground in a mound of stone. From which the following references:

Fir 14-inches in diameter, bears N51°E, 57.1 feet, with a healed blaze. (Record N51°E, 58.1 feet)

Fir 26-inches in diameter, bears S15\*28'E, 24.6 feet, with a healed blaze. (Record S16\*E, 25.1 feet)

Fir 44-inches in diameter, bears S22\*49'W, 22.7 feet, with a healed blaze. (Record S21\* 23.1 feet)

Fir snag 36-inches in diameter, bears N69\*50'W, 15.4 feet, with scribing partially visible. (Record N71\*W, 15.8 feet)

Description of monument and accessories I established to perpetuate the original location of this corner:

At the exact corner point I set a  $2V_2$  inch outside diameter, 30 inch long galvanized iron pipe with a  $2V_2$  inch diameter brass cap marked as shown in the corner diagram, 23 inches in the ground, in a mound of stone. Corner lies on the southerly edge of an old skid road. From which the following references:

Douglas-fir 11-inches in diameter, bears N70°41'E, 100.2 feet, marked "T30SR3ES14 LS1071" on upper face and "BT" on lower face.

Iron pin 5/8 inches by 30 inches, flush with the ground with a  $1\frac{1}{2}$  inch aluminum cap, marked RM  $\frac{14}{23}$ , bears S81\*48'00"E, 235.92 feet.

Incense-cedar 16-inches in diameter, bears S27°41'W, 35.7 feet, marked "T30SR3ES22 LS1071" on upper face and "BT" on lower face.

Iron pin 5/8 inches by 30 inches, with a  $1\frac{1}{2}$  inch aluminum cap marked RM  $\frac{15}{22}$ , flush with the ground, bears N48°58°14°W, 164.18 feet.

July 17, 1984

Basis of Bearing: Original northeast bearing tree.

## RECEIVED \*\*

Date 9/1/64 By Sk

This survey Consists of:

O sheet(s) Map

2 page(s) Narrative

JACKSON COUNTY
SURVEYOR