
N.F.S.L.

NATIONAL FOREST SYSTEM LANDS

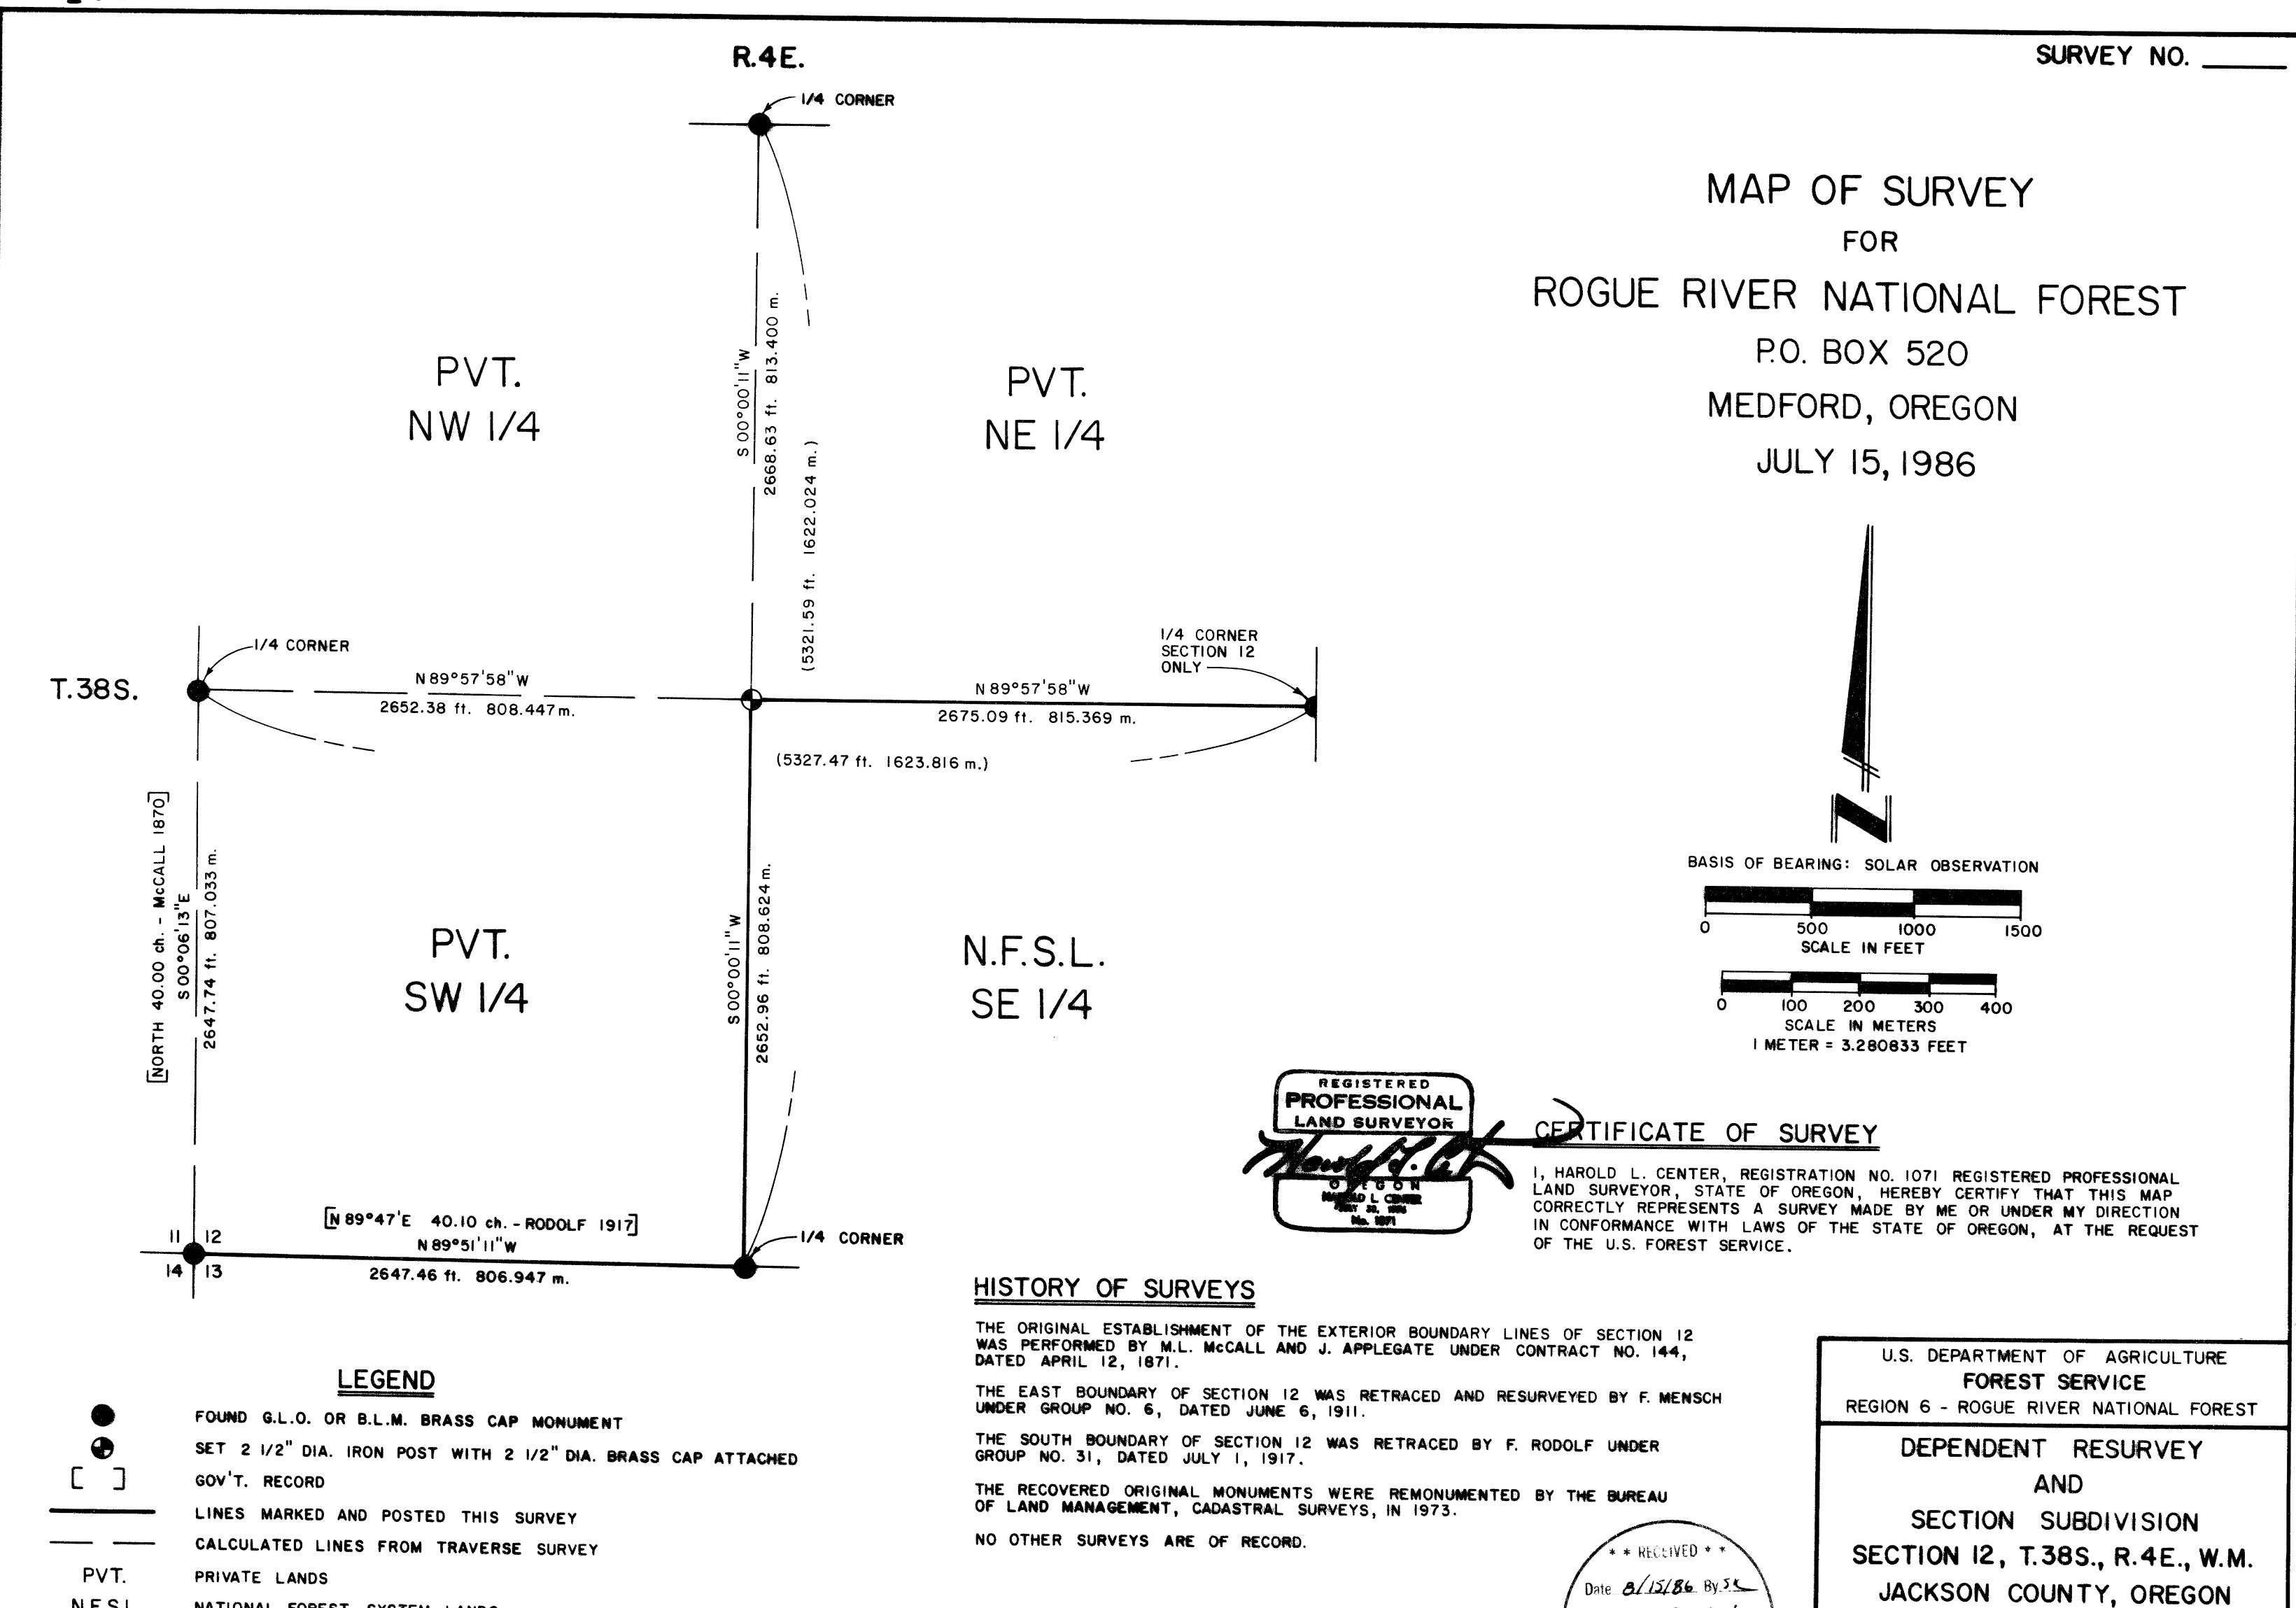

PROJECT NO. 86-2

REVIEWED BY: Thunk Bell DATE: 6/166

REVIEWED BY: Living DATE: 8/13/86

This survey Consists of:

1_ sheet(s) Map

CHECK THE

re (c) hardlive

SURVEY NARRATIVE TO COMPLY WITH PARAGRAPH 209.250 OREGON REVISED STATUTES

SURVEY FOR:

Rogue River National Forest

P. 0. Box 520 Medford, OR 97501

LOCATION:

Located in Section 12, Township 38 South, Range 4 East, Willamette Meridian, Jackson County, Oregon.

PURPOSE:

To subdivide Section 12, set monuments, and mark and post the boundaries between National Forest and private lands within said Section 12.

BASIS OF BEARING:

Solar observation

PROCEDURE:

Prior to commencement of this survey, an investigation of all controlling corners necessary to subdivide this section was made.

With all required corner points recovered and verified, I performed a closed traverse tying said controlling monuments to my closed traverse. From this data I calculated the subdivision of Section 12, set the required center one-quarter corner, and marked and posted all necessary property boundaries utilizing calculated off-sets from my random to

true line.

Property lines were posted with aluminum posts with National Forest boundary signs attached. Trees along the property line were blazed and painted with red timber marking paint.

EQUIPMENT USED:

This survey was performed utilizing a Wild T-2 Theodolite and a Sokkisha Red 2L Distance Meter.

CORNERS ACCEPTED FOR CONTROL

One-quarter corner for Sections 1 and 12, Township 38 South, Range 4 East, Willamette Meridian, Jackson County, Oregon.

At the corner point, I found a standard Bureau of Land Management monument marked:

U.S. Dept. of Interior Unlawful to Disturb T38S R4E

1/4 S12

1973

Cadastral Surveys
Bureau of Land Management

And the following accessories:

A 17-inch diameter fir bears S.46°24'W., 91.00 feet distance, with a healed blaze.

A 40-inch diameter fir bears N.19°04'W., 8.25 feet distance, with no visible marks on an opened, decayed face.

A 10-inch diameter fir bears N.14°42'E., 45.50 feet distance, with a healed blaze.

One-quarter corner for Sections 11 and 12, Township 38 South, Range 4 East, Willamette Meridian, Jackson County, Oregon.

At the corner point, I found a standard Bureau of Land Management monument marked:

U.S. Dept. of Interior Unlawful to Disturb T 38S R 4E

Cadastral Surveys
Bureau of Land Management

And the following accessories:

A 33-inch diameter fir bears N.09°49'W., 8.70 feet distance, with a healed blaze.

A 12-inch diameter fir bears $N.60^{\circ}02'E.$, 20.60 feet distance, with a healed blaze.

A root hole bears S.45°00'W., 23.00 feet distance, with scribing BT found on a dead and down fir next to root hole.

Section corner for Sections 11, 12, 13 and 14, Township 38 South, Range 4 East, Willamette Meridian, Jackson County, Oregon.

At the corner point, I found a standard General Land Office monument marked:

U.S. General Land Office
Survey
T 38 S R 4 E

S11 S12
S14 S13

1973 1917

And the following accessories:

A 21-inch diameter fir bears N.30°14'E., 59.30 feet distance, with a healed blaze.

A 30-inch diameter sawed fir stump bears N.39°36'E., 11.10 feet distance, with no visible marks.

A 7-inch diameter pine bears S.20°52'E., 38.60 feet distance, with scribing T38 R4E S 13 BT visible on a pitch face.

A 21-inch diameter pine bears S.53°40'W., 27.00 feet distance, with scribing S R4E S14 visible on an open blaze.

A 22-inch diameter pine bears N.20°15'W., 22.60 feet distance, with a healed blaze.

One-quarter corner for Sections 12 and 13, Township 38 South, Range 4 East, Willamette Meridian, Jackson County, Oregon.

At the corner point, I found a standard General land Office monument marked:

1/4 S12

1917

And the following accessories:

A 20-inch diameter fir bears N.36°52'W., 30.60 feet distance, with a healed blaze.

A 38-inch diameter fir bears $N.56^{\circ}36'E.$, 25.00 feet distance, with a healed blaze. This tree now dead and has a broken top.

A 17-inch diameter fir bears S.63°15'E., 45.35 feet distance, with a healed blaze.

East one-quarter corner for Section 12 only, Township 38 South, Range 4 East, Willamette Meridian, Jackson County, Oregon.

At the corner point, I found a standard Bureau of Land Management monument marked:

U.S. Dept. of Interior Unlawful to Disturb T38S 1/4 S 12

R4E 1973

Cadastral Surveys
Bureau of Land Management

And the following accessories:

An 18-inch diameter fir bears S.36°45'W., 27.40 feet distance, with a healed blaze.

A 45-inch diameter sawed fir stump bears S.60°49'W., 19.20 feet distance, with a healed blaze.


A 28-inch diameter pine bears N.63°00'W., 7.70 feet distance, with scribing /4 S12 BT visible on an open blaze.

A 28-inch diameter pine bears S.36°59'E., 11.00 feet distance, with a healed blaze. (Note: scribing was reported as being destroyed by F. Mensch in 1911.)

CORNER ESTABLISHED THIS SURVEY

Center one-quarter for Section 12, Township 38 South, Range 4 East, Willamette Meridian, Jackson County, Oregon.

At the corner point, I set a $2\frac{1}{2}$ inch diameter by 30 inch long iron post with a $2\frac{1}{2}$ inch diameter brass cap monument marked:



And mark the following accessories:

A 9-inch diameter fir bears N.23°14'W., 10.65 feet distance. Scribed C1/ α S12 LS1071 BT.

A 6-inch diameter pine bears N.43°11'E., 33.70 feet distance. Scribed X BT.

July 15, 1986

HAROLD L. CENTER Registered Professional Land Surveyor Oregon Certificate No. 1071 PROFESSIONAL LAND SURVEYOR

* * RECEIVED * *

Date 8/15/86 By 5K

This survey Consists of:

______ sheet(s) Map

______ page(s) Narrative

JACKSON COUNTY
SURVEYOR