


10847

E 1/6 COR. SECS. 21/28, FD.
5/8" I. ROD & 2 B.T.'S AS
SET IN SURV. NO. 10030.

21 | 22
28 | 27



2604.98'

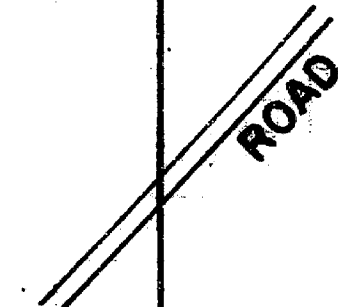

NOTES:

BEARING BASIS = E-W C. OF SEC.28
PER SURVEY NO. 4861.

THIS SURVEY & MAP WAS COM-
-PLETED FOR THE EXCLUSIVE USE
OF CHARLES INMAN.

SEPARATE NARRATIVE ACCOMPANIES
THIS MAP.

C. INMAN

** RECEIVED **

Date 4/9/87 By SK

This survey consists of:

- sheet(s) Map
- page(s) Narrative

JACKSON COUNTY
SURVEYOR

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert M. Thompson

OREGON
SEPTEMBER 23, 1917
ROBERT M. THOMPSON
1358

N 00°14'54"W

CTR. 1/4 COR. AS SET IN SURV.
NO.3058, FD. 1" G.I. PIPE EXP 2",
1 B.T., B.T. STUB; SCRIBED
NEW B.T.

CE 1/6 COR., SET 5/8" I. ROD
W/YEL. CP MKD. "THOMPSON",
SCRIBED 2 B.T.'S.

1/4 COR. SECS. 28 & 27, FD. B.L.M.
1971 BR. CAP IN 2" G.I. PIPE,
2 O.B.T.'S, 1966 & 1971 B.T.'S.

SEC
28

S 89°36'00"E 1341.84'

S 89°36'00"E 1341.84'

SURVEY OF SOUTH & WEST LINES OF THE C. INMAN PROPERTY
THE E 1/2 NE 1/4 OF SECTION 28, T 35S, R3W, W.M., JACKSON CO., ORE.

SCALE: 1 INCH = 200 FEET

JANUARY 10, 1987.

ROBT. M. THOMPSON & ASSOC.

35 3W 28

10847

SURVEY OF SOUTH & WEST LINES OF THE C. INMAN PROPERTY,
THE E $\frac{1}{2}$ NE $\frac{1}{4}$ OF SECTION 28, T35S, R3W, W.M., JACKSON CO., OR.

Narrative Description to comply with Par. 209.250 O.R.S.

For: Charles Inman, 814 Hillview Drive, Ashland, OR 97520.

By: Robert M. Thompson & Assoc., 1140 Acacia Lane, Grants Pass, OR 97527.

Note: Separate map sheet accompanies this narrative.

Purpose: To set CE1/16 corner, and mark the true South and West boundaries of the E $\frac{1}{2}$ NE $\frac{1}{4}$.

Procedure:

My previous Survey Nos. 3058 and 4861 had "crossed out" Section 28 between opposite Quarter Corners, setting the center Quarter Corner. My Survey No. 10030 had set the East 1/16 Corner for Sections 21/28. The East half of the East-West Center Line was surveyed, setting the Center East 1/16 Corner at its proportioned position, from which a survey was run northward to said East 1/16 Corner for Sections 21/28. The true South and West lines of said E $\frac{1}{2}$ NE $\frac{1}{4}$ were then marked with red-painted blazes and red flagging. Bearings are based on the record of Survey No. 4861 for said East-West Center Line. Corners found or set are as follows:

$\frac{1}{4}$ Corner Sections 28 & 27, found B.L.M. 1971 br. cap on 2" G.I. Pipe, and B.T.'s, meas. to ctr.:

- 20" Yel. Pine S 85°E 42.9' (O.B.T.), opened "B.T." scribe visible
- 20" B. Oak N 60°W 11.9' (O.B.T.), rotted upper face
- 12" D. Fir S 77 $\frac{1}{2}$ °W 29.9' (rec. 28.8'), healed faces, 1966
- 8" D. Fir N 69°E 9.8' (rec. 10.2'), healed faces, 1971

CE 1/16 Corner Sec. 28, set 5/8" I. Rod w/Yel. cap mkd. "Thompson", scribed "CE 1/16 S28 1358 BT" on trees meas. to ctr.:

- 10" Madronna N 25°E 29.2'
- 9" W. Oak S 85°E 21.55'

Center $\frac{1}{4}$ Corner Sec. 28, found Surv. No. 3058 1" G.I. Pipe and 1966 B.T.'s, meas. to ctr.:


- 11" Madronna S 52 3/4°W 29.3', scribe vis.
- 5" B. Oak S 2°E 21.8', a dead stub, scribe vis.
- Scribed new B.T. "C $\frac{1}{4}$ S28 1358 BT" on:
- 11" Madronna S 87°E 22.7'

From cor. point on old 2" steel tubing (at cor. of fences brg. S'ly & W'ly) bears N 1°49 3/4'W 43.25'

East 1/16 Corner Secs. 21/28, found Surv. No. 10030 5/8" I. Rod w/Yel. cap mkd. "Thompson", & 1984 B.T.'s meas. to ctr.

- 9" Madronna N 14°W 18.7', scribe vis.
- 11" D. Fir S 77 $\frac{1}{2}$ °E 10.2', scribe vis.

January 10, 1987

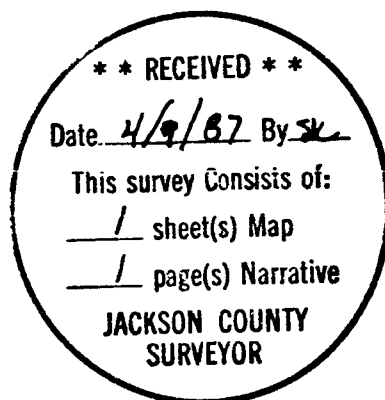

Robert M. Thompson

