


of the subject property by a maximum approximate amount of 20 feet. There is also a wood frame shed belonging to the property owner to the South encraoching this boundary.



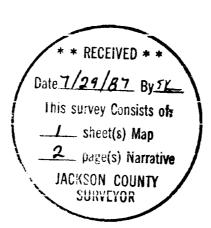

MARK E. BOYDEN RPLS ORE 281

108 MISTLETOE ST., MEDFORD, OREGON 97501 PHONE (503) 773-6000

GARY D. KAISER RPLS ORE 803

SURVEY NO. 10934

SURVEY NARRATIVE TO COMPLY WITH O.R.S. 209.250

SURVEY FOR:

ARLIN STAFFORD

5599 Pleasant Creek Road Rogue River, Oregon, 97537

SURVEY BY:

BOYDEN SURVEYORS 108 Mistletoe Street Medford, Oregon, 97501

LOCATION:

SW 1/4 of Section 22, T.34S., R.4W., W.M.,

Jackson County, Oregon

BASIS OF BEARINGS: Filed Survey No 8136 (Dept. of Public Works "D" line tangent South 22° 33' 46" West, 1100.80 feet). 6 solar observations were taken, the mean of which checked the basis

of bearings within 0° 01' 30".

DATE:

July 24, 1987

PURPOSE:

To monument the Northerly and the Southerly boundaries of that tract described in Inst. No. 85-18465 O.R. Also to set witness corners

referencing the approximate westerly boundary

of said tract.

## PROCEDURE:

Utilizing E.D.M. equipment, traversed between the East and West 1/4 corners to Section 22. The 5/8" rebar set for the center East 1/16 corner and the 5/8" rebar set as a witness corner to the center West 1/16 corner on Filed Survey No. 8136 were tied, the center 1/4 corner was searched for and not found. Also traversed around the subject property.

The Northerly, Southerly and approximate Westerly boundaries of the subject tract were computed and monumented as shown on the annexed map.

A fence belonging to the property owner to the South and adjacent to the subject property encroaches the South boundary