

SURVEY NARRATIVE to comply with O.R.S. 209.250

DATE: August 11, 1989.

SURVEYED FOR: Boise Cascade Corporation
P.O. Box 100
Medford, Oregon 97501

SURVEYED BY: Gerald V. Nygren
522 Barker Drive
Merlin, Oregon 97532

LOCATION: Section 29, Township 37 South, Range 3 West,
Willamette Meridian, Jackson County, Oregon.

PURPOSE: To subdivide said Section 29 and monument the
Northeast One-sixteenth corner, the East and West
One-sixteenth corners on the North line, and blaze
and tag the South and West lines of the Northeast
Quarter of the Northeast Quarter and the North line
of the Northwest Quarter of the Northwest Quarter.

PROCEDURE: I traversed from the Northwest corner of said Section
29 to the Northeast corner of said Section 29, both
were monumented by BLM in 1966 and the Northeast
corner was re-monumented by the Jackson County
Surveyor's Office in 1989. At a point which bears
South 58°41' West, 57.26 feet, from the computed
position for the Quarter corner common to Sections
20 and 29, I found a 2" diameter wood stake, from
which bears:

A 30" dia. Madrone with lower interior rotted
away, N34°W, 19.1 feet, (Rec. = N40°W, 27 Lks.),
with BLM location tag set in 1965 by RWG/AHA.

A Madrone root collar, S21½°W, 24.4 feet,
(Rec. = S7°W, 37 Lks.), with BLM location tag
set in 1965 by RWG/AHA.

A 8" D. Fir, S65°W, 29.6 feet (not scribed)
with BLM location tag set in 1982 by HH.

A 10" D. Fir, N20°E, 28.3 feet (not scribed)
with BLM location tag set in 1982 by HH.

(Continued on page 2)

(Continued from page 1)

On August 8, 1989, Ron Frost and Steve Beecher, both from the Jackson County Surveyor's office, inspected the evidence I found and surmised that it was marginal, at best. Ron Frost suggested that I should contact BLM and check the evidence that was found in 1965 and 1982. On August 9, 1989, I conferred with BLM employee, Terry Dickerson, on BLM's status of this corner. He explained that this corner was used for a 1982 administrative survey in Section 20. After examining the 1965 BLM corner notes and the 1982 BLM administrative survey notes, I conclude that the corner evidence is marginal and should not be used to establish the Quarter corner common to Sections 20 and 29. I established this corner by single proportion and set a 5/8" X 24" iron rod with yellow plastic cap marked "NYGREN LS 1035", from which bears:

- A 5" Cedar, N14°E, 30.9 Ft. scribed "1/4 S20 BT"
- A 10" D. Fir, S50°W, 13.3 Ft. scribed "1/4 S29 BT"

At the West One-sixteenth corner common to Sections 20 and 29 I set a 5/8" X 24" iron rod with yellow plastic cap marked "NYGREN LS 1035", from which bears:

- A 8" Madrone, S24°E, 50.8 Ft. scribed "W1/16 S29 BT"
- A 5" P. Pine, N12°W, 29.1 Ft. scribed "X BT"

At the East One-sixteenth corner common to Sections 20 and 29 I set a 5/8" X 24" iron rod with yellow plastic cap marked "NYGREN LS 1035", from which bears:


- A 5" D. Fir, S30°W, 4.8 Ft. scribed "E1/16 S29 BT"
- A 14" Madrone, East, 12.8 Ft. bark scribed "E1/16 S29 BT"
- A 2" X 2" wood stake with BLM ref. trees, S57°W, 27.9 Ft.

At the Northeast One-sixteenth corner of Section 29 I set a 5/8" X 24" iron rod with yellow plastic cap marked "NYGREN LS 1035", from which bears:

- A 7" B. Oak, S72°W, 26.3 Ft. scribed "NE1/16 S29 BT"
- A 5" B. Oak, N33°E, 24.4 Ft. scribed "NE1/16 S29 BT"

Bearings are based on Survey No. 11562

A Wild T-16 theodolite and MAC 15 EDM were used to execute this survey.

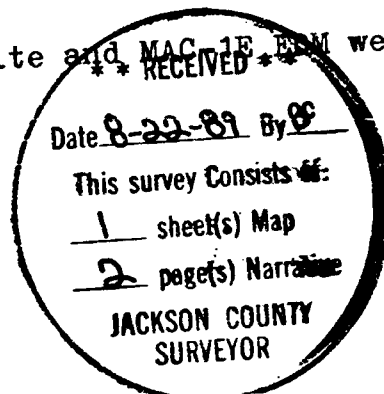

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
GERALD V. NYGREN
AUGUST 22, 1975
1035