
Tax Lot 35-4W-17-1400

SE ¼ SI7 T35S R4W W.M.



CERTIFICATE OF SURVEY


I, ARTHUR R. RAMBO, REGISTRATION No. 1086
REGISTERED PROFESSIONAL LAND SURVEYOR
STATE OF OREGON, HEREBY CERTIFY THAT
THIS MAP CORRECTLY REPRESENTS A SURVEY
MADE BY ME OR UNDER MY DIRECTION IN
CONFORMANCE WITH THE LAWS OF THE
STATE OF OREGON.

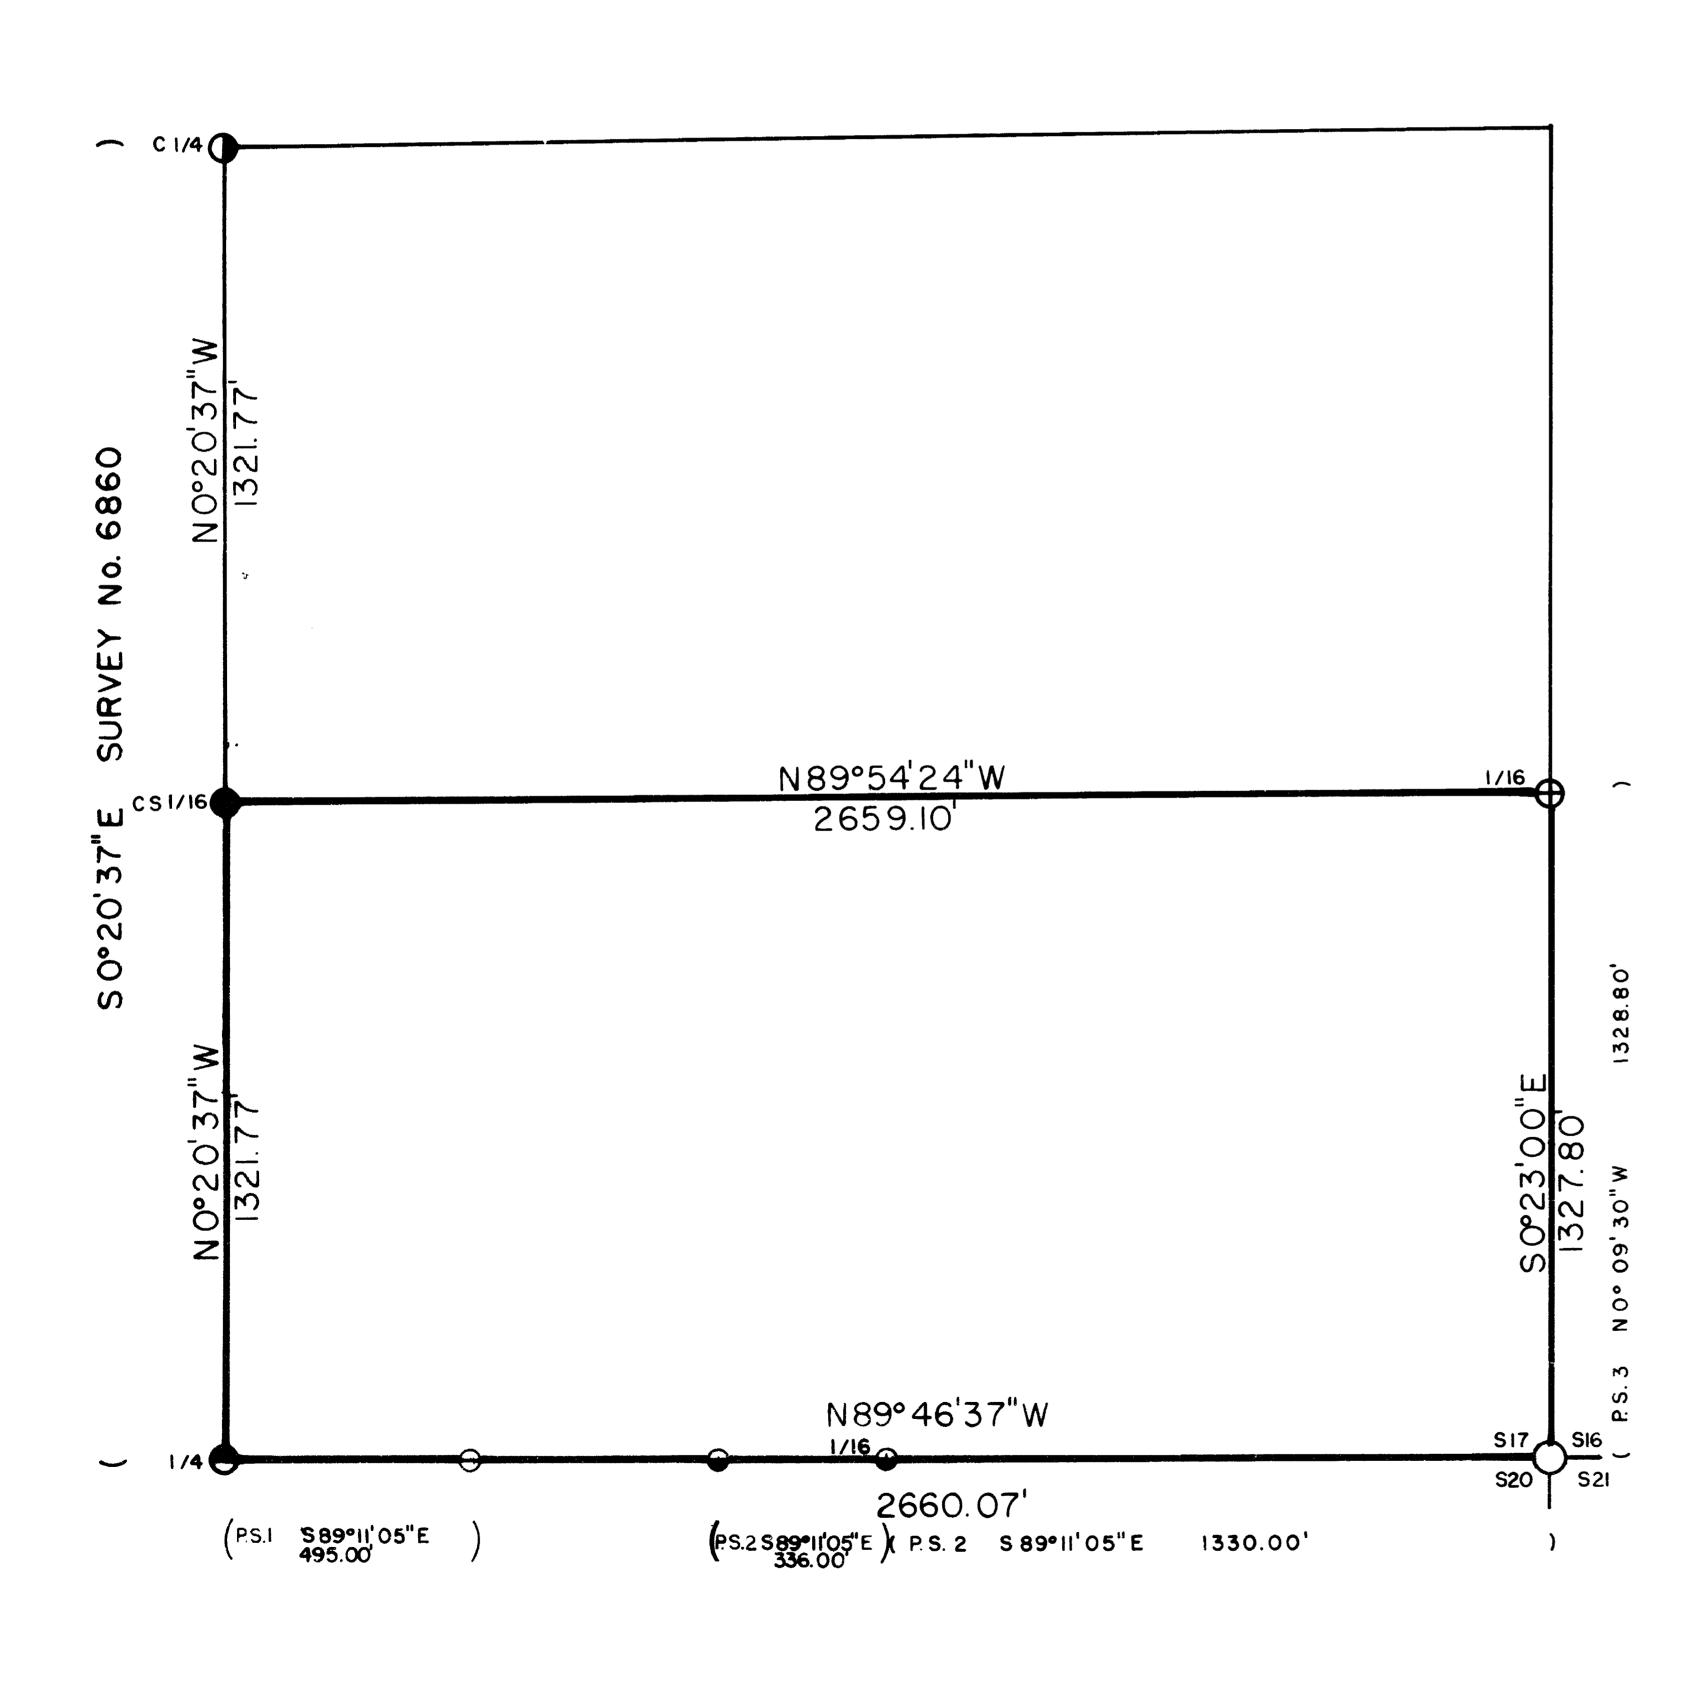

LEGEND

- O FOUND STANDARD B.L.M. MONUMENT
- FOUND COUNTY MONUMENT
- FOUND MONUMENT SET SURVEY No. 6860
- FOUND MONUMENT SET SURVEY No. 4183
- SET 5/8" BY 30" REBAR WITH 2" ALUM. CAP
- FOUND MONUMENT SET SURVEY No. 9795
- FOUND MONUMENT SET SURVEY No. 7318
- PS. I PRIVATE SURVEY No. 7318
- P.S. 2 PRIVATE SURVEY No. 9795
- PS. 3 PRIVATE SURVEY No. 4183

LINES POSTED AND BLAZED THIS SURVEY

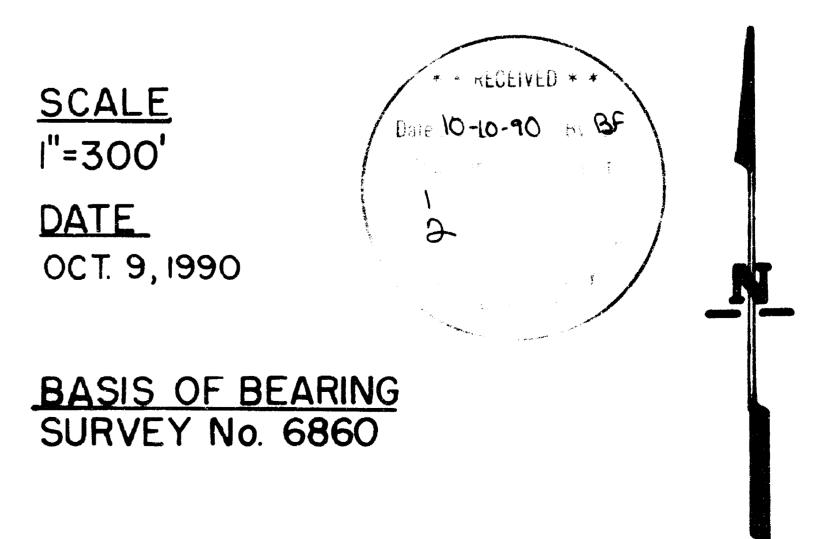

Survey Narrative to Comply With O.R.S. 209.250

Location:

Section 17 Tpwnship 35 South, Range 4 West, Willamette Meridian, Jackson County, Oregon.

Survey For:

Medford Corporation

P.O. Box 550

Medford, Oregon 97501

Survey By:

Arthur R. Rambo 735 Vista Park Drive

Eagle Point, Oregon 97524

Date:

October 9, 1990

Basis of Bearing:

Survey No. 6860 (N/S Centerline Section 17)

Purpose:

To mark and post the boundries of Medco land in the South half of the Southeast quarter of said Section 17 as shown on the plat to accompany

this narrative.

Procedure:

closed traverse survey was performed, beginning at the center ½ corner, proceeding to the South ½ corner, then to the Southeast Section corner, then to the South 1/16 corner common to Section 16 and 17, then West closing the survey back to the Center 1/2 corner. The Centersouth 1/16 corner was calculated and set by proportionate measurement. Lines marked and posted are shown on the plat to accompany this narrative.

CORNERS FOUND AND ACCEPTED FOR CONTROL

All measurements to bearing trees are to the center of tree at base unless otherwise stated.

Center one-quarter corner Section 17 I found a 5/8" iron pin set survey number 6860.

One-quarter corner common to Section 17 and 20 I found a Jackson County monument buried 11 inches marked:

T35S R4W 17 20 1974

From which:

A $21\frac{1}{2}$ inch Dia. Cedar Bears S6°33'43"W 26.3 feet, with an unoprned face.
A 24 inch Dia. Madrona Bears N38°22'13"E
67.0 feet marked with an unopened face.

Section corner common to Sections 16, 17, 20, and 21. At the corner location I found a standard Bureau of Land Management monument at ground level marked:

and the modern of the companion of the c

Page 2 of 2

T35S R4W S17 S16 S20 S21

1961

From which:

A 2½ inch Dia. pipe exposed 8 inches Bears North and against monument.
A 25½ inch Dia. Oak Bears S9°42'56"E 25.2 feet, with unopened face.
A 23 inch Dia. Fir Stump Bears S87°54'07"W 58.5 feet, with unopened face.
A 16½ inch Dia. Oak Bears N24°23'14"W 34.4 feet with rotted face no scribes visible.
A 23 inch Dia. Oak Bears N71°34'40"E 36.3 feet with unopened face.

South one-sixteenth corner common to Section 17 and 16. At the corner location I found a 5/8" Iron Pin with a tag marked R.S. 705 wired to pin.

From which:

A 14½ inch Dia. Pine stub Bears S24°41'29"E 23.4 feet with opened face no scribes visible.
A 20½ inch Dia. Fir Snag Bears S52°11'04"W 34.4 feet with unopened face.

CORNERS SET THIS SURVEY

All measurements to bearing trees are to the center of tree at the base unless otherwise stated. All bearing trees have a Brass washer stamped LS 1086 nailed to the lower face of tree.

Center South one-sixteenth corner Section 17. At the corner location I set a $1\frac{1}{2}$ inch diameter Alum. cap on a 5/8" by 30" rebar exposed 4 inches marked:

T35S R4W CS . 1/16

LS 1086

From which:

A 9 inch diameter Madrona Bears S46°10'34"W 38.7 feet, marked CS1/16S17 in upper face BT in lower face. An 11 inch diameter Pine Bears N16°30'46"E 19.1 feet, marked CS1/16S17 in upper face BT in lower face.

