

LINN ROAD

589° 55' E. 2033.57' ±

L = 163.21 ±  
E = 746.70'

FD. 5/8" REBAR

FD 5/8" I. PIN  
F.S. # 8720

50° 02' 10" W 390.48'

INST. # 71-12141 O.R.  
59.27 ACRES ±

FD YELLOW CAP ON  
5/8" REBAR HORIZONTAL  
SET 3/8" REBAR / RED  
P. CAP

N89° 44' 50" W 400.00'

FD. YELLOW CAP  
"KAISER"  
F.S. # 8488

INS # 80-01169, O.R.

50° 02' 10" W 500.00'

NW COR. D.L.L. # 46  
FD BR. DISK

W.L.

589° 44' 50" E 256.78'

426.06

50° 08' 15" W

FD 5/8" REBAR  
N0° 18' 40" W 0.55'  
FROM TRUE CORNER

415.54'

FD. YELLOW CAP  
"KAISER"

647.50'

W.L. 75.00' W.L.

406.28'

MEAS. 456.05'  
REL. = 485.56'  
REC. = 480'

N89° 48' 10" W

F.S. # 8738

Survey for

Mrs. Lorene (Nash) Hale  
2075 So. Pacific Hwy.  
Medford, Oregon 97501

Location  
NE 1/4, Sec. 4, T.36S., R.1W., W.M.

Date

June 18, 1991

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

OREGON  
MAY 9, 1984  
MARK E. BOYDEN  
201




North  
Scale: 1" = 100'

Survey by:

Boyden Surveyors  
108 Mistletoe  
Medford, Oregon 97501

Basis of Bearings  
Filed Survey No. 8688

- Legend
- Found Monument as indicated
  - Set 5/8" x 24" Rebar w/plastic cap stamped "BOYDEN RLS 281"
  - ✕ Set 5/8" x 30" Rebar w/plastic cap stamped "BOYDEN RLS 281"

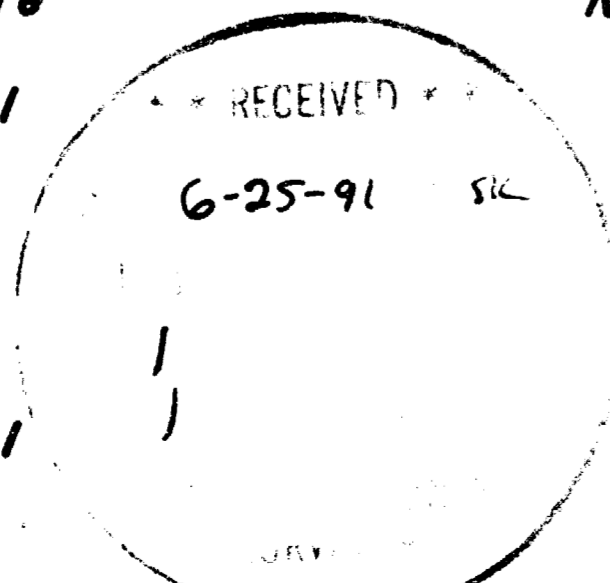

1/4 SEC. COR.  
SECS. 3+4  
FD BR. DISK

SW COR. D.L.L. # 46

FD 6" x 6" CONC.  
MON. / BR. DISK

F.S. # 2080 DEED VOL. 553, Pg. 66

1294.37'  
1294.67'

N0° 18' 40" W  
(REL. = N0° 18' 16" W)



MARK E. BOYDEN  
R.P.L.S. ORE. 281  
108 MISTLETOE ST., MEDFORD, OREGON 97501  
PHONE (503) 773-6000

SURVEY NO. 12566

SURVEY NARRATIVE TO COMPLY WITH O.R.S. 209.250

SURVEY FOR: MRS. LORENE (NASH) HALE  
2075 S. PACIFIC HIGHWAY  
MEDFORD, OREGON 97501

SURVEY BY: BOYDEN SURVEYORS  
108 MISTLETOE STREET  
MEDFORD, OREGON 97501

LOCATION: NE ¼ OF SECTION 4,  
T. 36 S., R. 1 W., W.M.

BASIS OF BEARINGS: FILED SURVEY NO. 8688

DATE: JUNE 18, 1991

PURPOSE: To establish the boundaries of the tract described in Instrument No. 71-12141, O.R.

PROCEDURE: With E.D.M. equipment, enclosed the subject property, tying to monuments set on Filed Survey Nos. 1619, 3080, 3720, 8688 and 8738. Also searched for the location centerline at PI Stations 80 + 39.08 and 104 + 73.57 of Linn Road according to the County Survey of Sept. 1965, but with negative results.

The location of Linn Road as shown on this survey utilized the 5/8" rebar found at the Northeast corner of the tract surveyed on Filed Survey No. 3080 and the Southerly right-of-way P.C. Station 103 + 33.71 as calculated from the position determined on Filed Survey No. 3720. It should be noted that client was not interested in a precise road right-of-way line location and said location was utilized only to close the tract and determine the approximate area thereof.

The monument set for the Southwest corner of the tract monumented on Filed Survey No. 8688 and monument set for the Northeast corner of the tract monumented on Filed Survey No. 8738 were searched for with negative results.

**\*\* RECEIVED \*\***  
Date 6-25-91 By JK  
This survey consists of:  
 plat and Map  
 page(s) Narrative  
JACKSON COUNTY  
SURVEYOR

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR  
*Mark E. Boyden*  
OREGON  
NOV. 9, 1951  
MARK E. BOYDEN  
281