
MAP OF SURVEY LOCATED IN THE WEST HALF OF SEC. 2, TWP. 34 SOUTH, RANGE 3 EAST, WILLAMETTE MERIDIAN

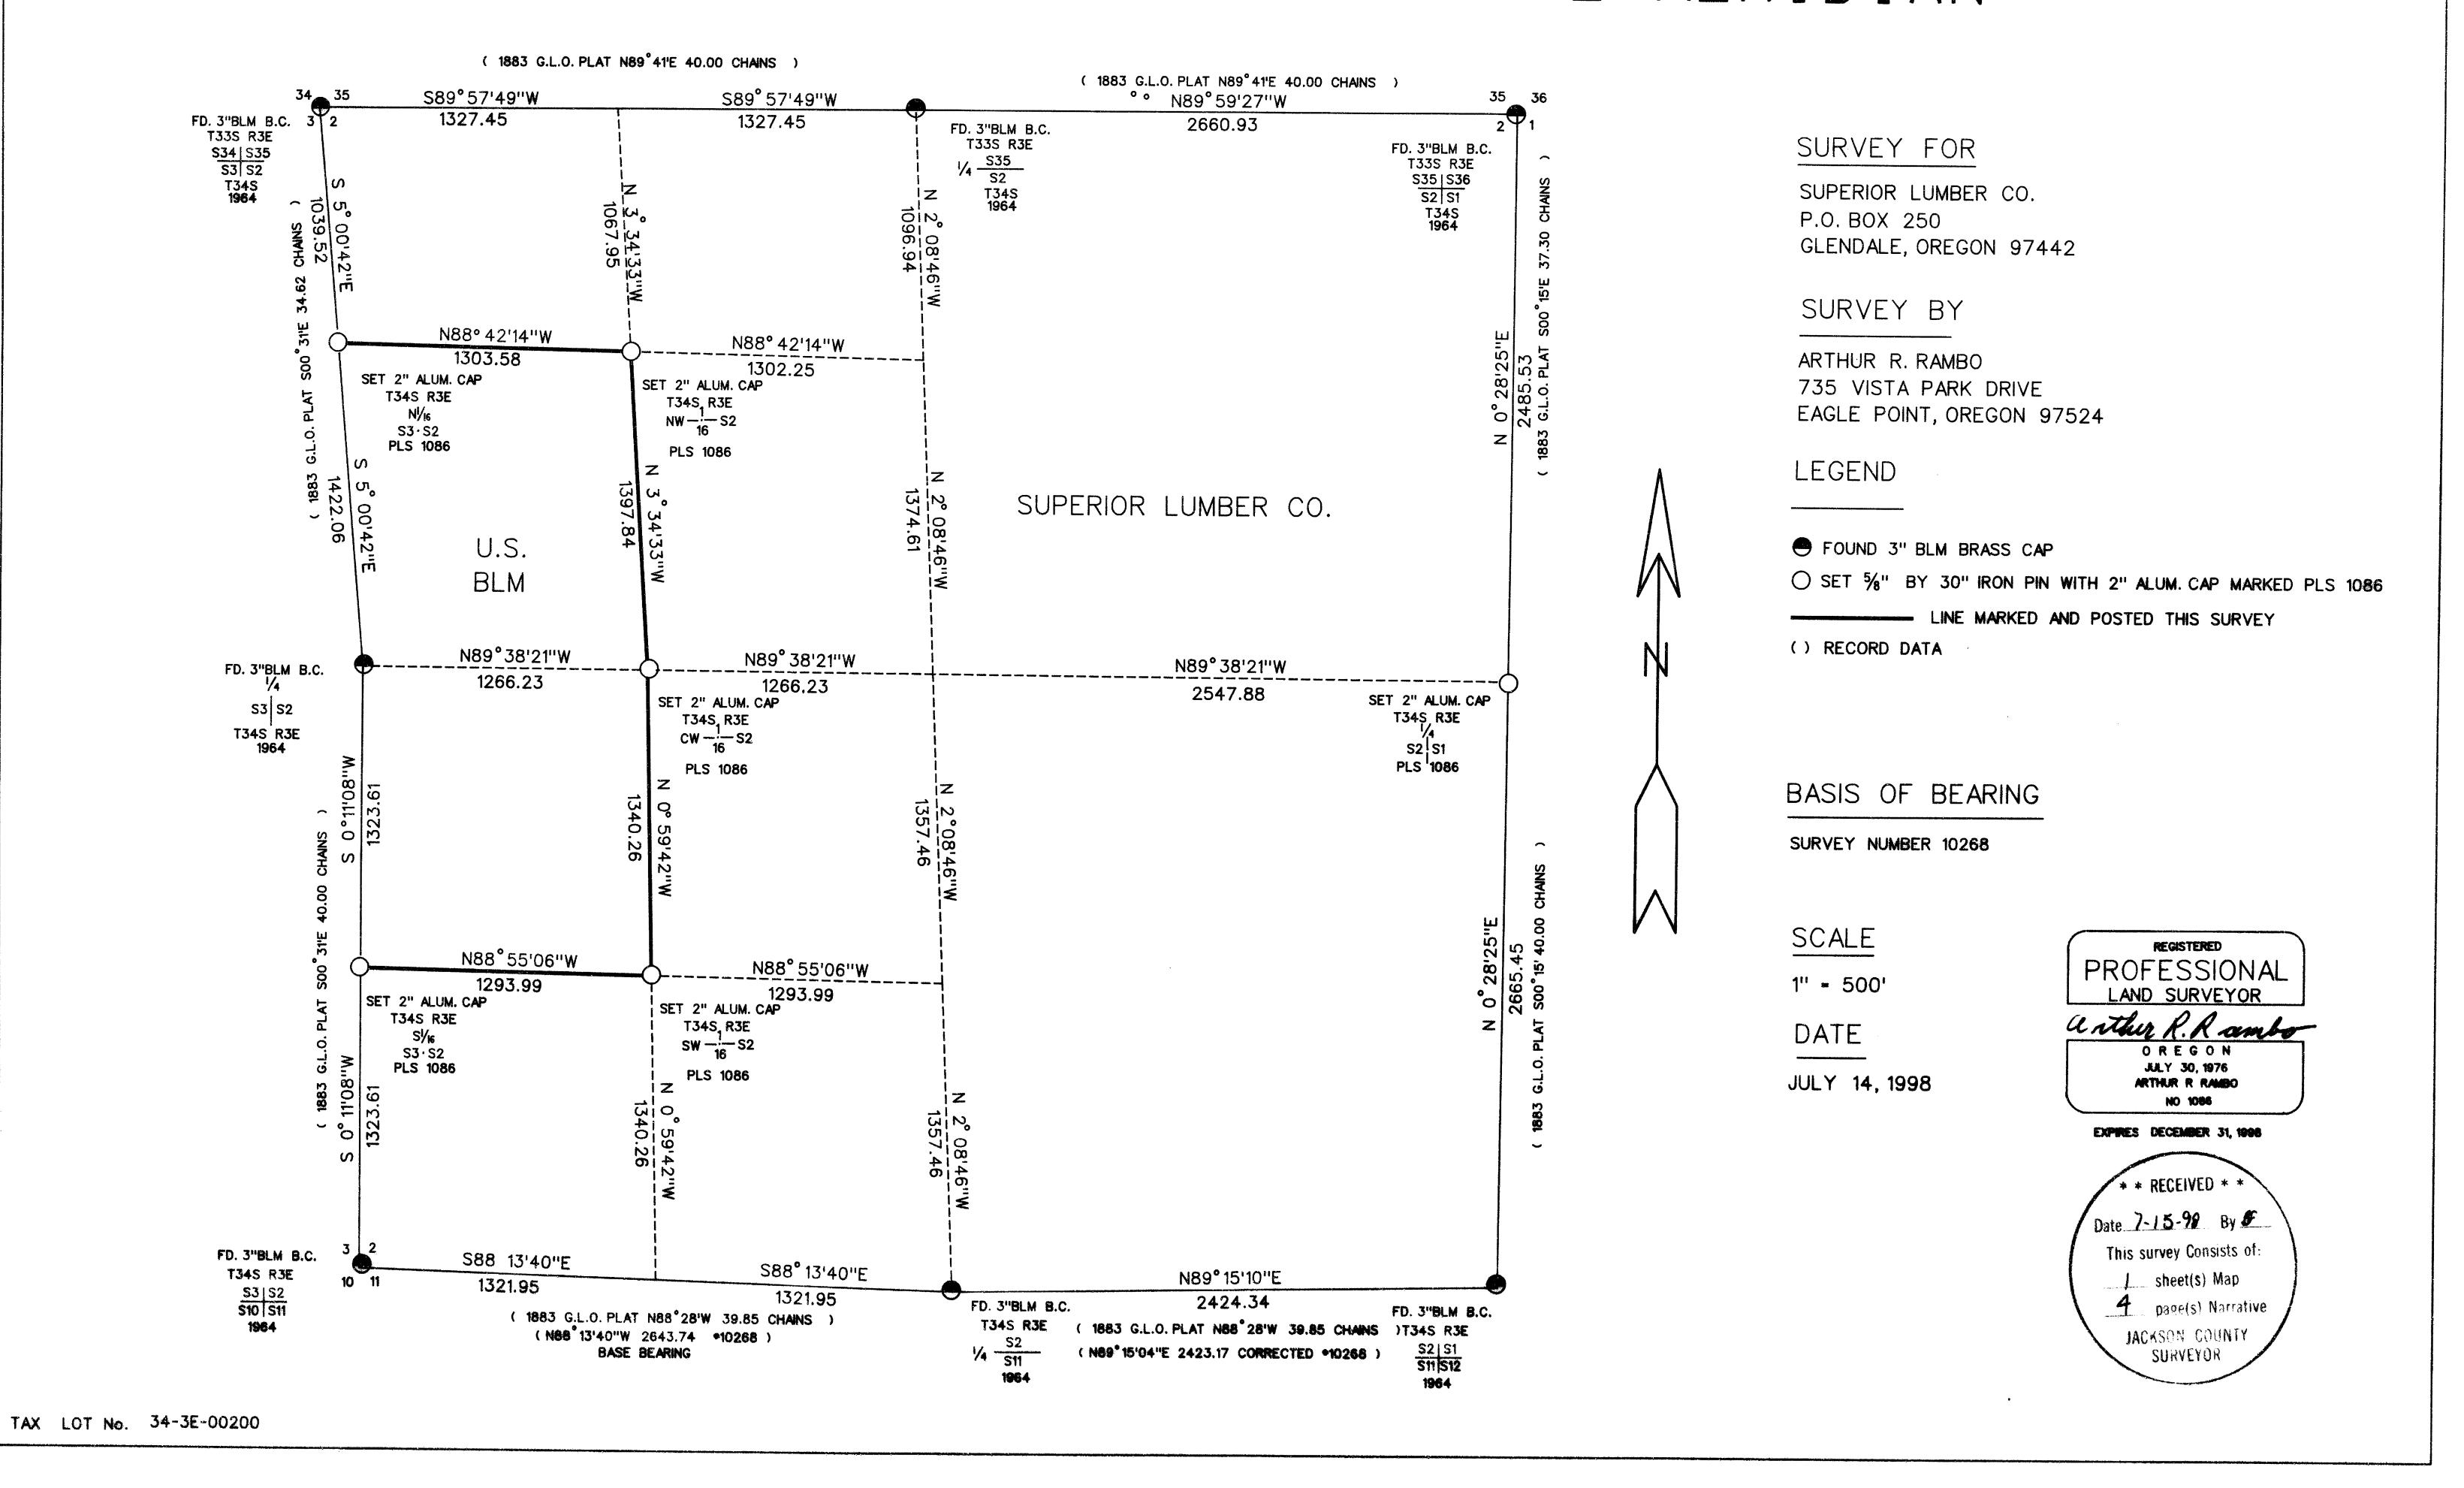


SOUTH ONE-SIXTEENTH CORNER COMMON TO SECTION 2 AND SECTION 3 TOWNSHIP 34 SOUTH RANGE 3 EAST. AT THE CORNER POINT I SET A 5/8" BY 30" IRON PIN WITH A 2" DIAMETER ALUM. CAP MARKED:

FROM WHICH:

A 9 INCH DIAMETER FIR BEARS N84°27′E, 10.9 FEET MARKED S1/16S2 IN UPPER FACE, BT IN LOWER FACE.

A 22 INCH DIAMETER FIR BEARS S15°11'W, 15.1 FEET MARKED S1/16S3 IN UPPER FACE, BT IN LOWER FACE.

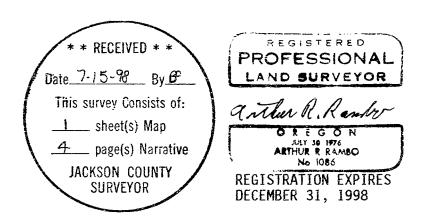

TAX LOT 34-3E-00200

FROM WHICH:

A 7.5 INCH DIAMETER FIR BEARS S40° 36'E, 16.4 FEET MARKED N1/16S2 IN UPPER FACE, BT IN LOWER FACE.

AN 12 INCH DIAMETER FIR BEARS S47° 11'E, 35.8 FEET MARKED N1/16S3 IN UPPER FACE, BT IN LOWER FACE.

NORTHWEST ONE-SIXTEENTH CORNER SECTION 2 TOWNSHIP 34 SOUTH RANGE 3 EAST. AT THE CORNER POINT I SET A 5/8" BY 30" IRON PIN WITH A 2" DIAMETER ALUM. CAP MARKED:

FROM WHICH:

A 14 INCH DIAMETER FIR BEARS S13 01/W, 48.4 FEET MARKED NW1/16S2 IN UPPER FACE, BT IN LOWER FACE.

A 9 INCH DIAMETER FIR BEARS N12° 59'E, 31.6 FEET MARKED NW1/16S8 IN UPPER FACE, BT IN LOWER FACE.

CENTER WEST ONE-SIXTEENTH CORNER SECTION 2 TOWNSHIP 34 SOUTH RANGE 3 EAST. AT THE CORNER POINT I SET A 5/8" BY 30" IRON PIN WITH A 2" DIAMETER ALUM. CAP MARKED:

FROM WHICH:

A 13 INCH DIAMETER FIR BEARS S29 08/W, 19.1 FEET MARKED CW1/16S2 IN UPPER FACE, BT IN LOWER FACE.

A 6.5 INCH DIAMETER FIR BEARS NO3 58'W, 12.9 FEET MARKED CW1/16S2 IN UPPER FACE, BT IN LOWER FACE.

SOUTHWEST ONE-SIXTEENTH CORNER SECTION 2 TOWNSHIP 34 SOUTH RANGE 3 EAST. AT THE CORNER POINT I SET A 5/8" BY 30" IRON PIN WITH A 2" DIAMETER ALUM. CAP MARKED:

T35S R3W

FROM WHICH:

AN 11.5 INCH DIAMETER FIR BEARS N34°04'E, 25.4 FEET MARKED SW1/16S2 IN UPPER FACE, BT IN LOWER FACE.

A 9 INCH DIAMETER FIR BEARS N61°39'W, 42.1 FEET MARKED SW1/16S2 IN UPPER FACE, BT IN LOWER FACE.

FROM WHICH:

I MARK NEW TREE. AN 8.5 INCH DIAMETER HEMLOCK BEARS S11 33'E, 47.1 FEET MARKED 1/4S2 IN UPPER FACE, BT IN LOWER FACE.

AT THE SECTION CORNER COMMON TO SECTION 34 AND 35 TOWNSHIP 33 SOUTH RANGE 3 EAST, AND SECTION 2 AND 3 TOWNSHIP 34 SOUTH RANGE 3 EAST I FOUND A 3" DIAMETER BLM BRASS CAP.

FROM WHICH:

I MARK NEW TREE.
AN 8.5 INCH DIAMETER YEW BEARS N35 26'E,
64.9 FEET MARKED S35 IN UPPER FACE, BT IN
LOWER FACE.
A 9 INCH DIAMETER FIR BEARS S51 20'W,
53.7 FEET MARKED S3 IN UPPER FACE, BT IN
LOWER FACE.

CORNERS SET THIS SURVEY

ALL MEASUREMENTS TO BEARING TREES ARE TO THE CENTER OF TREE AT BASE UNLESS OTHERWISE STATED. BEARING TREES HAVE A BRASS WASHER MARKED LS1086 NAILED TO LOWER FACE.

ONE-QUARTER CORNER COMMON TO SECTION 1 AND SECTION 2 TOWNSHIP 34 SOUTH RANGE 3 EAST. AT THE CORNER POINT I SET A 5/8 BY 30 INCH IRON PIN WITH A 2 INCH DIAMETER ALUM. CAP MARKED:

T34S R3E 1/4 S2 + S1 PLS 1086

FROM WHICH:

A 4.5 INCH DIAMETER FIR BEARS N32 26'W, 38.0 FEET MARKED 1/4S2 IN UPPER FACE, BT IN LOWER FACE.

A 6 INCH DIAMETER FIR BEARS N39 51'E, 29.9 FEET MARKED 1/4S1 IN UPPER FACE, BT IN LOWER FACE.

A 13 INCH DIAMETER FIR BEARS S54 31'E, 43.5 FEET MARKED 1/4S1 IN UPPER FACE, BT IN LOWER FACE.

AN 8 INCH DIAMETER CEDAR BEARS S18"31', 15.9 FEET MARKED 1/4S2 IN UPPER FACE, BT IN LOWER FACE.

A 2 INCH DIAMETER IRON PIPE BEARS S42 26'W, 40.2 FEET MARKED M

S2 D S1 C

NORTH ONE-SIXTEENTH CORNER COMMON TO SECTION 2 AND 3 TOWNSHIP 34 SOUTH RANGE 3 EAST. AT THE CORNER POINT I SET A 5/8 BY 30 INCH IRON PIN WITH A 2 INCH DIAMETER ALUM. CAP MARKED:

T34S R3E

N

1
S3 --- ---S2

16
PLS 1086

SURVEY NARRATIVE TO COMPLY WITH O.R.S. 209.250

LOCATION:

WEST HALF OF SECTION 2, TOWNSHIP 34 SOUTH, RANGE 3 EAST, WILLAMETTE MERIDIAN, JACKSON COUNTY, OREGON.

SURVEY FOR:

SUPERIOR LUMBER CO.

P.O. BOX 250

GLENDALE, OREGON 97442

SURVEY BY:

RAMBO SURVEYING

ARTHUR R. RAMBO LS1086

735 VISTA PARK DRIVE

EAGLE POINT, OREGON 97524

DATE:

JULY 14, 1998

BASIS OF BEARING: SURVEY NUMBER 10268

PURPOSE:

TO MARK AND POST THE BOUNDARY LINE AND SET THE CORNERS COMMON TO SUPERIOR LUMBER CO. AND THE BUREAU OF LAND MANAGEMENT (MEDFORD DISTRICT) OWNERSHIP WITHIN SECTION 2, TOWNSHIP 34 SOUTH, RANGE 3 EAST, AS SHOWN ON THE PLAT TO ACCOMPANY THIS NARRATIVE.

PROCEDURE:

A SEARCH OF RECORDS REVEALED THAT ALL THE EXTERIOR CORNERS OF SAID SECTION 2, EXCEPT FOR THE ONE-QUARTER CORNER COMMON TO SECTION 1 AND 2, NEEDED FOR CONTROL OF THIS SURVEY WERE REESTABLISHED FROM ORIGINAL EVIDENCE.

I RAN A TRAVERSE TYING TO THE CORNERS NEEDED FOR CONTROL OF THIS SURVEY.

THE SUBDIVISION OF SAID SECTION 2 WAS THEN COMPUTED. THEN LINES NEEDED WERE RAN, CORNERS WERE SET, AND THE LINES WERE MARKED AND POSTED.

NEW TREES MARKED AT EXISTING CORNERS

ALL TREES ARE MEASURED TO THE CENTER OF THE TREE AT THE BASE UNLESS OTHER WISE STATED. ALL TREES HAVE A BRASS WASHER MARKED PLS 1086 NAILED TO THE LOWER FACE.

AT THE ONE-QUARTER CORNER COMMON TO SECTION 35, TOWNSHIP 33 SOUTH, RANGE 3 EAST, AND SECTION 2, TOWNSHIP 34 SOUTH, RANGE 3 EAST, I FOUND A 3" DIAMETER BLM BRASS CAP.