
## MAP OF SURVEY **EXCEL DRIVE EXTENSION**

LOCATED IN THE SOUTHEAST 1/4 OF SECTION 7

TOWNSHIP 37 SOUTH, RANGE 1 WEST, WILLAMETTE MERIDIAN IN THE CITY OF MEDFORD, JACKSON COUNTY, OREGON

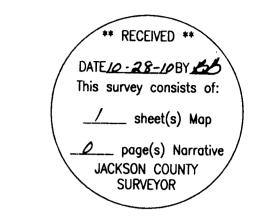

SURVEY NARRATIVE TO COMPLY WITH O.R.S. 209.250

SURVEYED BY, AND FOR: THE CITY OF MEDFORD PUBLIC WORKS ENGINEERING DEPARTMENT 411 WEST 8TH STREET, MEDFORD, OREGON 97501

DATE OF SURVEY: FIELD WORK COMPLETED IN MAY, 2010.

BASIS OF BEARING: OREGON STATE PLANE SYSTEM, SOUTH ZONE, NORTH AMERICAN DATUM (NAD) 1983/1991. GRID BEARING AS MEASURED BETWEEN POINTS 230 AND 260 AS S 53°13'30" W.

CITY OF MEDFORD VERTICAL BENCHMARK: A-436 ELEVATION=1333.521


PURPOSE: IN THE SPIRIT OF O.R.S. 209.155. 1. TO ESTABLISH THE CONTROLLING CENTERLINE AND EXISTING RIGHT OF WAY, IN WHICH STREET IMPROVEMENTS ARE TO BE CONSTRUCTED. 2. TO PERPETUATE THE LOCATION OF FOUND SURVEY MONUMENTS THAT MAY BE DESTROYED DURING CONSTRUCTION OF STREET IMPROVEMENTS. 3. TO ESTABLISH SURVEY CONTROL TO CONSTRUCT STREET IMPROVEMENTS. 4. TO SATISFY REQUIREMENTS OF 209.155(2)(b)


PROCEDURE: UTILIZING RECORD MAPS AND FIELD BOOKS NOTED ON THE MAP A FIELD SURVEY WAS MADE USING AN ELECTRONIC TOTAL STATION AND REAL-TIME KINEMATIC G.P.S. REDUNDANT MEASUREMENTS WERE MADE TO FOUND AND SET MONUMENTS TO WHICH A COORDINATE LISTING WAS COMPLIED AS SHOWN ON MAP.




- FOUND MONUMENTS AS NOTED IN TABLE
- MONUMENT TO BE DESTROYED DURING CONSTRUCTION AS NOTED IN TABLE
- A CITY OF MEDFORD SURVEY CONTROL AS NOTED IN TABLE FND FOUND
- CL CENTERLINE
- BM VERTICAL BENCHMARK FB C.O.M. FIELD BOOK
- SN SURVEY NUMBER AS FILED WITH THE JACKSON COUNTY SURVEYOR'S OFFICE C.O.M. CITY OF MEDFORD
- RPC RED PLASTIC CAP MARKER "C.O.M. CONTROL"
- OPC ORANGE PLASTIC CAP MARKED "HARDEY ENG & ASSOC" C.L.B.C. CRATER LAKE BUSINESS CENTER

AREA DEDICATED TO CITY OF MEDFORD AS PUBLIC RIGHT-OF-WAY

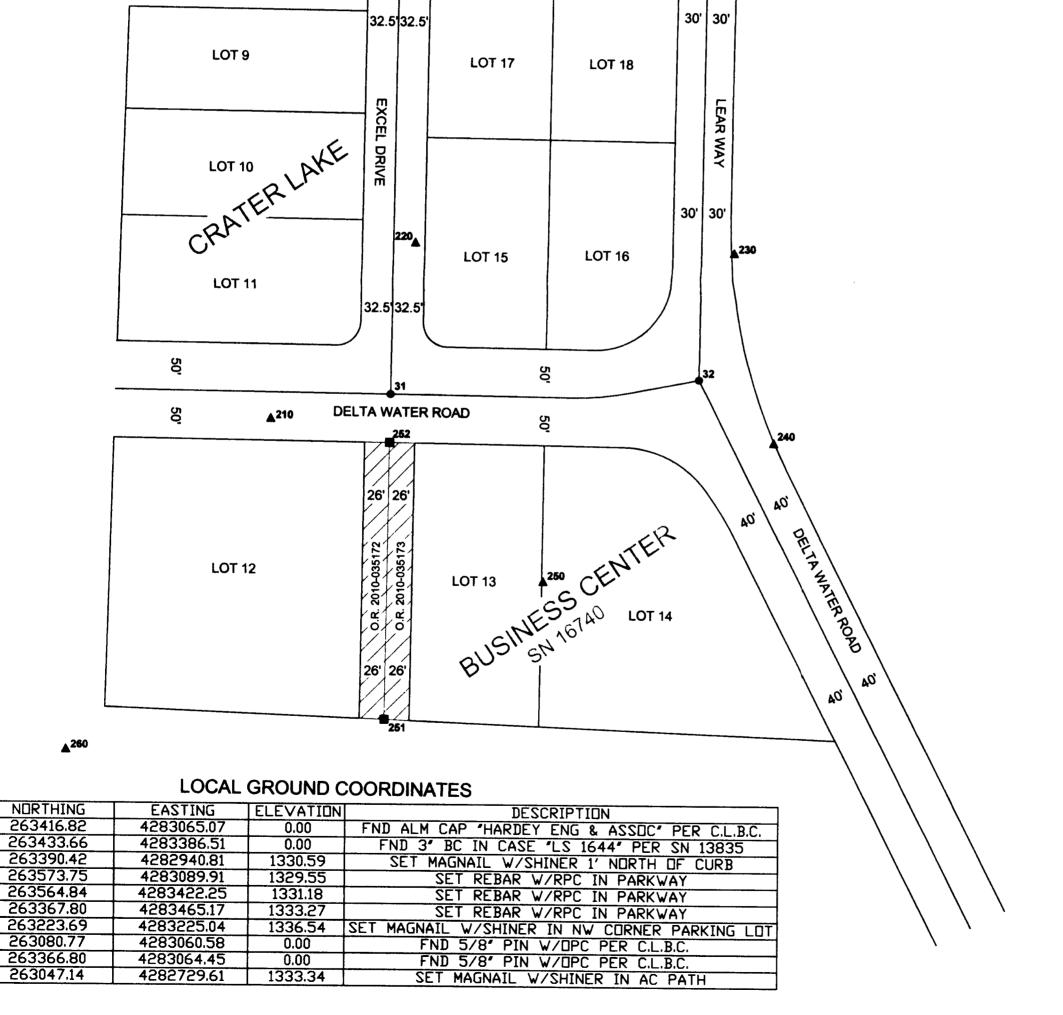

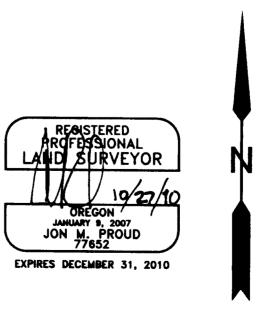

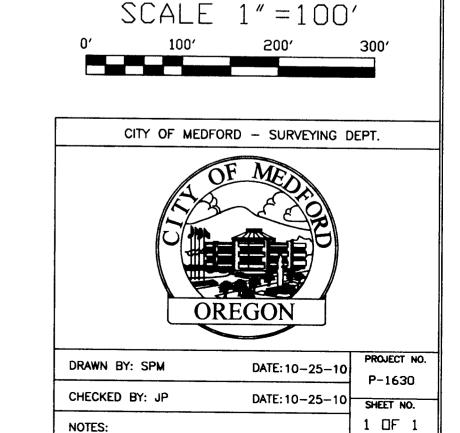

371W07D TAX LOTS 300 & 307

POINT

210

220

230

240

250

251

260