

### MAP OF SURVEY

Located within the South One-Half of Section 28, the Southeast One-Quarter of Section 32, and the East One-Half of Section 33, Township 32 South, Range 2 East of the Willamette Meridian, in Jackson County, Oregon.

#### PREPARED FOR:

LONE ROCK TIMBER MANAGEMENT CO.

PO Box 1127
Roseburg, Oregon 97470

# SURVEY NARRATIVE TO COMPLY WITH PARAGRAPH 209.250, OREGON REVISED STATUTES

**PURPOSE:** Pursuant to Client's request and direction, perform a boundary survey, recover existing monuments, establish monuments at boundary corners as needed, mark line with posts, blaze and tag line trees, and file a Map of Survey in the office of the Jackson County Surveyor.

PROCEDURE: Equipment/software utilized: Trimble RIO GNSS equipment, Trimble S7 robotic instrument, Trimble TSC7 data collectors with Trimble Access Software, Trimble Business Center and Trimble Terramodel; Records utilized: Instrument Number 1997-08348, of the Official Records of Jackson County, Oregon; the United States Department of Interior Bureau of Land Management, Field Notes Volume 699, Pages 399-418; the United States Department of Interior Bureau of Land Management, Map Number 8072, Dated April 26, 2019, and filed on July 8, 2019; Survey's Numbered 1621, 5523, 9500, 9511, 10710, 11925, 13497, 21531 and 21556, all in the office of the Jackson County Surveyor; Corner Re-establishment Notes as filed in the office of the Jackson County Surveyor. Linear unit (horizontal) is International Foot (ift); Linear unit (vertical) is U.S. Survey Foot (usft); Vertical datum is the North American Datum of 1988 (NAVD88); Geodetic Information: Datum is the North American Datum (NAD) of 1983 (2011) Epoch 2010.00; System is the Oregon Coordinate Reference System; Zone is the Grants Pass-Ashland (Refer to ORS, Chapter 93.312(c)).

All bearings and distances shown hereon are projected (grid) values based on the projection definition herein and above. This projection was utilized in order to minimize the difference between projected (grid) distances and horizontal (ground) distances at the topographic surface within the design area of this coordinate system. The basis of bearings is Geodetic North. Note that the grid bearings depicted do not equal geodetic bearings due to meridian convergence.

Subject properties are described in said Instrument Numbered 1997-08348, as TRACT 30, the South Half of the Southeast Quarter of Section 32 and a portion of TRACT 44, the Northeast Quarter of the Southwest Quarter, the South Half of the Southwest Quarter, the West Half of the Southeast Quarter, and the Northeast Quarter of the Southeast Quarter of Section 28; the Northwest Quarter of the Northeast Quarter, and the East Half of the East Half of Section 33, all in Township 32 South, Range 2 East of the Willamette Meridian in Jackson County, Oregon.

Utilized a Fast Static network to establish base control, thence utilized RTK methods with redundant observations to establish primary control and certain found monuments. From said established primary control, utilized terrestrial equipment to traverse boundary lines, locate remaining monuments, mark line, set required monuments, and close to said primary control.

Bearing Tree notes from Sections 28, 32, and 33 are listed on sheet 5. Bearings and distances to bearing trees are to the center of the tree at the ground.

Resolution for Section 33: Found the four Quarter corners for Section 33, thence computed the Center Quarter of Section 33 to establish monuments at the Center-North Sixteenth corner (IO) and the Center-East Sixteenth corner (8). The Northeast Sixteenth corner (9) was established utilizing said corners as well as the found East Sixteenth corner to Sections 28 and 33, and the found Section corner common to Sections 27, 28, 33, and 34. The East Sixteenth corner (7) common to Sections 33 and 4 was established utilizing the Quarter corner common to Sections 33 and 4, as well as the Section corner common to Sections 3, 4, 33, and 34.

Monuments were established, as depicted hereon, on August 17, 2023

#### BASIS OF BEARINGS:

Basis of bearings is Geodetic North referenced to the NAD83 2011 (Epoch 2010.00) datum. Refer to Survey Narrative for a complete description.

## PREPARED BY:

Neathamer Surveying, Inc. 3126 State St, Suite 203 P.O. Box 1584 Medford, Oregon 97501 Phone (541) 732-2869 FAX (541) 732-1382

PLOT DATE: November 16, 2023

PROJECT NUMBER: 23003

Sheet 1 of 5 © CN MN-SL

PROFESSIONAL LAND SURVEYOR

Plut I New Machine

OREGON
JULY 19, 1994
ROBERT V. NEATHAMER

REGISTERED


ROBERT V. NEATHAMER 2675


Renewal Date 12/31/24

#### Southeast One-Quarter of Section 32, and the East One-Half of Section 33, Township 32 South, Range 2 East of the Willamette Meridian, in Jackson County, Oregon. 588°25'27"E 2669,17' PREPARED FOR: LONE ROCK TIMBER MANAGEMENT CO. SHEET 3 PO Box 1127 32 2E TAX LOT 9000 32 2E Roseburg, Oregon 97470 **TAX LOT 9200** FOUND 2-1/2" ALUMINUM CAP MARKING THE CENTER SOUTH SIXTEENTH CORNER OF SECTION 32 FOUND 2-1/2" BRASS CAP MARKING THE ORIGINALLY SET PER SN 21556 AND FOUND LEGEND: SOUTH SIXTEENTH CORNER OF SECTIONS PER 2019 CADASTRAL SURVEY 8072, 32-33, PER CADASTRAL SURVEY 8072, BUREAU OF LAND MANAGEMENT BUREAU OF LAND MANAGEMENT $oldsymbol{\otimes}$ Indicates a set 5/8-inch diameter by 40-inch long iron pin CAP MARKED: LONE ROCK TIMBER with a 2-inch aluminum cap marked "NEATHAMER SURVEYING", CAP MARKED: U.S. DEPARTMENT OF THE INTERIOR UNLAWFUL TO DISTURB ACCESS ROAD NOT TO SCALE CROSSING • Indicates a found brass cap as noted hereon. 51/16 532 GATE-BT-8" FIR BT-12" FIR STUMP S 1/16 Indicates a found aluminum cap as noted hereon. BT-14" FIR L7 BT-18" FIR {L8} 2014 532 \$ 533 Indicates a found 5/8-inch diameter iron pin with yellow PLS 2291 plastic cap per SN 10710, unless noted otherwise. 2017 CADASTRAL SURVEY Indicates a computed position, nothing found or set. BUREAU OF LAND MANAGEMENT Indicates record information as per SN 1621. 32 2E Indicates record information as per SN 5523. (SEE SHEET 3) **TAX LOT 9100** Indicates record information as per the United States Department of Interior Bureau of Land Management, TRACT 30, INST 97-08348 Map Number 8072, Dated April 26, 2019. - FOUND 1-1/2" ALUMINUM CAP IN Indicates record information as per SN 9500. 32 2E TAX LOT 9000 EXPANDER ATOP I" PIPE MARKING Indicates record information as per SN 9511. THE SECTION CORNER OF 32-33, 5-4 Indicates record information as per SN 10710. PER JOSEN DATED MARCH 27, 2007 Indicates record information as per SN 11925. CAP MARKED: « » Indicates record information as per SN 13497. Indicates record information as per SN 21531. T325 R2E T335 Indicates record information as per SN 21556. 32 | 33 BT Indicates a Bearing Tree. BT-I9" FIR-L9 [ LIO ] JCSRN Indicates a reference to re-establishment notes on file in <LII> \\ (L12) CS BT-33" CEDER BT-I2" FIR BT-30" CEDERthe office of the Jackson County Surveyor. ACCESS ROAD BT-34" CEDER CROSSING SN Indicates a survey filed by number in the office of the FOUND 2-1/2" BRASS CAP IN MOUND OF -STONE MARKING THE QUARTER CORNER OF Jackson County Surveyor. SECTION 32-5, PER CADASTRAL SURVEY, BUREAU OF LAND MANAGEMENT INST Indicates an instrument recorded by number of the Official Records of Jackson County, Oregon. CAP MARKED: 33 2E 05 U.S. DEPARTMENT OF THE INTERIOR UNLAWFUL TO DISTURB T325 R2E 532 1/4-8-T335 2022 CADASTRAL SURVEY BUREAU OF LAND MANAGEMENT LINE TABLE LINE BEARING DISTANCE LINE BEARING DISTANCE LINE BEARING DISTANCE LINE BEARING DISTANCE LI SO1°16'59"E NOI°19'55"W N88°00'49"W 1323.47 LI9 2685.581 L36 588°45'44"E 1357.04 L53 1320.28 L2 500°47'26"E 1323.62 L20 NOO°47'11"W 2692.92' L37 589°15'53"E 1357.08 L54 N87°33'20"W 1320.52 500°43'52"E L3 1333.32 2697.381 L2I N89°03'28"W L38 588°45'37"E 1357.28 L55 N88°00'49"W 1320.28 588°44'30"E L4 501°16'53"E 1323.631 L22 N88°32'49"W 2696.84 L39 1357.05 L56 N87°33'20"W 1320.52 BASIS OF BEARINGS: SCALE 1" = 400'588°45'44"E L5 502°46'26"E 9.99' L23 N88°33'57"W 2697.231 1357.04 L40 L57 NOO°42'28"W 1356.16 L6 503°10'30"E 10.01 L24 N88°35'07"W 2696.82 L4I 500°39'21"E 1329.39 L58 NOO°42'28"W 1356.16 Basis of bearings is Geodetic North referenced to the NAD83 2011 800 1200 (Epoch 2010.00) datum. Refer to Survey Narrative for a complete L7 N88°21'18"W 2636.20' L25 NOO°13'18"E 1323.70 L42 500°12'37"E NOO°05'44"W 1333.20 L59 1363.631 N88°21'14"W L8 2636.20' L26 NOO°42'58"E 1323.48 L43 N89°11'44"W 1353.17 N88°44'08"W L60 1334.46 L9 2638.40' 587°56'09"E L27 589°09'14"E 1333.23 L44 1352.74' NOO°42'42"W N88°39'52"W L61 | 1356.88 LIO 587°29'00"E 2639.20' L28 588°41'04"E 1333.131 L45 500°57'12"E 1330.50 NOO°49'34"W L62 1327.86 PREPARED BY: Neathamer Surveying, Inc. LII 587°29'00"E 2639.16' L29 NOO°25'48"W 1326.91 L46 500°24'29"E 1331.00' NOO°24'29"W **REGISTERED** L63 1331.06 \*\* RECEIVED \*\* **PROFESSIONAL** 3126 State St, Suite 203 LI2 587°26'32"E 2638.56 L30 NOO°03'25"W 1326.05 L47 | 1348.86 NOO°05'44"W 589°09'09"E L64 1366.27 DATE 11/17/23 BY PB LAND SURVEYOR LI3 NOI°19'55"W 1342.85 L3I 589°11'09"E 1319.46 L48 588°33'57"E 1348.21 588°25'27"E P.O. Box 1584 L65 1320.53 LI4 NOO°50'08"W 1342.831 L32 588°47'10"E 1317.85 L49 588°55'43"E 1347.91 L66 588°25'27"E 1320.53 Medford, Oregon 97501 This survey consists of: Rhut V. Weathamer NOO°50'17"W LI5 1342.97 L33 589°13'22"E 1357.00' L50 1348.21 588°13'08"E 588°33'57"E L67 1320.16' 5\_sheet(s) Map Phone (541) 732-2869 LI6 NOI°19'55"W 1342.74 L34 588°45'55"E 1356.95 L5I 500°43'08"E 1336.62 L68 588°13'08"E 1320.16 FAX (541) 732-1382 page(s) Narrative LI7 NOO°50'08"W 1342.82 L35 588°44'30"E 1357.05 L52 500°12'37"E 1333.20 L69 N88°44'08"W 1333.94 JULY 19, 1994 NOO°50'17"W 1342.97 LI8 JACKSON COUNTY ROBERT V. NEATHAMER PLOT DATE: November 16, 2023 PROJECT NUMBER: 23003 SURVEYOR 2675 Renewal Date 12/31/24 Sheet 2 of 5 Jackson County Assessor's Map No: 32 2E, Tax Lot 9100 Drawing N: WSI Projects\Lone Rock Timber Management Company\23003 Bdy Survey\23003 MOS.pro

MAP OF SURVEY

Located within the South One-Half of Section 28, the

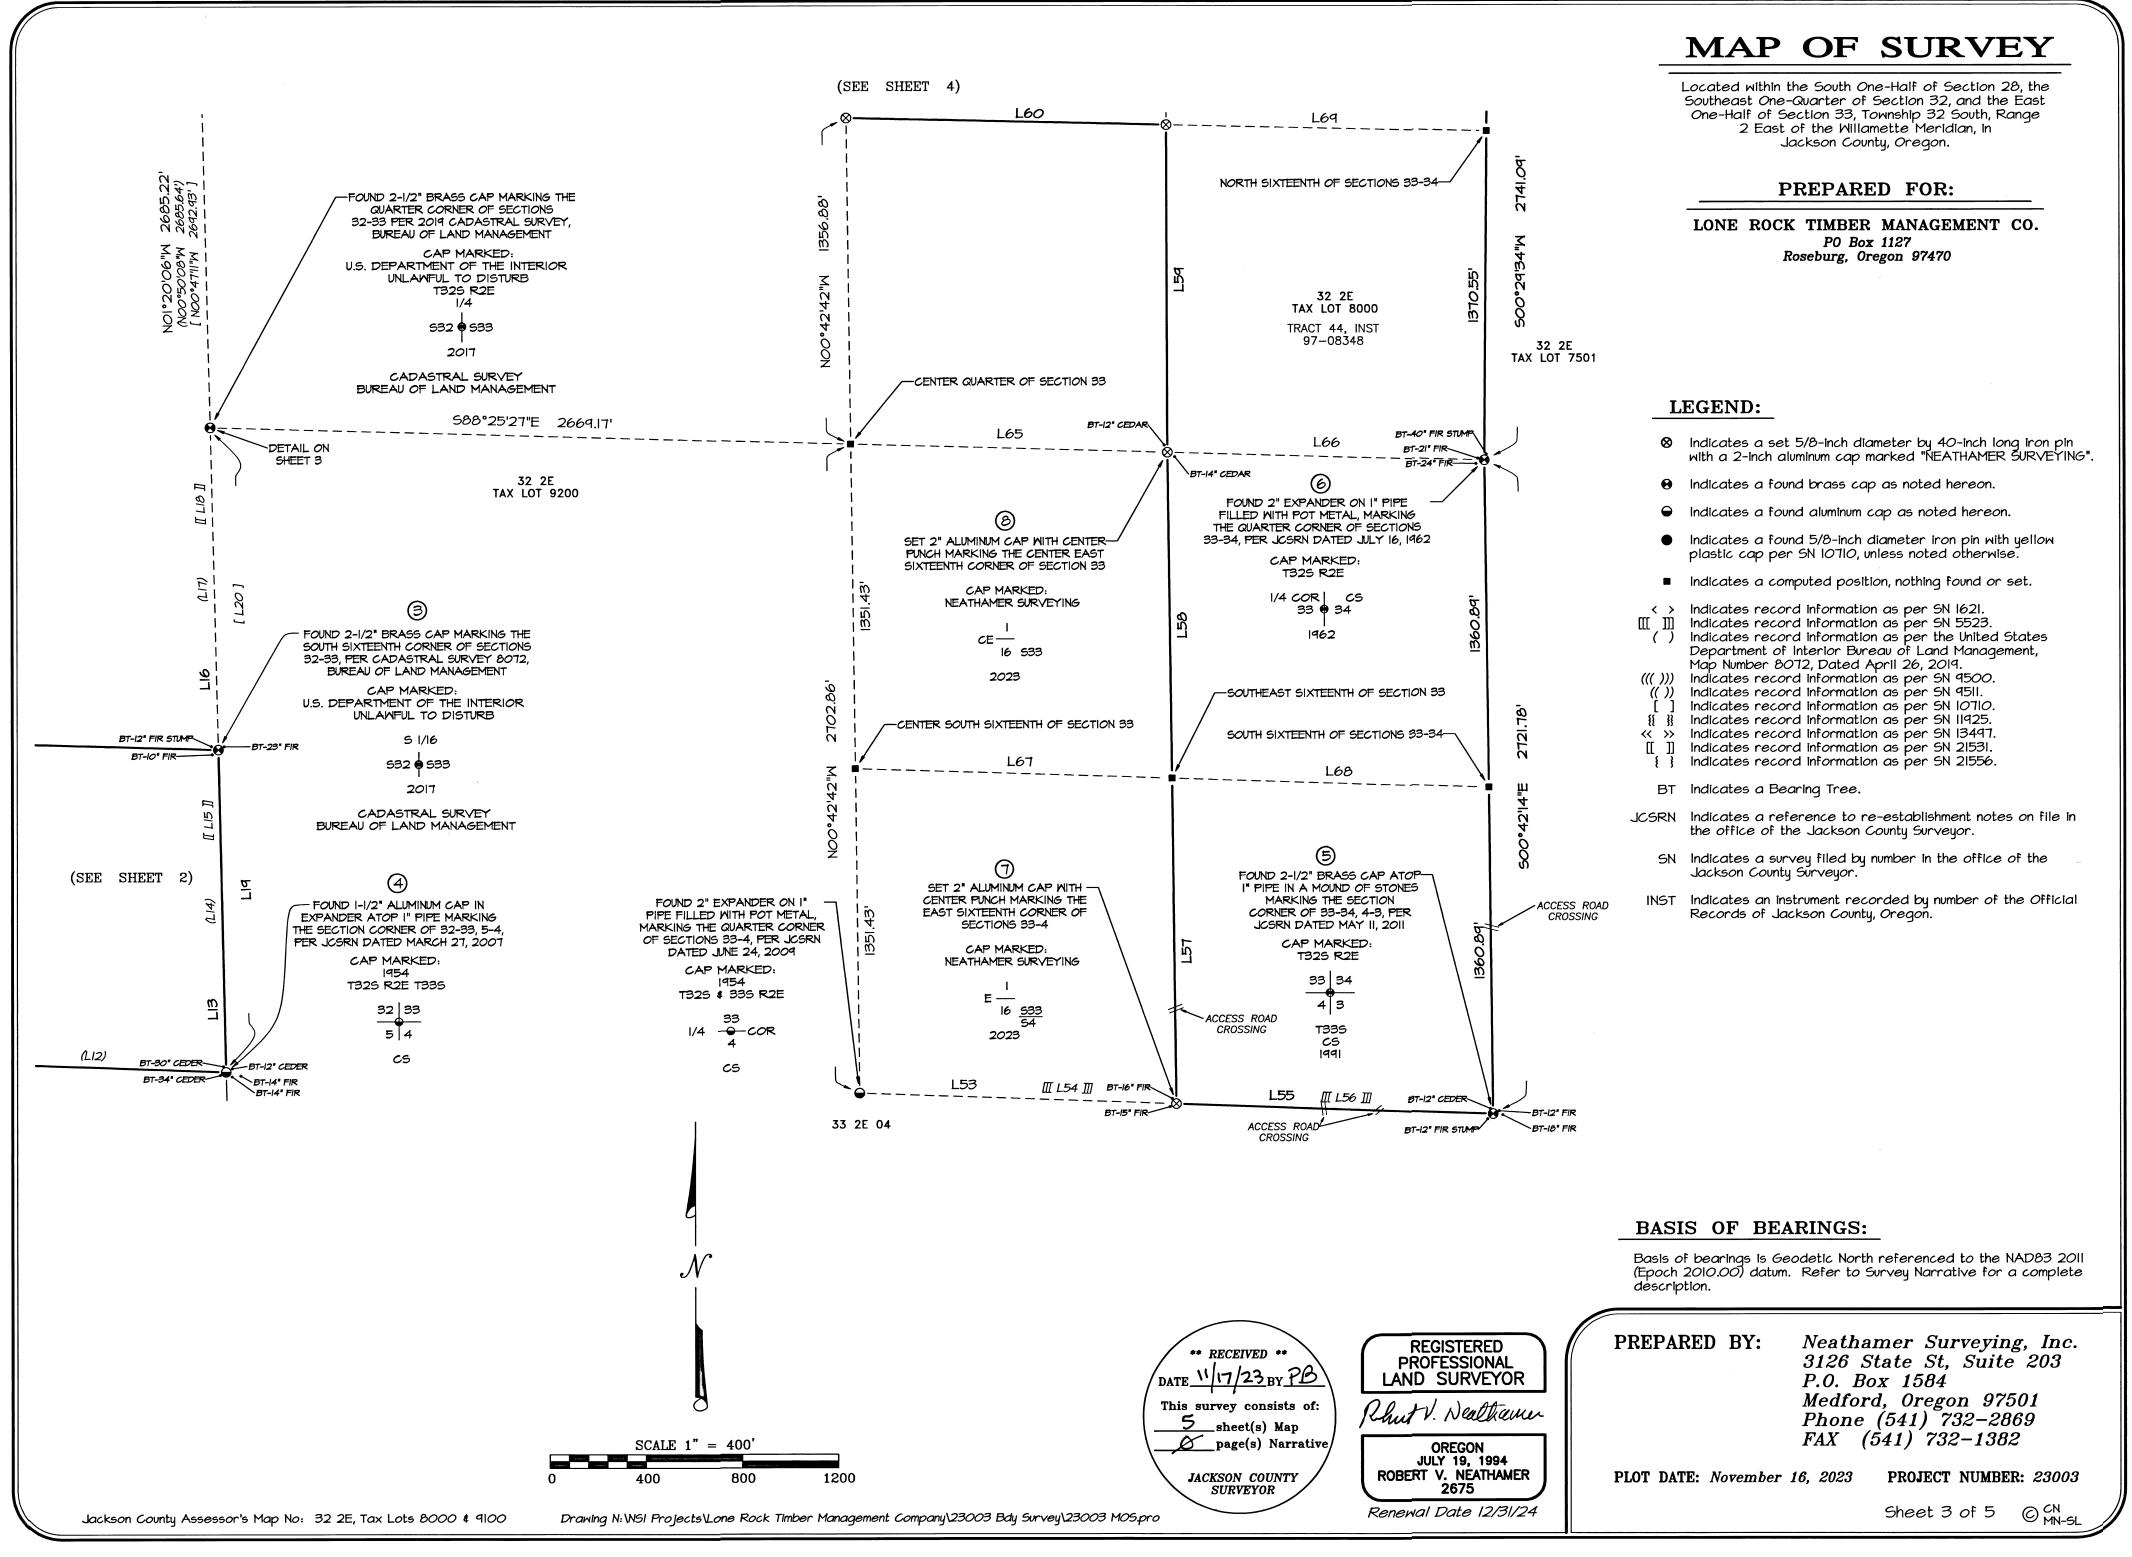

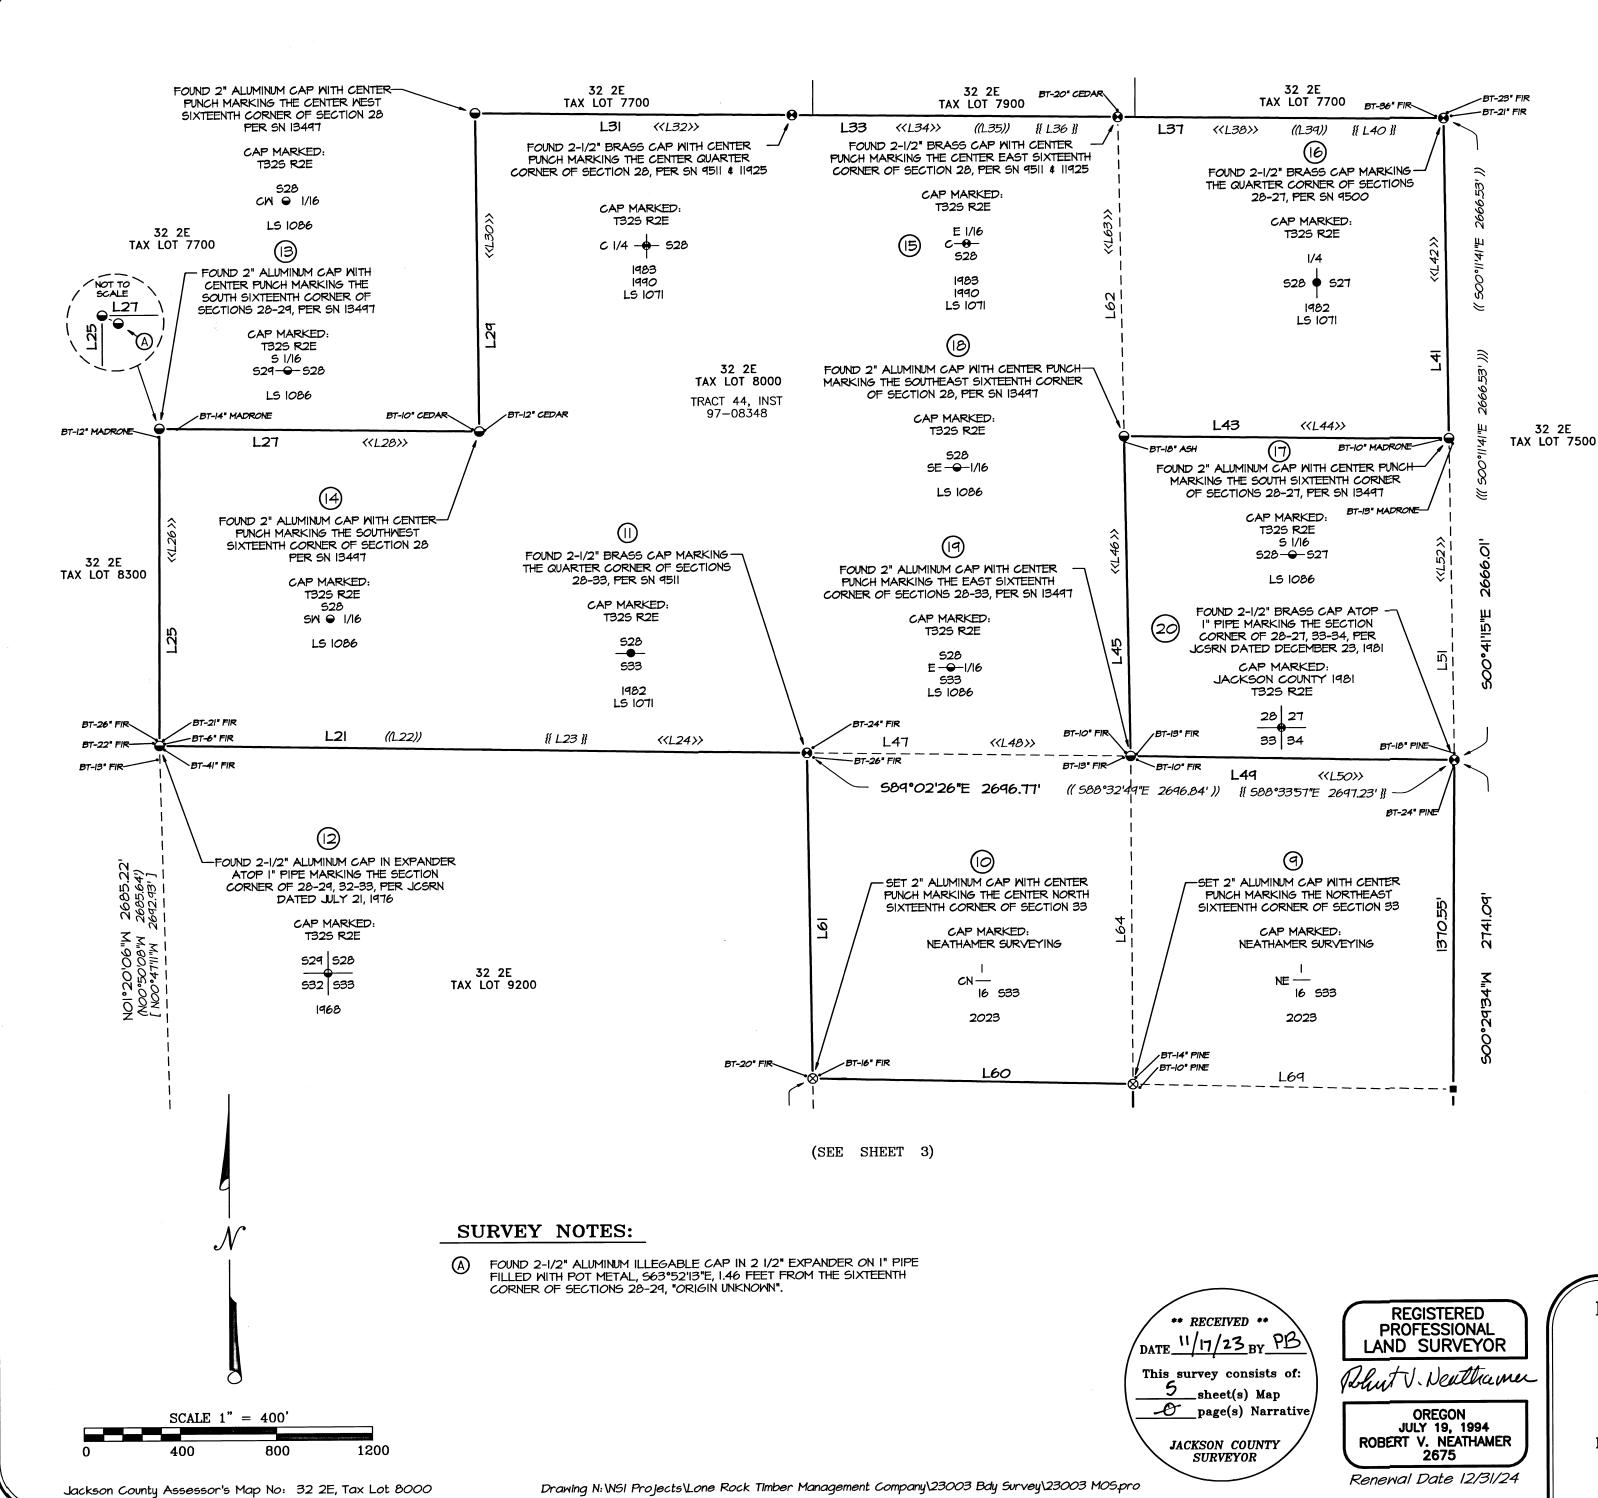

## MAP OF SURVEY

Located within the South One-Half of Section 28, the Southeast One-Quarter of Section 32, and the East One-Half of Section 33, Township 32 South, Range 2 East of the Willamette Meridian, in Jackson County, Oregon.

### PREPARED FOR:

LONE ROCK TIMBER MANAGEMENT CO.

PO Box 1127

Roseburg, Oregon 97470

#### LEGEND:

- $\otimes$  Indicates a set 5/8-inch diameter by 40-inch long iron pin with a 2-inch aluminum cap marked "NEATHAMER SURVEYING".
- Indicates a found brass cap as noted hereon.
- Indicates a found aluminum cap as noted hereon.
- Indicates a found 5/8-inch diameter iron pin with yellow plastic cap per SN 10710, unless noted otherwise.
- Indicates a computed position, nothing found or set
- Indicates record information as per SN 1621.
   Indicates record information as per SN 5523.
   Indicates record information as per the United States Department of Interior Bureau of Land Management, Map Number 8072, Dated April 26, 2019.
- (())) Indicates record information as per SN 9500.
  (()) Indicates record information as per SN 9511.
  [] Indicates record information as per SN 10710.
  {{}} Indicates record information as per SN 10710.
- Indicates record information as per SN 13497.
   Indicates record information as per SN 21531.
   Indicates record information as per SN 21556.
- BT Indicates a Bearing Tree.
- JCSRN Indicates a reference to re-establishment notes on file in the office of the Jackson County Surveyor.
  - SN Indicates a survey filed by number in the office of the Jackson County Surveyor.
- INST Indicates an instrument recorded by number of the Official Records of Jackson County, Oregon.

#### BASIS OF BEARINGS:

Basis of bearings is Geodetic North referenced to the NAD83 2011 (Epoch 2010.00) datum. Refer to Survey Narrative for a complete description.

PREPARED BY:

Neathamer Surveying, Inc. 3126 State St, Suite 203 P.O. Box 1584 Medford, Oregon 97501 Phone (541) 732-2869 FAX (541) 732-1382

PLOT DATE: November 16, 2023 PROJECT NUMBER: 23003

Sheet 4 of 5 © CN MN-SL

### MAP OF SURVEY

Located within the South One-Half of Section 28, the Southeast One-Quarter of Section 32, and the East One-Half of Section 33, Township 32 South, Range 2 East of the Willamette Meridian, in Jackson County, Oregon.

#### PREPARED FOR:

LONE ROCK TIMBER MANAGEMENT CO. PO Box 1127 Roseburg, Oregon 97470

#### BEARING TREE NOTES SHEET 2:

A FOUND 2-1/2" BRASS CAP MARKING THE QUARTER CORNER COMMON TO TOWNSHIPS 32 AND 33, SECTIONS 32 AND 5. (SHEET 2).

> A 19-INCH DIAMETER FIR WITH BEARING TREE TAG, BEARS NI9°47'32"W, 54.84 FEET WITH HEALED DOUBLE BLAZE.

A 33-INCH DIAMETER CEDAR WITH BEARING TREE TAG, BEARS 581°56'20"W, 79.07 FEET WITH HEALED DOUBLE BLAZE.

A 12-INCH DIAMETER FIR WITH BEARING TREE TAG, BEARS 553°15'03"E, 46.04 FEET WITH HEALED DOUBLE BLAZE.

A FOUND 2-1/2" ALUMINUM CAP MARKING THE SOUTH CENTER SIXTEENTH CORNER OF TOWNSHIP 32, SECTION 32. (SHEET 2).

> A 14-INCH DIAMETER FIR, BEARS 563°47'19"W, 25.95 FEET WITH BEARING TREE TAG MARKED LONE ROCK TIMBER.

A 8-INCH DIAMETER FIR, BEARS S62°53'10"E, IO.57 FEET WITH BEARING TREE TAG MARKED LONE ROCK TIMBER.

A 18-INCH DIAMETER FIR, BEARS 538°59'10"E, 20.02 FEET WITH BEARING TREE TAG MARKED LONE ROCK TIMBER.

A FOUND 2-1/2" BRASS CAP MARKING THE SOUTH SIXTEENTH CORNER OF TOWNSHIP 32, SECTIONS 32 AND 33. (SHEETS 2 AND 3).

> A 12-INCH DIAMETER FIR STUMP, BEARS N59°07'16"W, 20.90 FEET TO THE CENTER OF STUMP.

A 10-INCH DIAMETER FIR, BEARS 951°47'42"W, 19.27 FEET WITH SINGLE BLAZE AND BEARING TREE TAG.

A 23-INCH DIAMETER FIR, BEARS N60°00'06"E, 30.67 FEET WITH SINGLE BLAZE AND BEARING TREE TAG.

A FOUND 1-1/2" ALUMINUM CAP MARKING THE SECTION CORNER OF TOWNSHIPS 32 AND 33, SECTIONS 32-33-5 AND 4. (SHEETS 2 AND 3).

BEARING TREE TAG.

A 30-INCH DIAMETER CEDAR, BEARS NI9°54'45"W, 20.03 FEET WITH BEARING TREE TAG AND BLAZE.

A 34-INCH DIAMETER CEDAR WITH, BEARS 561°13'24"W, 20.95 FEET WITH

A 14-INCH DIAMETER FIR, BEARS 562°28'46"E, 20.27 FEET WITH BEARING TREE TAG.

A 14-INCH DIAMETER FIR, BEARS S71°23'06"E, 65.37 FEET WITH BEARING TREE TAG.

A 12-INCH DIAMETER CEDAR, BEARS N54°38'48"E, 21.71 FEET WITH BEARING

#### BEARING TREE NOTES SHEET 3:

BEARING TREE TAG.

A FOUND 2-1/2" BRASS CAP MARKING THE SECTION CORNER COMMON TO TOWNSHIPS 32 AND 33, SECTIONS 33-34-4 AND 3. (SHEET 3).

> A 12-INCH DIAMETER CEDAR, BEARS N28°42'09"W, 24.26 FEET WITH BEARING TREE TAG.

A 12-INCH DIAMETER FIR STUMP, BEARS 564°06'06"W, 7.63 FEET AT CENTER OF STUMP

A 18-INCH DIAMETER FIR, BEARS 583°38'II"E, 40.26 FEET WITH

A 12-INCH DIAMETER FIR, BEARS NO6°22'02"E, I3.30 FEET WITH BEARING TREE TAG.

A FOUND 2" EXPANDER ON I" PIPE FILLED WITH POT METAL, MARKING THE QUARTER CORNER COMMON TO TOWNSHIP 32, SECTIONS 33-34.

> A 40-INCH DIAMETER FIR STUMP, BEARS N35°02'32"E, 21.70 FEET WITH BEARING TREE TAG IN CENTER OF STUMP.

A 21-INCH DIAMETER FIR, BEARS N79°27'22"W, I2.50 FEET WITH BEARING TREE TAG AND LOWER BLAZE.

A 24-INCH DIAMETER FIR, BEARS S66°21'51"W, 37.81 FEET WITH BEARING TREE TAG AND LOWER BLAZE.

A SET 2-INCH ALUMINUM CAP MARKING THE EAST SIXTEENTH CORNER OF TOWNSHIPS 32 AND 33, SECTIONS 33 AND 4. (SHEET 3).

> A 15-INCH DIAMETER FIR, BEARS 526°44'34"W, 6.45 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

A 16-INCH DIAMETER FIR, BEARS NI9°18'04"E, 11.55 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

A SET 2-INCH ALUMINUM CAP MARKING THE CENTER EAST SIXTEENTH CORNER OF TOWNSHIP 32, SECTION 33. (SHEET 3).

A 14-INCH DIAMETER CEDAR, BEARS N88°31'39"E, 15.21 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

A 12-INCH DIAMETER CEDAR, BEARS NI7°40'34"W, 24,94 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

#### BEARING TREE NOTES SHEET 4:

A SET 2-INCH ALUMINUM CAP MARKING THE NORTHEAST SIXTEENTH CORNER OF TOWNSHIP 32, SECTION 33. (SHEET 4).

> A 10-INCH DIAMETER PINE, BEARS 569°39'03"E, 12.10 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

A 14-INCH DIAMETER PINE, BEARS N34°51'49"E, 12.86 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

A SET 2-INCH ALUMINUM CAP MARKING THE CENTER NORTH SIXTEENTH CORNER OF TOWNSHIP 32, SECTION 33. (SHEET 4).

> A 16-INCH DIAMETER FIR, BEARS N86°42'28"E, IO.91 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

A 20-INCH DIAMETER FIR, BEARS 572°55'09"W, 6.80 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

A FOUND 2-1/2" BRASS CAP MARKING THE QUARTER CORNER OF SECTIONS 28-33. (SHEET 4).

> A 24-INCH DIAMETER FIR, BEARS N27°37'26"E, IO.5I FEET WITH BEARING TREE TAG AND BLAZE.

> A 26-INCH DIAMETER FIR, BEARS 532°53'19"E, 20.82 FEET WITH BEARING TREE TAG AND BLAZE.

A FOUND 2-1/2" ALUMINUM CAP IN EXPANDER ATOP I" PIPE MARKING THE SECTION CORNER COMMON TO TOWNSHIP 32, SECTIONS 28-29-32 AND 33. (SHEET 4).

> A 22-INCH DIAMETER FIR, BEARS NIO "58'36"W, I2.55 FEET WITH BEARING TREE TAG WITH OPEN FACE BLAZE.

> A 26-INCH DIAMETER FIR, BEARS NI6°55'07"W, 21.09 FEET WITH BEARING TREE TAG.

A 13-INCH DIAMETER FIR, BEARS 521°43'30"W, 16.95 FEET WITH BEARING TREE TAG AND OPEN FACE BLAZE.

A 21-INCH DIAMETER FIR, BEARS N36°06'16"E, 28.86 FEET WITH BEARING TREE TAG AND HEALED BLAZE.

A 6-INCH DIAMETER FIR, BEARS NTO OZ'OO'E, 22.85 FEET WITH

A 41-INCH DIAMETER FIR, BEARS 540°31'29"E, 12.07 FEET WITH BEARING TREE TAG AND HEALED BLAZE.

A FOUND 2" ALUMINUM CAP MARKING THE SOUTH SIXTEENTH CORNER OF SECTIONS 28-29. (SHEET 4).

> A 12-INCH DIAMETER MADRONE, BEARS SOT°52'46"W, 35.27 FEET WITH BEARING TREE TAG.

> A 14-INCH DIAMETER MADRONE, BEARS 588°08'46"E, 72.37 FEET WITH BEARING TREE TAG.

#### BEARING TREE NOTES SHEET 4:

WITH BEARING TREE TAG AND BLAZE.

A FOUND 2" ALUMINUM CAP MARKING THE SOUTHWEST SIXTEENTH CORNER OF SECTION 28. (SHEET 4). A 10-INCH DIAMETER CEDAR, BEARS 561°25'12"W, 8.23 FEET

A 12-INCH DIAMETER CEDAR, BEARS 522°42'20"E, IO.O9 FEET WITH BEARING TREE TAG AND BLAZE.

A FOUND 2-1/2" BRASS CAP MARKING THE CENTER EAST SIXTEENTH CORNER OF SECTION 28. (SHEET 4).

> A 20-INCH DIAMETER CEDAR, BEARS NO9°13'38"E, 22.81 FEET WITH BEARING TREE TAG AND HEALED BLAZE.

A FOUND 2-1/2" BRASS CAP MARKING THE QUARTER CORNER OF SECTIONS 28 AND 27. (SHEET 4).

A 21-INCH DIAMETER FIR, BEARS N52°48'II"E, 10.30 FEET WITH BEARING TREE TAG AND LOWER BLAZE.

A 23-INCH DIAMETER FIR, BEARS N23°05'01"W, 15.26 FEET WITH

BEARING TREE TAG AND LOWER BLAZE. A 36-INCH DIAMETER FIR, BEARS S31°O2'O6"W, 6.06 FEET WITH

BEARING TREE TAG AND LOWER BLAZE.

A FOUND 2" ALUMINUM CAP MARKING THE SOUTH SIXTEENTH CORNER OF SECTIONS 28 AND 27. (SHEET 4).

A 13-INCH DIAMETER MADRONE, BEARS S20°15'33"E, 9.31 FEET WITH BEARING TREE TAG AND DOUBLE BLAZE.

A 10-INCH DIAMETER DEAD MADRONE, BEARS 579°52'22"W, 35.07 FEET WITH TAG AND WASHER MARKED LS 1086.

A FOUND 2" ALUMINUM CAP MARKING THE SOUTHEAST SIXTEENTH CORNER OF SECTION 28. (SHEET 4).

> A 18-INCH DIAMETER ASH, BEARS SOT 43'13"E, 24.57 FEET WITH BEARING TREE TAG AND SCRIBED LOWER BLAZE.

A FOUND 2" ALUMINUM CAP MARKING THE EAST SIXTEENTH CORNER OF SECTIONS 28 AND 33. (SHEET 4).

> A 13-INCH DIAMETER FIR SNAG, BEARS 571°52'10"E, 14.88 FEET WITH BEARING TREE TAG.

A 10-INCH DIAMETER FIR, BEARS 537°03'33"W, 8.07 FEET WITH BEARING TREE TAG.

A 13-INCH DIAMETER FIR, BEARS N89°38'54"W, 15.39 FEET WITH BEARING TREE TAG AND DOUBLE BLAZE.

IO-INCH DIAMETER FIR, BEARS N54°55'12"W, 26.27 FEET WITH BEARING TREE TAG AND DOUBLE BLAZE.

A FOUND 2-1/2" BRASS CAP MARKING THE SECTION CORNER OF SECTIONS 28-27, 33 AND 34. (SHEET 4).

A 18-INCH DIAMETER PINE, BEARS NOI°13'38"W, 27.24 FEET WITH BEARING TREE TAG AND HEALED BLAZE.

A 24-INCH DIAMETER PINE, BEARS 520°21'58"E, 16.43 FEET WITH BEARING TREE TAG AND HEALED BLAZE.

### BASIS OF BEARINGS:

Basis of bearings is Geodetic North referenced to the NAD83 2011 (Epoch 2010.00) datum. Refer to Survey Narrative for a complete

\*\* RECEIVED \*\* DATE 11/17/23 BY PB This survey consists of:

**SURVEYOR** 

Klant V. Neathaine 5\_sheet(s) Map page(s) Narrative ROBERT V. NEATHAMER JACKSON COUNTY

Renewal Date 12/31/24

**REGISTERED** 

**PROFESSIONAL** 

LAND SURVEYOR

OREGON

2675

JULY 19, 1994

PREPARED BY:

Neathamer Surveying, Inc. 3126 State St, Suite 203 P.O. Box 1584 Medford, Oregon 97501 Phone (541) 732-2869 FAX (541) 732-1382

PLOT DATE: November 16, 2023

PROJECT NUMBER: 23003

Sheet 5 of 5

Jackson County Assessor's Map No: 32 2E, Tax Lots 8000 € 9100 Drawing N:\NSI Projects\Lone Rock Timber Management Company\23003 Bdy Survey\23003 MOS.pro

24023