

CHARLES H. HURST, L. S.  
REGISTERED PROFESSIONAL LAND SURVEYOR  
CONSULTING FORESTER  
765 SUNRISE AVENUE  
MEDFORD, OREGON 97501

3092

County Surveyor  
Jackson County Courthouse  
Medford, Oregon

March 31, 1966

Dear Sir:

The following data is submitted relative to re-establishing the section corner common to Sections 19, 20, 29 and 30, Township 33 South, Range 1 West of the Willamette Meridian:

Found 4" squared oak post with scribing visible on four faces at the intersection of N-S and E-W blazed lines. Post decayed at ground line and approximately reset by Bureau of Land Management personnel.

Original survey notes call for the following:

8" Fir N 55° E	12 links	(7.92 feet)
6" Oak N 50° W	15 links	(9.90 feet)
4" Oak S 48° W	27 links	(17.82 feet)
10" Fir S 24° E	24 links	(15.84 feet)



At the vicinity of said post, I found a point from which a 28" Douglas fir with old face (no scribing) bears N 25° 21' E 7.92 feet; a 22.8" Douglas fir with old face (no scribing) bears S 22° 41' E 15.84 feet; an 8" oak stump bears S 32° 28' W 17.82 feet, all of which show evidence of very old axe work which, by annual ring count, show at least 75 years overgrowth.

Since a bearing fit according to record was not possible, I decided to hold record distances and on the basis of the above evidence set a brass capped 3/4" x 30" iron pin 26 inches in the ground from which I scribed a 22 1/2" Douglas fir "T33S RLW S 29 483BT" which bears S 81° 22' E 32.18 feet distant; a 19.4" Douglas fir "T33S RLW S 30 483BT" which bears S 39° 22' W 62.60 feet distant; a 13.7" Douglas fir "T33S RLW S 19 483BT" which bears N 48° 32' W 38.64 feet distant.

Distances to new witness trees were measured to nails at side center of said trees.

Yours very truly,

*Charles H. Hurst*  
Charles H. Hurst

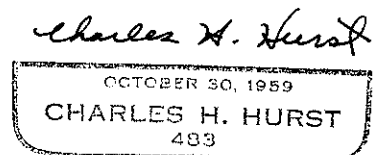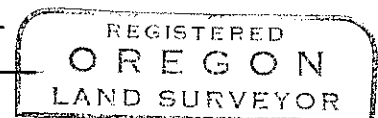

CHH:bjh

cc: Bureau of Land Management  
Steve Wilson

