

6415

FD. 1" I. PIPE
SEE NARRATIVE & SURVEY NO. 3227

W

1326.18'


2652.36'

N. 0° 01' 17" W.

663.09'

663.09'

23 24
FD. 1 1/2" I. PIPE
1/4 SEC. COR.

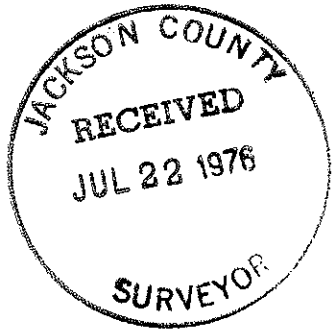

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Edward A. McGinty

OREGON
JULY 10, 1953
EDWARD A. MCGINTY
301



DEPENDANT SURVEY IN N.W. 1/4, SEC. 24, T. 38 S., R. 2 W., W.M.

FOR

LEWIS MAHARRY
(76-15)

BY EDWARD MC GINTY
MEDFORD, OREGON
MAY 1976

SCALE 1" = 200'
● = SET 5/8" I. PIN

6415

6415
5/79

6415

SURVEY NO. _____

SURVEY NARRATIVE TO COMPLY WITH O.R.S. 209-250

Survey for: Mr. L. M. Maharry
1700 Prune St.
Medford, Oregon 76-15

Survey by: Edward A. McGinty, R.S.
Medford, Oregon
May, 1976

Basis of Bearing: Survey No. 3802 (68-12)

Location: NW. 1/4 of Sec. 24, T38S, R2W. WM.

Precedence of Survey:

Found a 1 1/4 in. iron pipe with quartz along side, at the 1/4 corner between Sec.s 23 and 24, its location previously verified on survey No. 3802 and this survey. Traversed Northerly to a 1 in. pipe, being identified as the NW. corner of Section 24 on Survey No. 3227.

In the year 1956 I had previously searched for this corner. In 1966 survey No. 3227, by Ager, shows this is a found monument. This appears to be near or practically at location for the corner. The only other evidence found previously and on this survey was intersection of average blazed lines (part of old blazes about 30 yrs. old) being at a point 8 to 10 ft. southerly and 5.4 ft. easterly (note oak tree near 1st ridge southerly) of monument found.

This survey is dependant survey and subject to monuments found.

Reference to said 1 inch iron pipe, being near an existing fence -

white oak, 5 ins. diam., bears S.77°24'W., 17.8 ft. mkd. with 2 blazes
white oak, 16 ins. diam., bears S.4°41'E., 25.9 ft. mkd. with old blazes.

