SURVEY NO. 8123

MAP OF SURVEY
FOR
ROGUE RIVER NATIONAL FOREST

P.O. BOX 520
MEDFORD, OREGON
OCTOBER 19, 1979

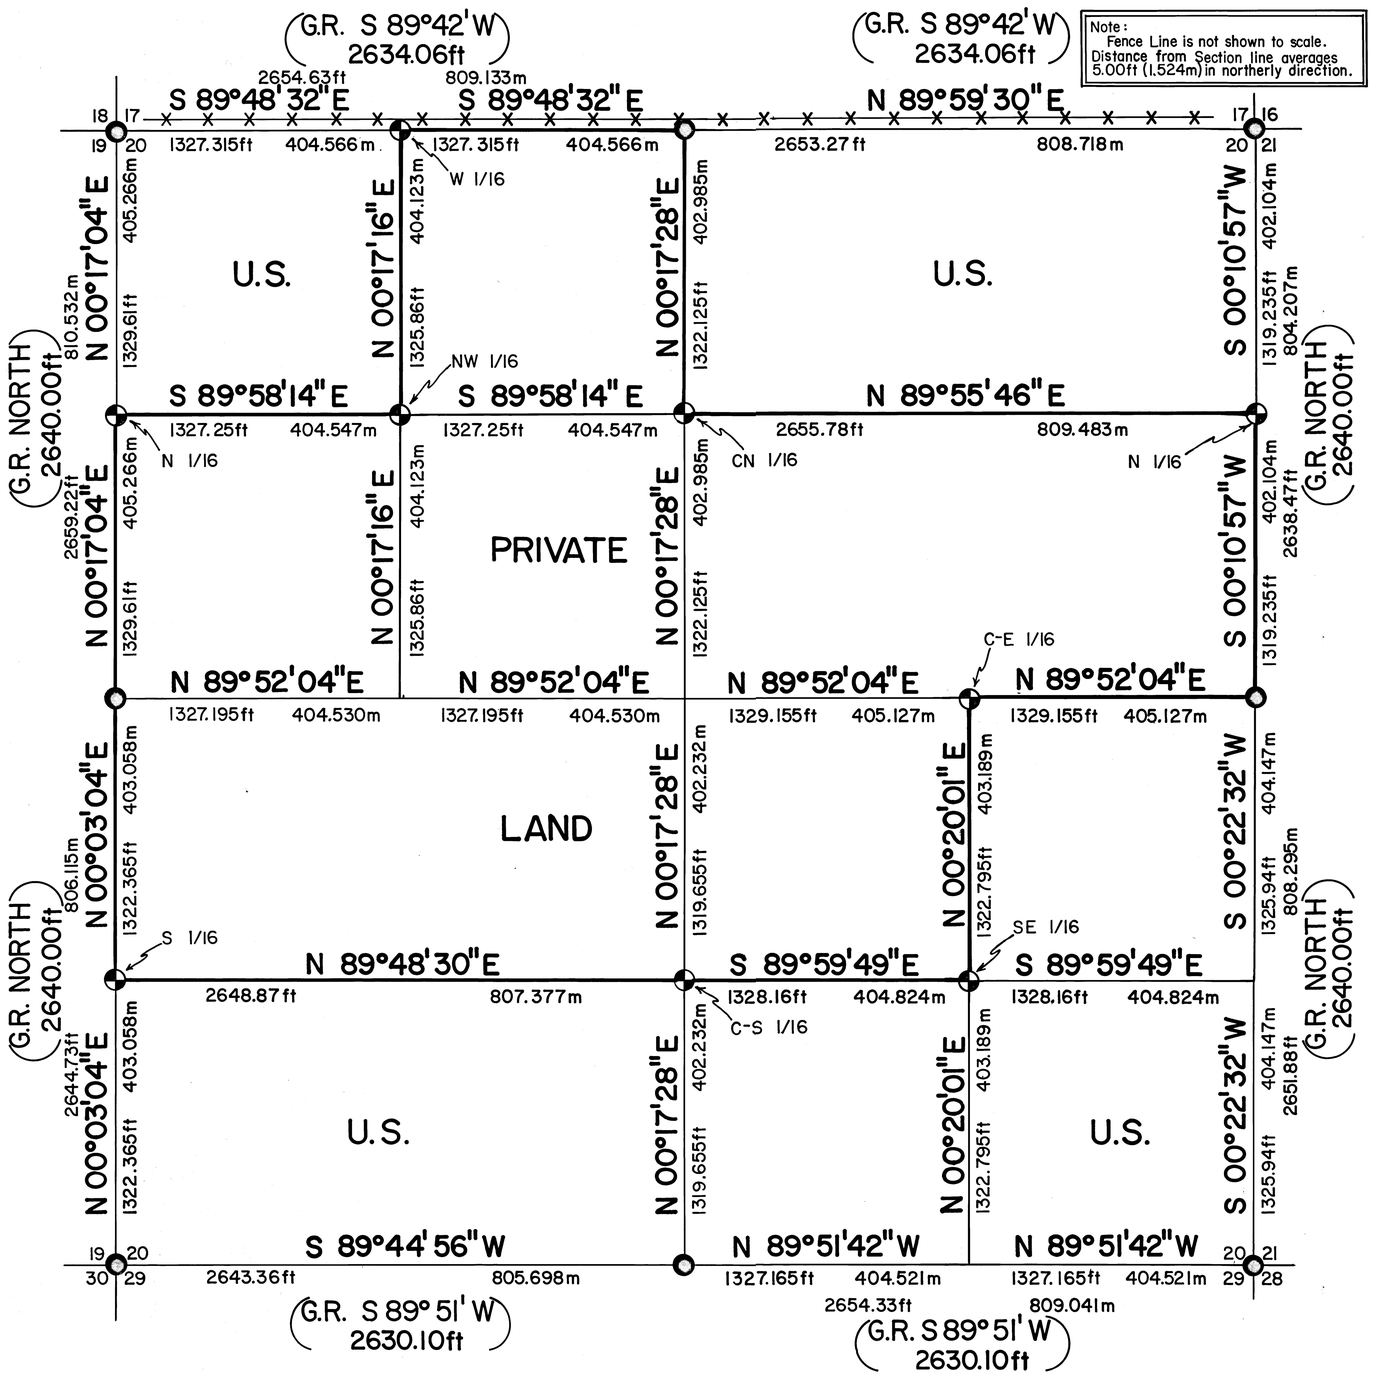

BASIS OF BEARING = SOLAR OBSERVATION

SCALE IN FEET: 0 500 1000

SCALE IN METERS: 0 100 200 400

1 METER = 3.280833 FEET

* See Affidavit of Correction Deed # 93-26993 8/16/1993

HISTORY OF SURVEYS

THE LINES OF TOWNSHIP 35 SOUTH, RANGE 4 EAST, WERE SURVEYED BY RUFUS S. MOORE UNDER CONTRACT NO. 504 IN MAY, 1884.

THE SUBDIVISION OF TOWNSHIP 35 SOUTH, RANGE 4 EAST, WAS PERFORMED BY RUFUS S. MOORE UNDER CONTRACT NO. 504 IN MAY, 1884.

THE QUARTER CORNERS COMMON TO SECTIONS 17 & 20, AND 20 & 29, WERE REMONUMENTED BY THE JACKSON COUNTY SURVEYOR'S OFFICE IN 1975.

THE REMAINING SECTION AND QUARTER CORNERS OF SECTION 20 WERE REMONUMENTED BY THE BUREAU OF LAND MANAGEMENT IN 1967.

LEGEND

- FOUND STANDARD BLM OR COUNTY SURVEYOR MONUMENT.
- SET 2 1/2" DIA. X 30" LG. IRON POST WITH 2 1/2" DIA. BRASS CAP UNLESS OTHERWISE NOTED.
- SECTION LINE CALCULATED FROM TRAVERSE SURVEY.
- PROPERTY LINE ESTABLISHED AND POSTED THIS SURVEY.
- FENCE LINE
- G.R. GOVERNMENT RECORD

CERTIFICATE OF SURVEY

I, HAROLD L. CENTER, REGISTRATION NO. 1071 REGISTERED PROFESSIONAL LAND SURVEYOR STATE OF OREGON, HEREBY CERTIFY THAT THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAWS OF THE STATE OF OREGON AT THE REQUEST OF THE U.S. FOREST SERVICE.

JACKSON COUNTY RECEIVED DEC 6 1979 SURVEYOR

REGISTERED PROFESSIONAL LAND SURVEYOR — OREGON — HAROLD L. CENTER — MAY 30, 1974 — No. 1071

U.S. DEPARTMENT OF AGRICULTURE
FOREST SERVICE
REGION 6 — ROGUE RIVER NAT. FOREST

DEPENDENT RESURVEY
and
SECTION SUBDIVISION
SEC. 20, T. 35 S., R. 4 E., W.M.
JACKSON COUNTY, OREGON

REVIEWED BY [signature] DATE 11/28/79

REVIEWED BY [signature] DATE 11-29-79

(TL 200) 35 4E 20

NARRATIVE OF SURVEY TO CONFORM TO PARAGRAPH 209.250 OREGON REVISED STATUTES

SURVEY FOR: Rogue River National Forest
P. O. Box 520
Medford, Oregon 97501

LOCATION: Section 20, Township 35 South, Range 4 East, Willamette Meridian, Jackson County, Oregon.

BASIS OF BEARING: Solar Observation

PURPOSE: To establish property corners, and mark and post National Forest ownership within Section 20.

PROCEDURE: Prior to the commencement of the survey, an investigation of the corner control was made. The Bureau of Land Management had remonumented from original evidence all controlling corners, except the quarter corner common to Sections 17 and 20, and the quarter corner common to Sections 20 and 29. These corners were remonumented from original evidence by the Jackson County Surveyor.

With the above corner control identified I began a random line traverse around the perimeter of the section. Starting at the Southeast section corner, I surveyed in a clockwise direction and closed back into my starting point. From this data I calculated the corner positions and ran on true line along the property lines as shown on plat. All lines were part of a closed traverse and were ran on a computer to check the error of closure. I then set iron monuments at the corner positions and marked and posted the property lines.

CORNERS ACCEPTED FOR CONTROL

Section corner common to Section 19, 20, 29 and 30, Township 35 South, Range 4 East, Willamette Meridian. At the corner location I found a standard BLM brass cap marked:

U. S. Dept. of Interior
Unlawful to disturb

T35S R4E WM

S19	S20
S30	S29

1967

Cadastral Survey
Bureau of Land Management

(TL 200) 35 4E 20

From which the following references:

A pine 8-inches in diameter bears N 30° 54' E 29.60 feet distant. Scribed figures 4E visible within a single blaze.

A fir 13-inches in diameter bears S 80° 02' E 19.70 feet distant. No scribing visible within a single blaze.

A pine 14-inches in diameter bears S 68° 07' W 14.30 feet distant. Scribed figures 35S R4E S visible within a single blaze.

A pine 10-inches in diameter bears N 28° 21' W 47.60 feet distant. No scribing visible within a single blaze.

The quarter corner common to Sections 20 and 29, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I found a standard Jackson County Surveyor's brass cap marked:

Jackson County

T35S R4E

¼S $\frac{20}{29}$ 1975

From which the following references:

The stump remains of an original bearing tree 30-inches in diameter bears N 13° E 6.40 feet distant.

A fir 14-inches in diameter bears S 32° 16' W 49.00 feet distant. Scribing illegible on a pitched over double blaze.

A fir 18-inches in diameter bears N 21° 41' W 10.70 feet distant. Scribing illegible on a partly healed double blaze.

The quarter corner common to Sections 19 and 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I found a standard BLM brass cap marked:

U. S. Dept. of Interior
Unlawful to disturb

T35S R4E

¼

S19 | S20

1967

Cadastral Survey
Bureau of Land Management

From which the following references:

A pine 6-inches in diameter bears S74° 05' E 16.50 feet distant. No scribing visible within a healed single blaze.

A pine 16-inches in diameter bears S 65° 38' W 12.00 feet distant. No scribing visible within a healed single blaze.

The section corner common to Sections 17, 18, 19 and 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I found a standard BLM monument marked:

U. S. Dept. of Interior
Unlawful to disturb

T35S R4E

S18	S17
S19	S20

1967

Cadastral Survey
Bureau of Land Management

From which the following references:

A pine 11-inches in diameter bears N 57° 44' E 13.70 feet distant. Healed blaze.

A pine 30-inches in diameter bears N 67° 18' E 35.00 feet distant. Original bearing tree.

A pine 14-inches in diameter bears S 62° 53' E 23.00 feet distant. Healed blaze.

An oak 15-inches in diameter bears S 9° 57' E 69.50 feet distant.

A fir 10-inches in diameter bears S 12° 41' W 48.60 feet distant. Healed blaze.

A pine 13-inches in diameter bears N 66° 37' W 30.30 feet distant. Healed blaze.

The quarter corner common to Section 17 and 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I found a standard Jackson County Surveyor's brass cap marked:

Jackson County

T35S R4E

¼ S $\frac{17}{20}$

1975

From which the following references:

A fir 12-inches in diameter bears N 9° 07' E 33.30 feet distant.

A fir 47-inches in diameter bears S 32° 43' E 30.80 feet distant.

A fir 15-inches in diameter bears S 66° 35' E 21.40 feet distant.

The section corner common to Sections 16, 17, 20 and 21, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I found a standard BLM brass cap marked:

U. S. Dept of Interior
Unlawful to disturb

T35S R4E

S17	S16
S20	S21

1967

Cadastral Survey
Bureau of Land Management

From which the following references:

A Douglas-fir 12-inches in diameter bears N 63° 49' E 28.60 feet distant. No scribing visible within a healed single blaze.

A Douglas-fir 14-inches in diameter bears S 18° 33' E 20.40 feet distant. Scribed figures 4 S21 visible within a single healed blaze.

A Douglas-fir 19-inches in diameter bears S 13° 27' W 17.20 feet distant. Scribing illegible within a partly healed blaze.

A Douglas-fir 7-inches in diameter bears N 30° 55' W 24.60 feet distant. Healed single blaze.

The quarter corner common to Sections 20 and 21, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I found a standard BLM brass cap marked:

U. S. Dept of Interior
Unlawful to disturb

T35S R4E

	¼
S20	S21

1967

Cadastral Survey
Bureau of Land Management

AFFIDAVIT OF CORRECTION
O.R. 93-26993.

From which the following references:

A FIR STUMP, SIZE INDETERMINATE, BRS. S80°00'E, 8.5 FEET DIST. WITH FRAGMENTARY SCRIBING "B.T." VISIBLE ON A DECAYED FACE.

Incense 13"

A cedar ~~6~~ inches in diameter bears N ~~63° 03'~~ 81° 10' E 20.80 feet distant. ~~Scribing illegible within~~ a ~~partly~~ healed blaze.

A Douglas-fir ~~10~~ 17 inches in diameter bears S 27° 41' W 29.40 feet distant, ~~Scribing BT partly visible within a single blaze.~~ WITH A HEALED BLAZE.

The section corner common to Sections 20, 21, 28 and 29, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I found a standard BLM brass cap marked:

U. S. Dept. of Interior
Unlawful to disturb

T35S	R4E
S20	S21
S29	S28

1967

Cadastral Survey
Bureau of Land Management

From which the following references:

A fir 9-inches in diameter bears N 00° 27' W 39.10 feet distant. Healed blaze.

A fir 7-inches in diameter bears S 00° 26' E 5.50 feet distant. Scribed figures T35S R4E S 28 BT visible on a pitched over blaze.

A pine 48-inches in diameter bears S 57° 35' W 13.50 feet distant. Scribing illegible on a partly healed blaze.

A fir 12-inches in diameter bears N 53° 12' W 45.90 feet distant. Scribed figures T35S R4E S 20 BT visible in a partly healed blaze.

CORNERS ESTABLISHED THIS SURVEY

South one-sixteenth corner common to Section 19 and 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I set, in a 3½-foot diameter by 2 foot high mound of stone, a 2½-inch in diameter by 30-inch long iron post with a 2½-inch in diameter brass cap marked:

T35S R4E WM

S19 | S20

S 1/16

LS 1071

1979

From which the following references:

A pine 14-inches in diameter bears N 59° 19' E 28.90 feet distant. Scribed S 1/16 S 20 LS 1071 BT on a double blaze.

A pine 8-inches in diameter bears S 59° 00' W 60.20 feet distant. Scribed S 1/16 S 19 LS 1071 BT on a double blaze.

North one-sixteenth corner common to Section 19 and 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner location I set, in a mound of stone, a 2½-inch in diameter by 30-inch long iron post with a 2½-inch in diameter brass cap marked:

T35S R4E WM

N 1/16

S19 • —— S20

LS 1071

1979

From which the following references:

A Douglas-fir 11-inches in diameter bears N 78° 23' E 3.20 feet distant. Scribed N 1/16 S 20 LS 1071 BT on a double blaze.

A pine 13-inches in diameter bears N 77° 35' W 10.40 feet distant. Scribed N 1/16 S 19 LS 1071 BT on a double blaze.

West one-sixteenth corner common to Sections 17 and 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner position I set a 2½-inch in diameter by 30-inch long iron post with a 2½-inch in diameter brass cap marked:

T35S R4E WM

S17 —— W 1/16

S20

LS 1071

1979

From which the following references:

A fir 7-inches in diameter bears S 43° 00' E 9.3 feet distant. Scribed W 1/16 S 20 LS 1071 BT on a double blaze.

A Douglas-fir 10-inches in diameter bears N 27° 08' E 13.20 feet distant. Scribed W 1/16 S 17 LS 1071 BT on a double blaze.

The north one-sixteenth corner common to Section 20 and 21, Township 35 South, Range 4 East, Willamette Meridian.

At the corner position I set a 2½-inch in diameter by 30-inches long iron post with a 2½-inch in diameter brass cap marked:

T35S R4E WM

N 1/16

S20 — | S21

LS 1071

1979

From which the following references:

A pine 17-inches in diameter bears N 65° 20' E 29.00 feet distant. Scribed N 1/16 S 21 LS 1071 BT.

A pine 14-inches in diameter bears N 83° 50' W 39.50 feet distant. Scribed N 1/16 S 20 LS 1071 BT.

The Center-East one-sixteenth corner of Section 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner position I set a 2½-inch in diameter by 30-inches long iron post with a 2½-inch in diameter brass cap marked:

T35S R4E WM

CE 1/16

S20 —
|
LS 1071

1979

From which the following references:

A cedar 6-inch in diameter bears S 47° 38' E 7.30 feet distant. Scribed CE 1/16 S 20 LS 1071 BT on a double blaze.

A pine 6-inches in diameter bears S 49° 03' W 20.70 feet distant. Scribed CE 1/16 S 20 LS 1071 BT on a double blaze.

The southeast one-sixteenth corner of Section 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner position I set a 2½-inch in diameter by 30-inches long iron post with a 2½-inch in diameter brass cap marked:

T35S R4E WM

S20

SE 1/16
|
LS 1071

1979

From which the following references:

A Douglas-fir 13-inches in diameter bears S 66° 51' E 24.50 feet distant. Scribed SE 1/16 S 20 LS 1071 BT on a double blaze.

A Douglas-fir 7-inches in diameter bears S 26° 35' W 21.80 feet distant. Scribed SE 1/16 S 20 LS 1071 BT on a double blaze.

The center-south one-sixteenth corner of Section 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner position I set a 2½-inch in diameter by 30-inches long iron post with a 2½-inch in diameter brass cap marked:

T35S R4E WM

S20

CS 1/16
|
LS 1071

1979

From which the following references:

A fir 11-inches in diameter bears N 82° 48' E 79.50 Feet distant. Scribed CS 1/16 S 20 LS 1071 BT on a double blaze.

A Douglas-fir 9-inches in diameter bears S 3° 16' E 62.30 feet distant. Scribed CS 1/16 S 20 LS 1071 BT on a double blaze.

The northwest one-sixteenth corner of Section 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner position I set a 2-inch in diameter by 30-inches long iron post with 2½-inch in diameter brass cap marked:

T35S R4E WM

NW 1/16

S20
|
LS 1071

1979

From which the following references:

A pine 10-inches in diameter bears S 64° 10' W 32.20 feet distant. Scribed NW 1/16 S 20 LS 1071 BT on a double blaze.

A pine 7-inches in diameter bears N 46° 09' W 14.70 feet distant. Scribed NW 1/16 S 20 LS 1071 BT on a double blaze.

The center-north one-sixteenth corner of Section 20, Township 35 South, Range 4 East, Willamette Meridian.

At the corner position I set a 2½-inch in diameter by 30-inches long iron post with a 2½-inch in diameter brass cap marked:

T35S R4E WM

CN 1/16

S20

LS 1071

1979

From which the following references:

A pine 12-inches in diameter bears S 36° 01' W 35.50 feet distant. Scribed CN 1/16 S 20 LS 1071 BT on a double blaze.

A pine 27-inches in diameter bears N 53° 55' E 46.50 feet distant. Scribed CN 1/16 S 20 LS 1071 BT on a double blaze.

October 19, 1979

HAROLD L. CENTER
Registered Professional Land Surveyor
Oregon Certificate No. 1071

REGISTERED
PROFESSIONAL
LAND SURVEYOR
OREGON
HAROLD L. CENTER
JULY 30, 1974
No. 1071

JACKSON COUNTY
RECEIVED
DEC 6 1979
SURVEYOR

93-26993

5.00
6.00
10:44

AFFIDAVIT OF CORRECTION
pursuant to ORS 209.255

8123

I, Harold L. Center, Registered Professional Land Surveyor in the State of Oregon, Certificate No. 1071 do hereby state that I have discovered errors and omissions on that survey filed as Record Survey No. 8123 on October 19, 1979 with the Jackson County Surveyor. The corrections are as follows:

The one-quarter corner for sections 20 and 21, Township 35 South, Range 4 East, Willamette Meridian, Jackson County, Oregon. An error was found in the calculations for the directions to two bearing trees. An omission of the last remaining original bearing tree was also discovered. The corrected description is as follows:

An Incense cedar, 13 ins. diam., brs. N. 81°10′ E., 20.8 ft. dist., mkd. with a healed blaze.

A Douglas fir, 17 ins. diam., brs. S. 45°48′ W., 29.4 ft. dist., mkd. with a healed blaze.

A fir stump, size indeterminate, brs. S. 80°00′E., 8.5 ft. dist, with fragmentary scribing "BT" visible on a decayed face.

REGISTERED PROFESSIONAL LAND SURVEYOR
OREGON
JULY 30, 1974
HAROLD L. CENTER
No. 1071

STATE OF OREGON)
County of Jackson)

June 16 A.D., 1993.

Personally appeared the above named Harold L. Center, a Registered Professional Land Surveyor, and acknowledged the foregoing instrument to be his voluntary act and deed.

Before Me:

KATHLEEN E. PETERSON
NOTARY PUBLIC - OREGON
My Commission Expires 4/19/94

Kathleen E. Peterson
Notary Public for the State of Oregon
My commission expires 4/19, 1994.

I, Verlyn Thomas, Jackson County Surveyor, hereby certify that I have examined this Affidavit of Correction, and that the changes are permitted in accordance with the Oregon Revised Statutes 209.255.

Verlyn Thomas, Jackson County Surveyor

Jackson County, Oregon
Recorded
OFFICIAL RECORDS

10:44 AUG 16 1993 HM

KATHLEEN S. BECKETT
CLERK and RECORDER
By Barbara Kelley Deputy

Posted