


MAP OF SURVEY  
FOR  
ROGUE RIVER NATIONAL FOREST  
P.O. BOX 520  
MEDFORD, OREGON  
DECEMBER 23, 1982

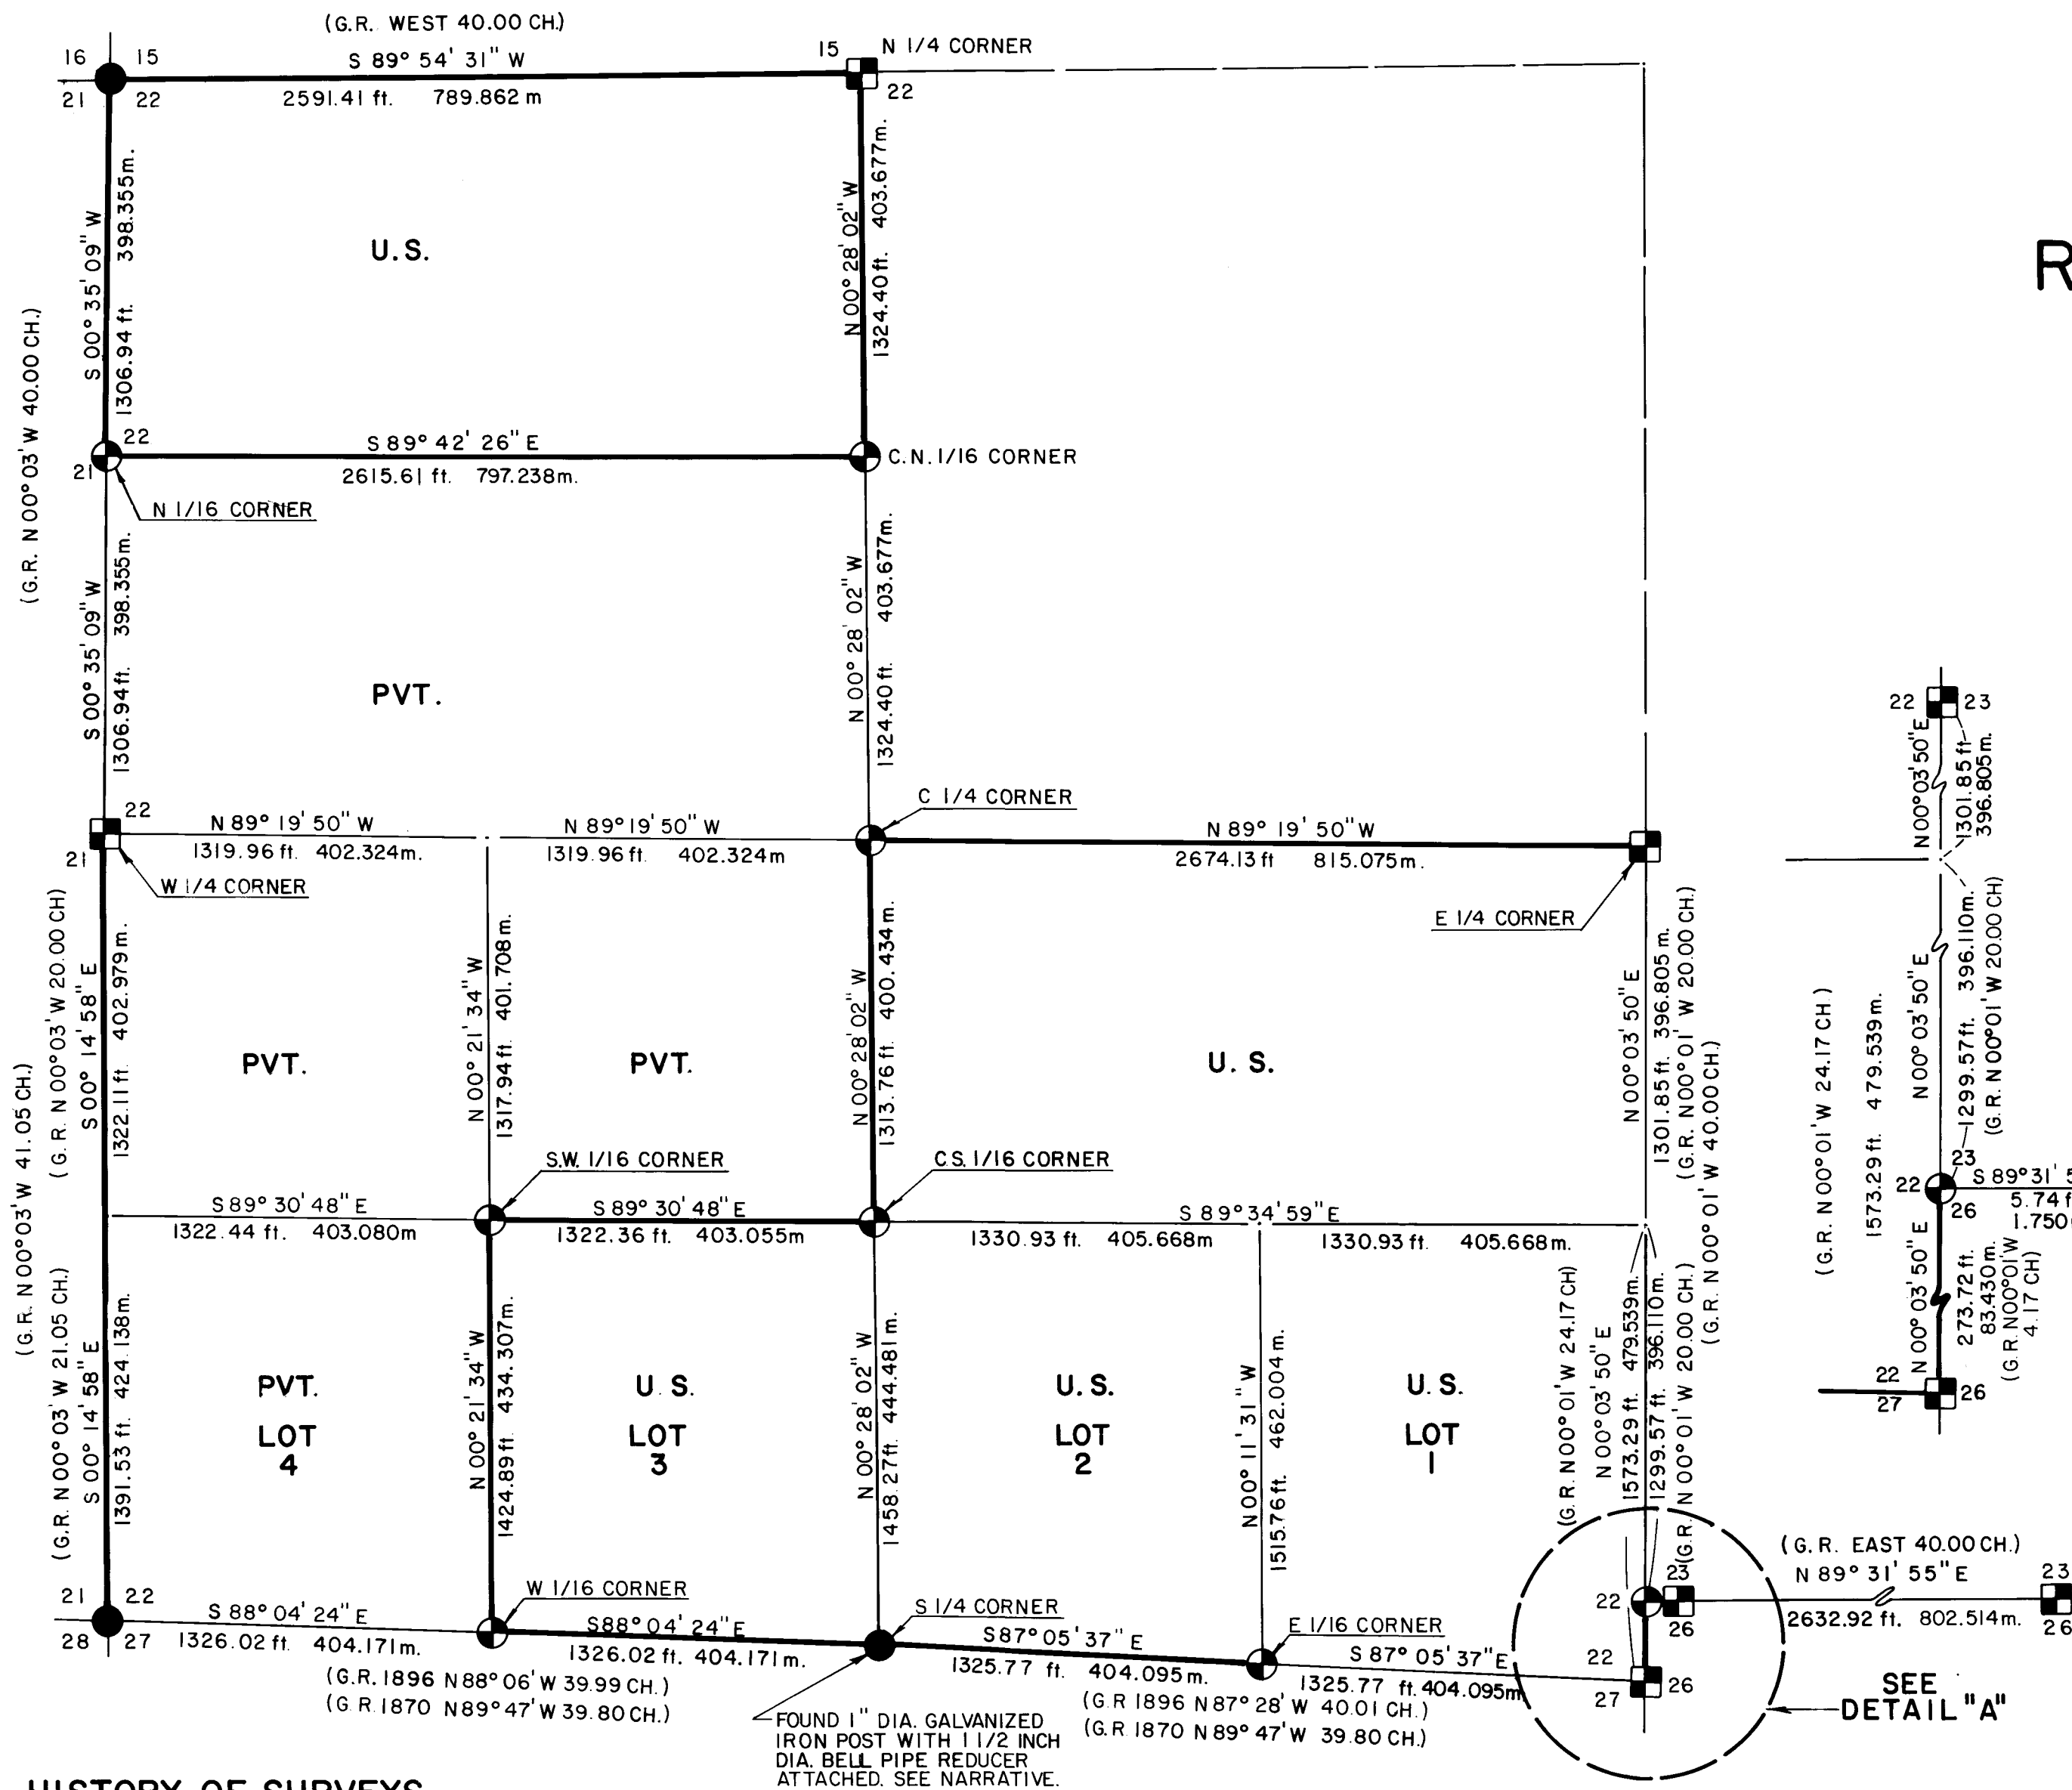

DETAIL "A"  
NOT TO SCALE

FOUND BRASS CAP MONUMENT  
SET RECORD SURVEY No. 8914

- LEGEND**
- FOUND STANDARD B.L.M. OR COUNTY SURVEYOR BRASS CAP MONUMENT UNLESS OTHERWISE SPECIFIED.
  - ⊕ SET 2 1/2" x 30" LG. IRON POST WITH 2 1/2" DIA. BRASS CAP.
  - FOUND BRASS CAP MONUMENT SET RECORD LAND SURVEY 759, UNLESS OTHERWISE NOTED.
  - PROPERTY LINE MARKED AND POSTED.
  - SECTION LINE CALCULATED FROM TRAVERSE SURVEY.

**HISTORY OF SURVEYS**

The South and West boundaries of Section 22 were established by William Turner and James Howard, Deputy Surveyors, under Contract No. 142 dated September 9, 1870.

The East and North boundaries were established and the South and West boundaries of Section 22 retraced by Peter Applegate, Deputy Surveyor, under Contract No. 651 dated April 25, 1896. Surveyor Applegate also established the line common to Sections 23 and 26.





Original corner points were remonumented by the Jackson County Surveyor and Everett L. Swain Registered Professional Land Surveyor No. 759 (reference, Jackson County Surveyor Record File No 5796).

The section line common to Sections 23 and 26 was retraced by Kurt Weaver, Registered Professional Land Surveyor No. 1679. Surveyor Weaver reestablished the one quarter corner common to Sections 23 and 26 (reference, Jackson County Surveyor Record File No 8914).



No other Surveys of Record were noted.

**CERTIFICATE OF SURVEY**

I, Harold L. Center, Registration No. 1071 Registered Professional Land Surveyor, State of Oregon, hereby certify that this plat correctly represents a survey made by me or under my direction in conformance with the laws of the State of Oregon, at the request of the U.S. Forest Service.

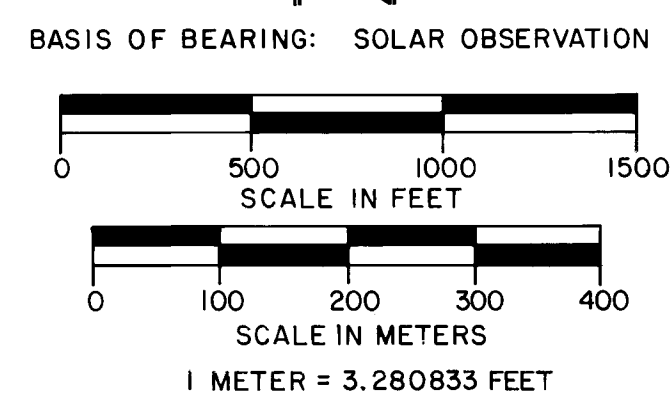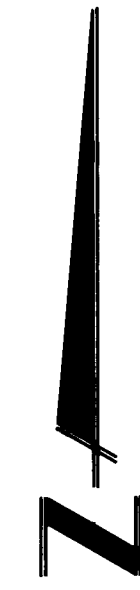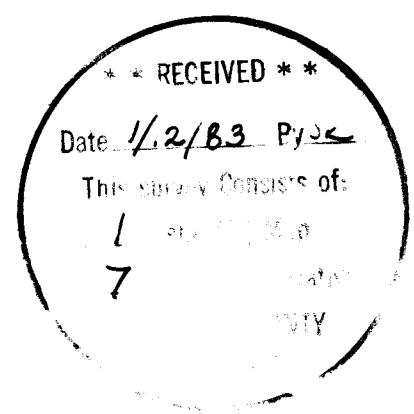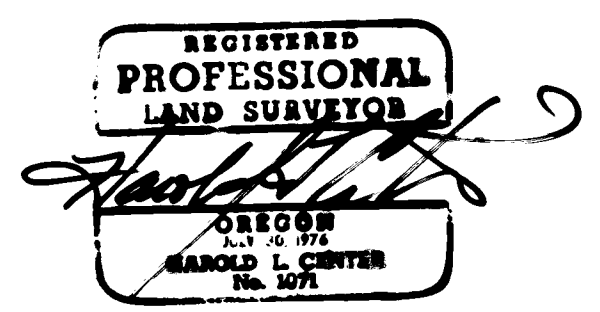

U.S. DEPARTMENT OF AGRICULTURE FOREST SERVICE REGION 6 ROGUE RIVER NATIONAL FOREST	
DEPENDENT RESURVEY AND SECTION SUBDIVISION SECTION 22, T. 32S., R. 2E., W.M. JACKSON COUNTY, OREGON	
REVIEWED BY: <i>Donald W. Smith</i>	DATE: 1/7/83
REVIEWED BY: <i>R. J. Atkinson</i>	DATE: 1/10/82

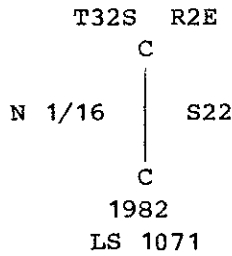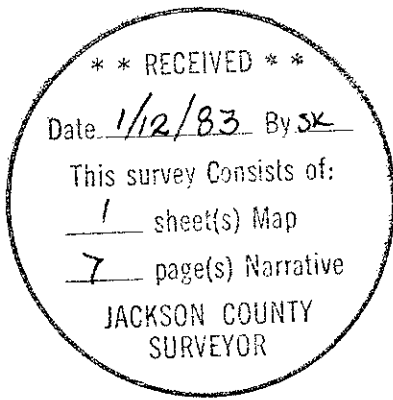


And the following references:

A 17-inch diameter cedar bears S 49° 05' W, 99.50 feet distance.  
Scribed CN 1/16 S22 LS 1071 BT.

A 10-inch diameter fir bears N 70° 57' W, 66.95 feet distance. Scribed  
CN 1/16 S22 LS 1071 BT.

Center-South one-sixteenth corner Section 22, Township 32 South, Range 2 East.

At the corner point I set a 2 1/2-inch diameter galvanized iron post with a 2 1/2-inch diameter brass cap marked:

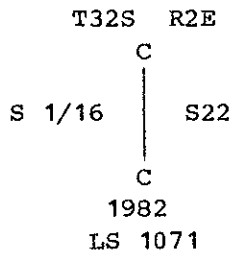


And the following references:

A 6-inch diameter cedar bears N 57° 16' E, 22.10 feet distance.  
Scribed CS 1/16 S22 LS 1071 BT.

A 15-inch diameter fir bears S 01° 16' E, 27.50 feet distance. Scribed  
CS 1/16 S22 LS 1071 BT.

Southwest one-sixteenth corner Section 22, Township 32 South, Range 2 East.

At the corner point I set a 2 1/2-inch diameter galvanized iron post with a 2 1/2-inch diameter brass cap marked:

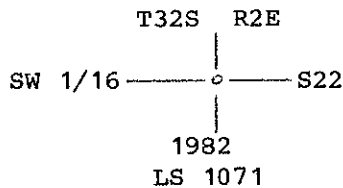

And the following references:

An 8-inch diameter fir bears S 26° 12' W, 32.55 feet distance. Scribed  
SW 1/16 S22 LS 1071 BT.

A 9-inch diameter fir bears N 88° 21' W, 11.20 feet distance. Scribed  
SW 1/16 S22 LS 1071 BT.

December 23, 1982

HAROLD L. CENTER  
Registered Professional Land Surveyor  
Oregon Certificate No. 1071



T32S R2E  
E 1/16  $\frac{S22}{S27}$   
1982  
LS 1071

And the following references:

An 18-inch diameter fir bears N 62° 07' W, 11.20 feet distance.  
Scribed E 1/16 S22 LS 1071 BT.

An 8-inch diameter fir bears S 00° 23' E, 55.70 feet distance. Scribed  
E 1/16 S27 LS 1071 BT.

Closing section corner common to Sections 22, 23 and 26, Township 32 South,  
Range 2 East.

At the corner point I set a 2<sup>1</sup>/<sub>2</sub>-inch diameter galvanized iron post with a  
2<sup>1</sup>/<sub>2</sub>-inch diameter brass cap marked:

T32S  
S22  $\left| \begin{array}{c} S23 \\ S26 \end{array} \right.$  CC  
R2E  
1982  
LS 1071

And the following references:

A 5-inch diameter fir bears S 03° 57' E, 9.60 feet distance. Scribed X  
BT.

A 23-inch diameter fir bears N 26° 10' E, 15.40 feet distance. Scribed  
CC T32S R2E S23 BT.

Center one-quarter corner Section 22, Township 32 South, Range 2 East.

At the corner point I set a 2<sup>1</sup>/<sub>2</sub>-inch diameter galvanized iron post with a  
2<sup>1</sup>/<sub>2</sub>-inch diameter brass cap marked:

T32S R2E  
C<sup>1</sup>/<sub>4</sub> ———— | ———— S22  
1982  
LS 1071

And the following references:

A 9-inch diameter fir bears S 81° 14' E, 130.91 feet distance. Scribed  
C<sup>1</sup>/<sub>4</sub> S22 LS 1071 BT.

A 12-inch diameter fir bears S 24° 03' W, 121.59 feet distance.  
Scribed C<sup>1</sup>/<sub>4</sub> S22 LS 1071 BT.

Center-North one-sixteenth corner Section 22, Township 32 South, Range 2  
East.

At the corner point I set a 2<sup>1</sup>/<sub>2</sub>-inch diameter galvanized iron post with a  
2<sup>1</sup>/<sub>2</sub>-inch diameter brass cap marked:

And the following references:

A 14-inch diameter fir bears S 30° 28' W 36.14 feet distance with partial scribe visible.

A 32-inch diameter fir snag bears S 45° 05' W 36.11 feet distance with a healed blaze.

A 33-inch diameter cedar bears N 10° 37' E 44.98 feet distance with a healed blaze.

CORNERS ESTABLISHED THIS SURVEY

North one-sixteenth corner common to Sections 21 and 22, Township 32 South, Range 2 East.

At the corner point I set a 2½-inch diameter galvanized iron post with a 2½-inch diameter brass cap marked:

T32S R2E  
N 1/16  
S21 | S22  
1982  
LS 1071

Special Note - Corner monument set in large mound of stone. Set P-K nail in bedrock beneath iron post to mark corner point.

And the following references:

A 15-inch diameter fir bears N 69° 10' W, 16.90 feet distance. Scribed N 1/16 S21 LS 1071 BT.

A 10-inch diameter fir bears N 37° 59' E, 9.90 feet distance. Scribed N 1/16 S22 LS 1071 BT.

West one-sixteenth corner common to Sections 22 and 27, Township 32 South, Range 2 East.

At the corner point I set a 2½-inch diameter galvanized iron post with a 2½-inch diameter brass cap marked:

T32S R2E  
W 1/16  $\frac{22}{27}$   
1982  
LS 1071

And the following references:

A 34-inch diameter fir bears N 16° 30' E, 19.80 feet distance. Scribed W 1/16 S22 LS 1071 BT.

A 7-inch diameter fir bears S 54° 12' E, 112.10 feet distance. Scribed W 1/16 S27 LS 1071 BT.

East one-sixteenth corner common to Sections 22 and 27, Township 32 South, Range 2 East.

At the corner point I set a 2½-inch diameter galvanized iron post with a 2½-inch diameter brass cap marked:

And the following references:

A 65-inch diameter fir bears N 30° 28' E 32.90 feet distance with a healed blaze.

A 40-inch diameter fir stump bears S 12° 59' E 32.10 feet distance. Scribe BT visible.

A 27-inch diameter fir bears S 13° 33' W 7.30 feet distance with a healed blaze.

A 72-inch diameter pine bears S 37° 37' W 57.60 feet distance with a healed blaze. (This tree is now dead.)

A 32-inch diameter fir bears N 76° 24' W 27.50 feet distance with a healed blaze.

Section corner common to Sections 22, 23 and 26, Township 32 South, Range 2 East.

At the corner point I found a 1-inch diameter galvanized iron post with a 2 1/2-inch diameter brass cap marked:

Swain Surveying  
T32S R2E  
S22 | S23  
     | S26  
PLS 759  
Survey Monument 1974

And the following references:

A 23-inch diameter fir bears N 53° 22' E 11.50 feet distance with a healed blaze.

A 45-inch diameter fir bears S 24° 16' E 128.27 feet distance with partial scribe visible.

A 13-inch diameter fir bears S 13° 46' E 43.20 feet distance with partial scribe visible.

Note: This corner was found N 89° 31' 55" E 5.74 feet distance from closing to easterly boundary of Section 22. This corner is recognized as a closing corner and held for alignment on the line between Sections 23 and 26.

One-quarter corner common to Sections 22 and 23, Township 32 South, Range 2 East.

At the corner point I found a 1-inch diameter galvanized iron post with a 2 1/2-inch diameter brass cap marked:

Swain Surveying  
T32S R2E  
      1/4  
S22 | S23  
PLS 759  
Survey Monument 1974

At the corner point I found a standard Jackson County Surveyors brass cap monument marked:

Jackson County  
 T32S R2E

21	22
28	27

1981

And the following references:

A 9-inch diameter fir bears S 84° 13' E 16.60 feet distance. Scribe CS-BT visible.

A 31-inch diameter fir stump bears S 76° 51' E 22.60 feet distance with open blaze and partial scribe visible.

A 17-inch diameter fir bears S 28° 22' W 48.70 feet distance with a healed blaze.

A 28-inch diameter hemlock bears N 42° 21' W 33.50 feet distance with partial scribe visible.

An 11-inch diameter fir bears N 11° 09' E 34.80 feet distance. Scribe CS-BT visible.

An 18-inch diameter fir stump bears N 44° 22' E 43.20 feet distance with scribe T visible.

One-quarter corner common to Sections 22 and 27, Township 32 South, Range 2 East.

At the corner point I found a 1-inch diameter galvanized iron post with a 1 1/2-inch bell pipe reducer filled with pot metal marked:

T32S R2E

22
+
27

1/4 COR  
1960

And the following references:

A 12-inch diameter hemlock bears N 03° 27' W 28.42 feet distance. Scribe CS-BT visible.

A 24-inch diameter hemlock bears N 89° 19' E 55.00 feet distance. Scribe CS-BT visible.

A 16-inch diameter hemlock bears S 72° 22' E 5.60 feet distance with bark scribe 1/4 BT visible.

A 25-inch diameter fir bears S 34° 13' W 5.90 feet distance with bark scribe 1/4 S2 BT visible.

Section corner common to Sections 22, 26 and 27, Township 32 South, Range 2 East.

At the corner point I found a 1-inch diameter galvanized iron post with a 2 1/2-inch diameter brass cap marked:

Swain Surveying  
 T32S R2E


S22	S26
S27	

PLS759  
 Survey Monument 1974

A 28-inch diameter cedar bears N 69° 46' E 12.40 feet distance with a healed blaze.

Section corner common to Sections 15, 16, 21 and 22, Township 32 South, Range 2 East.

At the corner point I found a standard Jackson County Surveyors brass cap monument marked:

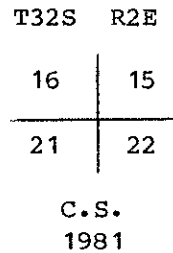

And the following references:

A 4-inch diameter fir bears N 13° 50' W 61.50 feet distance. Scribe CS-BT visible.

A 26-inch diameter fir bears N 36° 24' E 30.24 feet distance with a healed blaze.


A 9-inch diameter fir bears S 29° 16' E 44.90 feet distance. Scribe CS-BT visible.

A 19-inch diameter fir stump (stump has been disturbed by logging) bears S 13° 59' W 18.70 feet distance with scribe visible.

A 9-inch diameter yew bears N 89° 40' W 42.60 feet distance. Scribe CS-BT visible.

One-quarter corner common to Sections 21 and 22, Township 32 South, Range 2 East.

At the corner point I found a 1-inch diameter galvanized iron post with a 2 1/2-inch diameter brass cap marked:

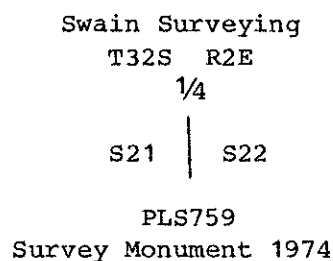

And the following references:

An 18-inch diameter fir bears N 54° 45' E 67.60 feet distance with a healed blaze.

A 19-inch diameter fir bears N 77° 07' E 28.80 feet distance with opened healed blaze.

A 23-inch diameter fir bears N 65° 00' W 30.20 feet distance with a healed blaze.

Section corner common to Sections 21, 22, 27 and 28, Township 32 South, Range 2 East.

SURVEY NARRATIVE TO COMPLY WITH  
PARAGRAPH 209.250 OREGON REVISED STATUTES

SURVEY FOR: Rogue River National Forest  
P. O. Box 520  
Medford, OR 97501

LOCATION: Section 22, Township 32 South, Range 2 East,  
Willamette Meridian, Jackson County, Oregon.

BASIS OF BEARING: Solar observation

PURPOSE: To monument property corners and mark and post  
National Forest boundaries within Section 22.

PROCEDURE: Prior to commencement of this survey, I performed  
an investigation of the controlling corners  
necessary for the subdivision of this section. All  
controlling corners had been remonumented from  
recovered original corner evidence. The North,  
West, East one-quarter corners and the Southeast  
section corner had been remonumented by Everett L.  
Swain, Registered Professional Land Surveyor  
No. 759.

Surveyor Swain also remonumented the closing corner  
common to Sections 22, 23 and 26. The Jackson  
County Surveyor had remonumented the Northwest,  
Southwest section corners and the South one-quarter  
corner.

With the required corner control verified, I per-  
formed a closed traverse tying each of the  
controlling corners. From this data I computed the  
subdivision of Section 22 and ran random traverse  
lines along interior lines closing each line to a  
part of a closed traverse. I then monumented pro-  
perty corners and posted property lines utilizing  
aluminum posts with National Forest boundary signs  
attached. Trees along the property lines were  
blazed and painted with red timber marking paint.

EQUIPMENT UTILIZED IN SURVEY:

This survey was performed utilizing a Wild T-2  
Theodolite and a Hewlett-Packard 3808 or Wild-DI4  
Electronic Distance Meter.

CORNERS ACCEPTED FOR CONTROL

One-quarter corner common to Sections 15 and 22, Township 32 South, Range 2  
East.

At the corner point I found a 1-inch diameter galvanized iron post with a  
2 1/2-inch diameter brass cap marked:

Swain Surveying

1/4  $\frac{S15}{S22}$

Survey Monument 1974

And the following references:

A 36-inch diameter fir bears S 73° 28' W 10.10 feet distance, bark  
scribed 1/4 S BT.