

RENEWAL OF 2 COUNTY SURVEYOR "INTERMEDIATE CORNERS"
 IN THE NW $\frac{1}{4}$ SE $\frac{1}{4}$ (ON THE NORTH-SOUTH CENTER LINE) OF
 SECTION 27, T32S, R3E, W.M.
 JACKSON CO., OREGON

December 12, 1983

Narrative Description only, of 2 existing corners and new accessories.



BY: Robert M. Thompson & Assoc., 1140 Acacia Lane, Grants Pass, OR. 97527

FOR: Boise Cascade Corp., Timber & Wood Prod. Group, P.O. Box 100, Medford, OR,
 97501

PURPOSE: To mark additional bearing trees at existing corners, to compensate for those cut during recent logging operations. Information for these corners was obtained from the Jackson County Surveyor files of "Intermediate Corners" set or perpetuated in 1929 and 1959. Measurements are to the original faces of the county's bearing trees, and to the centers of my new bearing trees. Corners are numbered as shown in my recent Survey No. 9775.

- 2) Found flush 1" I. Pipe w/expander top stamped "Ctr. $\frac{1}{4}$ Sec. 27 C.S. 1959", at cor. of fences running N'y, S'y, W'y, and existing bearing trees:
 25" D. Fir N 20 $\frac{1}{2}$ °E 34.2', scribe part vis., 1929, cut Dec. 1983, 4.5' high.
 21" W. Fir N 47°E 58.6', healed faces, cut Dec. 1983, 4.8' high.
 30" D. Fir S 12°E 59.5', healed face on old stump.
 Scribed new B.T.'s "C $\frac{1}{4}$ S27 1358 BT":
 10" I. Cedar S 83 $\frac{1}{2}$ °W 10.2'
 9" I. Cedar N 24°E 47.5'

- 3) Found 1" I. Pipe w/expander top 4" down, stamped "SW Cor. NW $\frac{1}{4}$ NW $\frac{1}{4}$ SE $\frac{1}{4}$ C.S. 1959", under corral fence brg. N 58°W, S 58°E, and existing bearing trees:
 33" Pine N 50 $\frac{1}{2}$ °E 25.8', scribe vis., 1929, cut Dec. 1983, 4.5' high.
 36" Cork Elm S 32 $\frac{1}{2}$ °W 128.1', scribe vis., 1929
 18" I. Cedar N 27°E 51.9', healed lower face, 1959, cut Dec. 1983, 1.6' high.
 Scribed new B.T.'s "CNS 1/64 1358 BT":
 13" I. Cedar N 58°E 38.9'
 10" I. Cedar N 11°E 29.6'

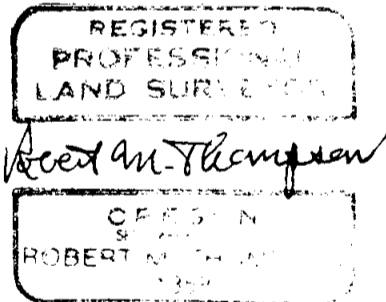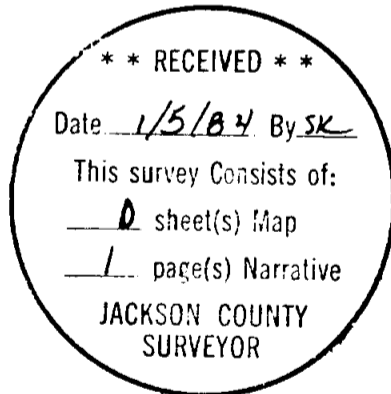

RENEWAL OF 2 COUNTY SURVEYOR "INTERMEDIATE CORNERS"
 IN THE NW $\frac{1}{4}$ SE $\frac{1}{4}$ (ON THE NORTH-SOUTH CENTER LINE) OF
 SECTION 27, T32S, R3E, W.M.
 JACKSON CO., OREGON

December 12, 1983

Narrative Description only, of 2 existing corners and new accessories.

BY: Robert M. Thompson & Assoc., 1140 Acacia Lane, Grants Pass, OR, 97527

FOR: Boise Cascade Corp., Timber & Wood Prod. Group, P.O. Box 100, Medford, OR,
 97501

PURPOSE: To mark additional bearing trees at existing corners, to compensate for those cut during recent logging operations. Information for these corners was obtained from the Jackson County Surveyor files of "Intermediate Corners" set or perpetuated in 1929 and 1959. Measurements are to the original faces of the county's bearing trees, and to the centers of my new bearing trees. Corners are numbered as shown in my recent Survey No. 9775.

- 2) Found flush 1" I. Pipe w/expander top stamped "Ctr. $\frac{1}{4}$ Sec. 27 C.S. 1959", at cor. of fences running N'ly, S'ly, W'ly, and existing bearing trees:
 - 25" D. Fir N 20 $\frac{1}{2}$ °E 34.2', scribe part vis., 1929, cut Dec. 1983, 4.5' high.
 - 21" W. Fir N 47°E 58.6', healed faces, cut Dec. 1983, 4.8' high.
 - 30" D. Fir S 12°E 59.5', healed face on old stump.
 - Scribed new B.T.'s "C $\frac{1}{4}$ S27 1358 BT":
 - 10" I. Cedar S 83 $\frac{1}{2}$ °W 10.2'
 - 9" I. Cedar N 24°E 47.5'

- 3) Found 1" I. Pipe w/expander top 4" down, stamped "SW Cor. NW $\frac{1}{4}$ NW $\frac{1}{4}$ SE $\frac{1}{4}$ C.S. 1959", under corral fence brg. N 58°W, S 58°E, and existing bearing trees:
 - 33" Pine N 50 $\frac{1}{2}$ °E 25.8', scribe vis., 1929, cut Dec. 1983, 4.5' high.
 - 36" Cork Elm S 32 $\frac{1}{2}$ °W 128.1', scribe vis., 1929
 - 18" I. Cedar N 27°E 51.9', healed lower face, 1959, cut Dec. 1983, 1.6' high.
 - Scribed new B.T.'s "CNS 1/64 1358 BT":
 - 13" I. Cedar N 58°E 38.9'
 - 10" I. Cedar N 11°E 29.6'

